



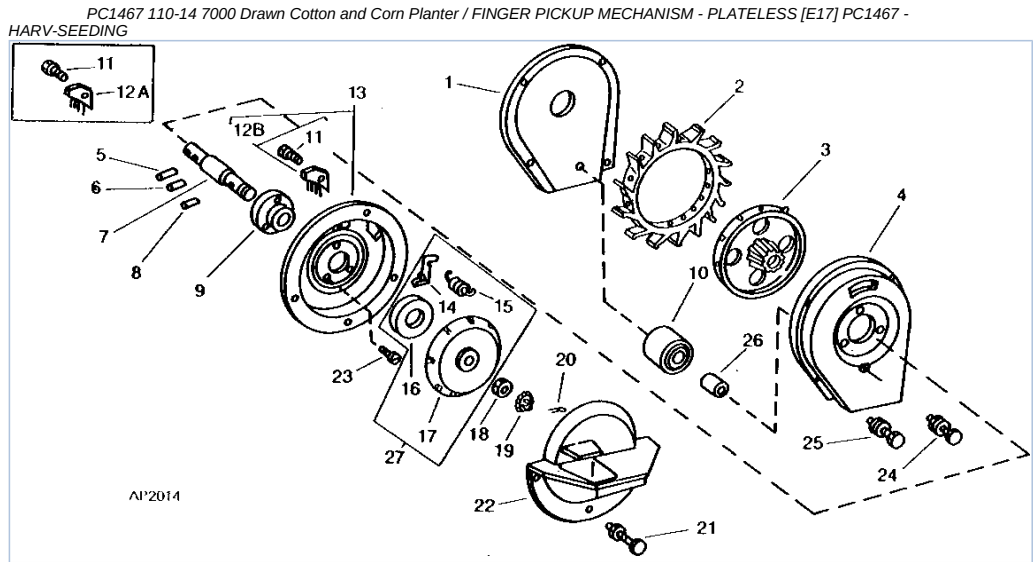

Список деталей

PC1467 110-14 7000 Drawn Cotton and Corn Planter / FINGER PICKUP MECHANISM -
PLATELESS [E17] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A22796	COVER	1		
2	A22451	BELTING	1		
3	A22795	DRIVER	1		
4	AA22780	HOUSING	1		
5	34H316	SPRING PIN	1		1/4" X 1-1/2"
6	34H286	SPRING PIN	1		3/16" X 1-1/2"
7	AA21289	BALL BEARING	1		
8	34H314	SPRING PIN	1		1/4" X 1-1/4"
9	A25542	HOUSING	1		
10	A22305	ROLLER	1		
11	21H1387	SCREW	1	_____-1978	0.190" X 3/4"
11	A33969	SCREW	1	1978-____	
12A	AA25234	BRUSH	1	_____-1978	
12A	AA26813	BRUSH	1	1978-1979	(SUB AA29838)
12A	AA29838	BRUSH	1	_____-1982	(SUB AA33839)
12B	AA33839	ASSEMBLY LINE PARTS	1	_____-1985	(SUB AA35660) INCLUDED TWO (2) BRUSH ASSEMBLIES
12B	AA35660	BRUSH	1		
13	A22797	PLANET PINION CARRIER	1	_____-1978	(SUB AA27850)
13	AA27850	PLANET PINION CARRIER	1	_____-1979	(SUB AA29839)
13	AA29839	PLANET PINION CARRIER	1	_____-1985	(SUB AA35644)
13	AA35644	CRADLE	1		
14	B30275	FINGER	12		(SUB A68331) CORN
14	A68331	FINGER	12		CORN
14	A37177	FINGER	12		SUNFLOWER
15	B31551	SPRING	12		
16	A22771	CAM	1		
17	A22307	HOLDER	1		
18	14H1041	NUT	1		5/8"
19	B31364	COVER	1		
20	11H268	COTTER PIN	1		5/32" X 1-1/4"
21	19H1919	CAP SCREW	3		1/4" X 5/8"
21	K40001	LOCK NUT	3		6.350 MM (1/4")
22	A25665	ISOLATOR	1	_____-1975	(SUB A30239)
22	A30239	ISOLATOR	1	_____-1978	(SUB A36243)
22	A48383	DEFLECTOR	1		(SUB FOR A36243)
23	21H1295	SCREW	3		0.190" X 5/8"
24	19H1727	CAP SCREW	1		1/4" X 1-1/2"
24	K40001	LOCK NUT	1		6.350 MM (1/4")
25	19H1227	CAP SCREW	4		1/4" X 1/2"
25	K40001	LOCK NUT	4		6.350 MM (1/4")
26	A21578	BUSHING	1		
27	AA31261	FINGER	1		CORN FINGER ASSEMBLY INCLUDES B30275 FINGERS
27	AA31262	FINGER	1		SUNFLOWER FINGER ASSEMBLY INCLUDES A37177

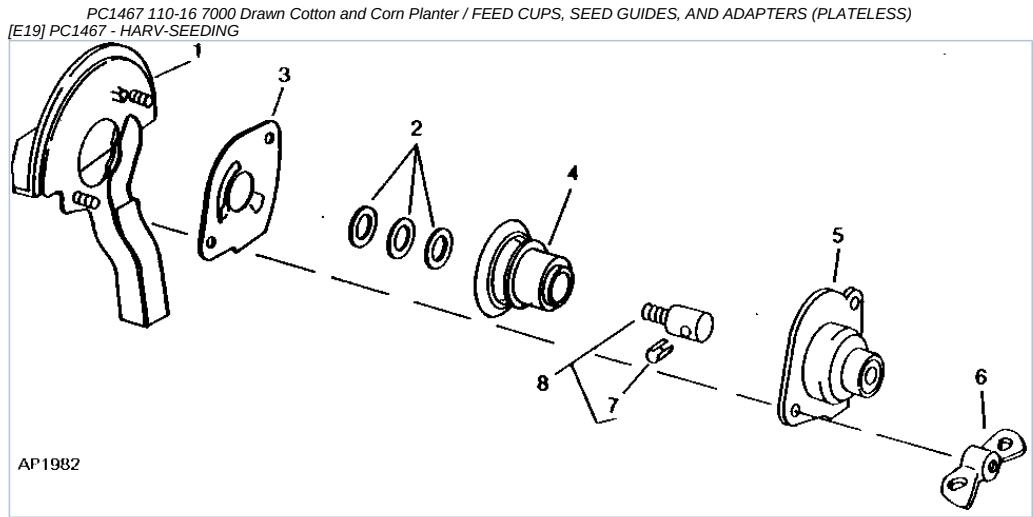


Список деталей

PC1467 110-16 7000 Drawn Cotton and Corn Planter / FEED CUPS, SEED GUIDES, AND ADAPTERS (PLATELESS) [E19] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA22897	ADAPTER FITTING	1	_____ 1977	(SUB AA27100)
1	AA27100	ADAPTER FITTING	1		
2	A25081	SHIM	1		LOW-RATE SORGHUM
3	A24641	PLATE	1	_____ 710100	SOYBEAN AND EDIBLE BEAN
3	A24682	REINFORCEMENT	1		REGULAR-RATE SORGHUM
3	A24659	PLATE	1	_____ 1978	(SUB A36323) LOW-RATE SORGHUM
3	A36323	PLATE	1		LOW-RATE SORGHUM AND SUNFLOWER
3	AA34798	PLATE	1	_____ 1989	(SUB A48005) SMALL SOYBEAN/ACID DELINTED COTTON SEED GUIDE AND RATE CHART ASSEMBLY
3	A48005	SEED PLATE	1		
4	AA22966	BOWL	1	_____ 1977	(SUB AA26713) SOYBEAN FEED
4	AA26713	BOWL	1	_____ 710100	SOYBEAN FEED
4	AA22971	BOWL	1	_____ 1980	(SUB AA30345) REGULAR-RATE SORGHUM FEED
4	AA30345	BOWL	1		(SUB AA29648) REGULAR-RATE SORGHUM FEED
4	AA29648	BOWL	1		REGULAR-RATE SORGHUM/MILO
4	AA22980	BOWL	1	_____ 1975	(SUB AA25319) LOW-RATE SORGHUM FEED
4	AA25319	BOWL	1		LOW-RATE MILO FEED
4	AA27934	BOWL	1	1978-	SUNFLOWER FEED
4	AA22976	BOWL	1	_____ 1977	(SUB AA26714) EDIBLE BEAN
4	AA26714	BOWL	1		EDIBLE BEAN
5	AA23367	HOUSING	1	_____ 1976	(SUB AA26409)
5	AA26409	HOUSING	1	_____ 1978	(SUB AA28036)
5	AA28036	HOUSING	1		FEED CUP
6	M47887	WING NUT	2		6.350 MM (1/4") (SUB FOR A23214)
7	34H316	SPRING PIN	1		1/4" X 1-1/2"
8	AA23366	STUD	1		

PC1467 110-17 7000 Drawn Cotton and Corn Planter / SUPPORT PANEL AND DRIVE CHAIN TIGHTENER (1.6 BU.
SEED HOPPER ONLY) [E20] PC1467 - HARV-SEEDING

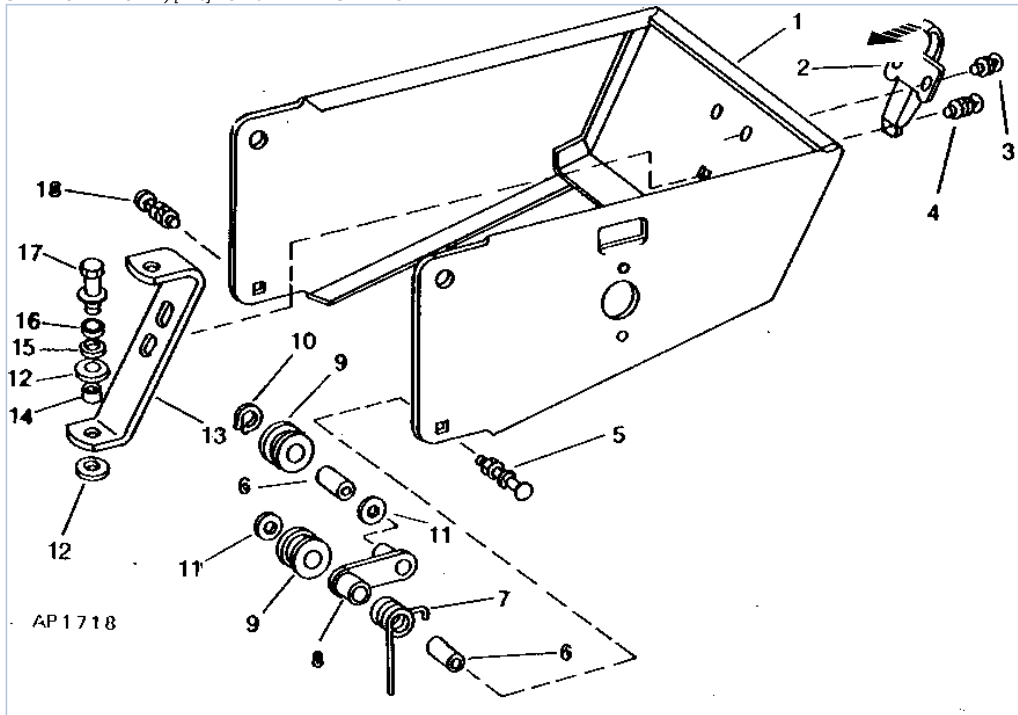


Список деталей

PC1467 110-17 7000 Drawn Cotton and Corn Planter / SUPPORT PANEL AND DRIVE
CHAIN TIGHTENER (1.6 BU. SEED HOPPER ONLY) [E20] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA22898	PANEL	1		
2	AA22119	LATCH	1		
3	03H2119	BOLT	2		1/4" X 5/8"
3	24H1287	WASHER	2	_____-1977	9/32" X 5/8" X 0.065"
3	N10217	LOCK NUT	1		6.350 MM (1/4")
4	03H1519	BOLT	2		3/8" X 1"
4	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
4	12H304	LOCK WASHER	2		3/8"
4	14H1076	NUT	2		3/8"
5	03H2023	BOLT	1		3/8" X 3-1/4"
5	12H304	LOCK WASHER	1	_____-1978	3/8"
5	14H1076	NUT	1	_____-1978	3/8"
5	K40003	LOCK NUT	1	1978-_____-	9.525 MM (3/8")
6	A22839	BUSHING	1	_____-064400	(SUB N120831)
6	N120831	SPACER	2		
7	A25368	SPRING	1	_____-1975	(SUB A28518)
7	A28518	TORSION SPRING	1		
8	A25369	ARM	1	_____-1986	(SUB A50564)
8	A50564	ARM	1		
9	A22838	IDLER	2	_____-705100	
10	B14203	SNAP RING	1		
11	24H1307	WASHER	2	064401-_____-	13/32" X 1" X 1/16"
11	24H1307	WASHER	1		13/32" X 1" X 1/16"
12	A24093	WASHER	2		(A) 16.662 X 31.750 X 3.175 MM (21/32" X 1-1/4" X 1/8")
13	A25659	BRACKET	1		
14	A24092	BUSHING	1		(A)
15	24H1307	WASHER	1		(A) 13/32" X 1" X 1/16"
16	12H304	LOCK WASHER	1		(A) 3/8"
17	19H1800	CAP SCREW	1		(A) 3/8" X 1-1/2"
17	24H1653	WASHER	1		(A) 13/32" X 1-1/4" X 0.120"
18	03H1480	BOLT	1		3/8" X 1-1/4"
18	12H304	LOCK WASHER	1		3/8"
18	14H1076	NUT	1		3/8"


PC1467 110-18 7000 Drawn Cotton and Corn Planter / SUPPORT PANEL AND DRIVE CHAIN TIGHTENER [E21] PC1467
- HARV-SEEDING

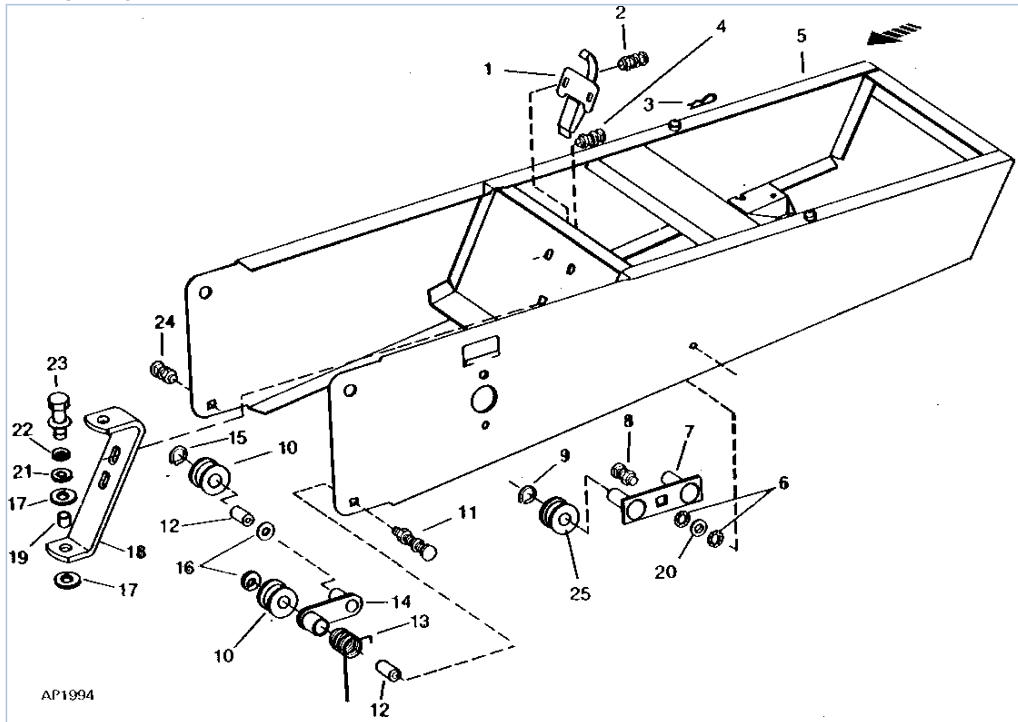

Список деталей

PC1467 110-18 7000 Drawn Cotton and Corn Planter / SUPPORT PANEL AND DRIVE
CHAIN TIGHTENER [E21] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA22119	LATCH	1		
2	03H2119	BOLT	2		1/4" X 5/8"
2	N10217	LOCK NUT	2		6.350 MM (1/4")
3	J16931	PIN	2		
4	03H1519	BOLT	2		3/8" X 1"
4	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
4	12H304	LOCK WASHER	2		3/8"
4	14H1076	NUT	2		3/8"
5	AA22050	SUPPORT	1	_____-1979	(SUB AA28976)
5	AA28976	SUPPORT	1		
6	12H335	LOCK WASHER	2		3/8"
7	AA24633	ARM	1		
8	03H1500	BOLT	1		3/8" X 1"
8	12H304	LOCK WASHER	1		3/8"
8	14H1076	NUT	1		3/8"
9	B14203	SNAP RING	2		
10	A22838	IDLER	2	_____-705100	
11	03H1836	BOLT	1		3/8" X 3-1/2"
11	K40003	LOCK NUT	1		9.525 MM (3/8")
12	N120831	SPACER	2		
13	A28518	TORSION SPRING	1		
14	A25369	ARM	1	_____-1986	(SUB A50564)
14	A50564	ARM	1		
15	B14203	SNAP RING	1		
16	24H1307	WASHER	2		13/32" X 1" X 1/16"
17	A24093	WASHER	3		21/32" X 1-1/4" X 1/8"
18	A25659	BRACKET	1		
19	A24092	BUSHING	1		
20	24H1308	WASHER	1		13/32" X 1" X 0.134"
21	24H1307	WASHER	1		13/32" X 1" X 1/16"
22	12H304	LOCK WASHER	1		3/8"
23	19H1800	CAP SCREW	1		3/8" X 1-1/2"
23	24H1653	WASHER	1		13/32" X 1-1/4" X 0.120"
24	03H1480	BOLT	1		3/8" X 1-1/4"
24	12H304	LOCK WASHER	1		3/8"
24	14H1076	NUT	1		3/8"
25	B30968	IDLER	1		

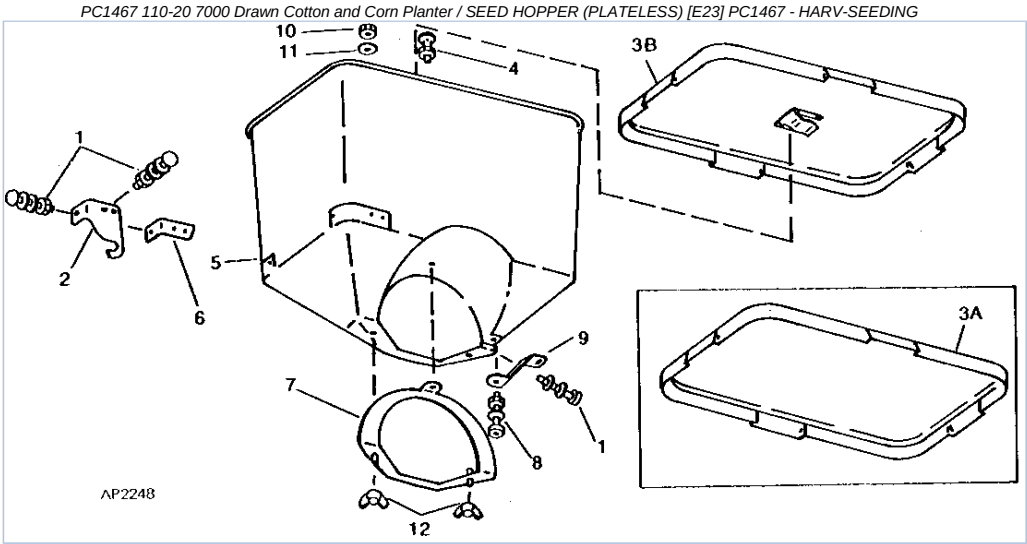


Список деталей

PC1467 110-20 7000 Drawn Cotton and Corn Planter / SEED HOPPER (PLATELESS) [E23]

PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1701	BOLT	7		1/4" X 3/4"
1	A21710	WASHER	7		
1	24H1646	WASHER	7		17/64" X 3/4" X 0.060"
1	N10217	LOCK NUT	7		6.350 MM (1/4")
2	A20166	BRACKET	1	_____-1977	(SUB A32984) R.H.
2	A32984	BRACKET	1		R.H.
2	A20167	BRACKET	1	_____-1977	(SUB A32985) L.H.
2	A32985	BRACKET	1		L.H.
3A	A20236	COVER	1	_____-1978	(SUB AA26827)
3B	AA26827	COVER	1		
4	03H1701	BOLT	1		1/4" X 3/4"
4	A21710	WASHER	1		
4	24H1646	WASHER	1		17/64" X 3/4" X 0.060"
4	N10217	LOCK NUT	1		6.350 MM (1/4")
5	A25663	HOPPER	1		
6	A21709	WEATHERSTRIP	2		
7	AA32075	RETAINER	1		(SUB FOR AA22896)
8	19H3295	SCREW	1		3/8" X 3/4"
8	24H1305	WASHER	1		13/32" X 13/16" X 0.065"
8	14H1076	NUT	1		3/8"
9	A25655	STRAP	1		
10	A22698	NUT	4		5/16"
11	A21710	WASHER	2		
12	M63594	WING NUT	2	_____-1985	7.925 MM (5/16") (SUB A22698, THIS APPLICATION)
12	A22698	NUT	2		7.925 MM (5/16")

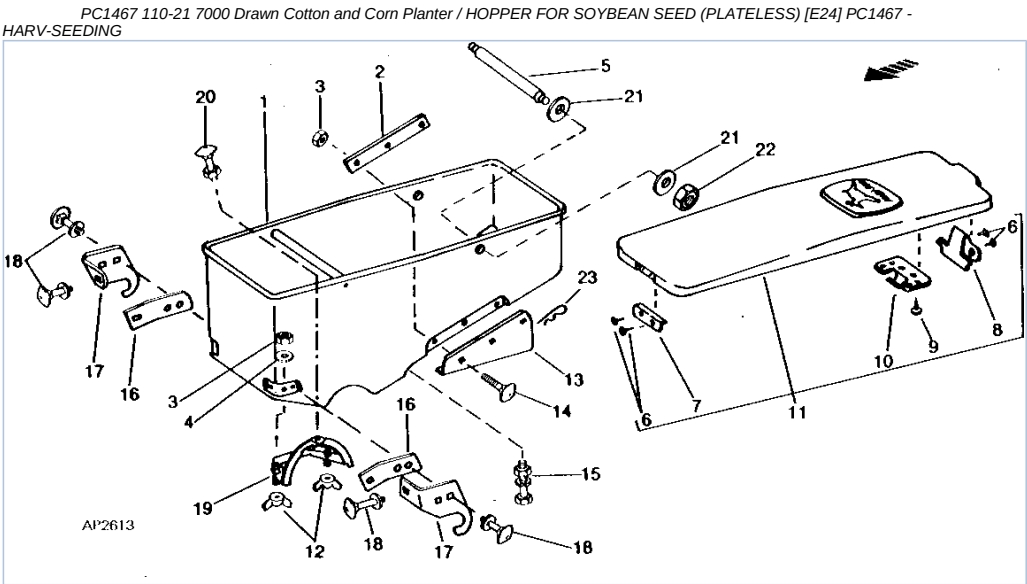


Список деталей

PC1467 110-21 7000 Drawn Cotton and Corn Planter / HOPPER FOR SOYBEAN SEED
(PLATELESS) [E24] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A38953	HOPPER	1		
2	A39489	STRAP	2		
3	A22698	NUT	8		5/16"
4	A21710	WASHER	2		
5	A43645	ROD	2		(SUB FOR A39505)
6	16H246	RIVET	4		3/16" X 3/8"
7	A40139	LATCH	1		
8	A25830	LATCH	1		
9	37H165	SCREW	4		NO. 10 X 3/4"
10	A33844	LATCH	1		
11	AA30461	COVER	1		
12	M63594	WING NUT	2	_____ -1985	7.925 MM (5/16") (SUB A22698, THIS APPLICATION)
12	A22698	NUT	2		7.925 MM (5/16")
13	A39474	SUPPORT	1		R.H.
13	A39475	SUPPORT	1		(ILLUSTRATED), L.H.
14	03H1540	BOLT	6		5/16" X 3/4"
15	19H3295	SCREW	1		3/8" X 3/4"
15	24H1307	WASHER	3		13/32" X 1" X 1/16"
15	14H1076	NUT	1		3/8"
16	A21709	WEATHERSTRIP	2		
17	A32984	BRACKET	1		R.H.
17	A32985	BRACKET	1		L.H.
18	03H1701	BOLT	6		1/4" X 3/4"
18	A21710	WASHER	6		
18	24H1646	WASHER	6		17/64" X 3/4" X 0.060"
18	N10217	LOCK NUT	6		6.350 MM (1/4")
19	AA32075	RETAINER	1		(SUB FOR AA22896)
20	03H1701	BOLT	1		1/4" X 3/4"
20	N10217	LOCK NUT	1		
20	24H1646	WASHER	1		17/64" X 3/4" X 0.060"
20	N10217	LOCK NUT	1		6.350 MM (1/4")
21	24H1287	WASHER	8		9/32" X 5/8" X 0.065"
22	14H786	NUT	4		1/4"
23	J16931	PIN	2		

PC1467 110-22 7000 Drawn Cotton and Corn Planter / SEED HOPPER (PLATE) [E25] PC1467 - HARV-SEEDING

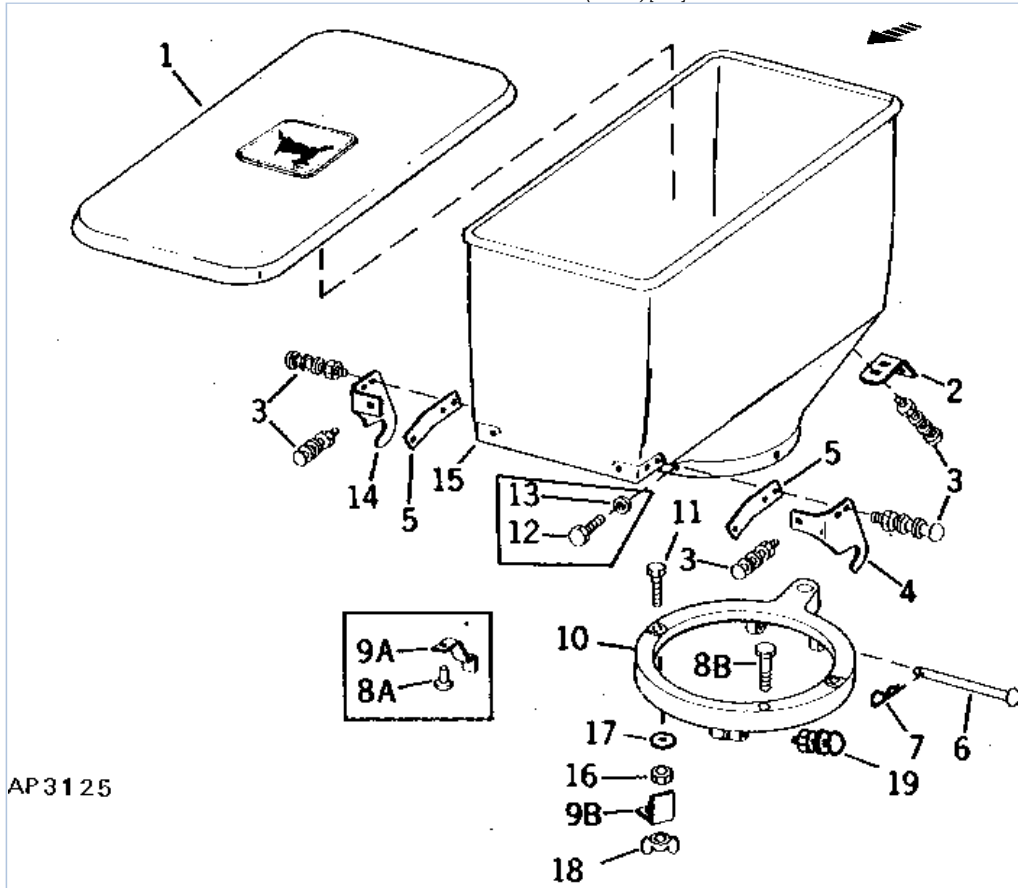


Список деталей

PC1467 110-22 7000 Drawn Cotton and Corn Planter / SEED HOPPER (PLATE) [E25]

PC1467 - HARV-SEEDING


КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A20236	COVER	1	_____-1978	(SUB AA26827)
1	AA26827	COVER	1		
2	A25654	CLIP	1		
3	03H1701	BOLT	8		1/4" X 3/4"
3	A21710	WASHER	8		
3	24H1646	WASHER	8		17/64" X 3/4" X 0.060"
3	N10217	LOCK NUT	8		6.350 MM (1/4")
4	A20167	BRACKET	1	_____-1977	(SUB A32985) L.H.
4	A32985	BRACKET	1		L.H.
5	A21709	WEATHERSTRIP	2		
6	B28999	PIN FASTENER	1		7.798 X 158.750 MM (0.307" X 6-1/4")
7	J16931	PIN	1		
8A	16H115	RIVET	1	_____-1975	1/8" X 5/8"
8B	19H1738	CAP SCREW	1	1975-____	1/4" X 2"
9A	B28972	SPRING	1	_____-1975	
9B	A30178	ANGLE	1	1975-____	
10	A24791	HOPPER	1	_____-1977	(SUB A28025)
10	A28025	HOPPER	1		
11	19H1738	CAP SCREW	1		1/4" X 2"
12	19H1813	CAP SCREW	3	_____-1977	5/16" X 5/8"
13	24H1136	WASHER	3	_____-1977	11/32" X 11/16" X 0.065"
14	A20166	BRACKET	1	_____-1977	(SUB A32984) R.H.
14	A32984	BRACKET	1		R.H.
15	A24767	HOPPER	1		
16	14H786	NUT	1	1975-____	1/4"
17	24H1646	WASHER	1	1975-1976	17/64" X 3/4" X 0.060"
18	M47887	WING NUT	1	1975-____	6.350 MM (1/4") (SUB FOR A23214)
19	03H1268	BOLT	3	1977-____	5/16" X 3/4"
19	24H1136	WASHER	3	1977-____	11/32" X 11/16" X 0.065"
19	14H785	NUT	3	1977-____	5/16"

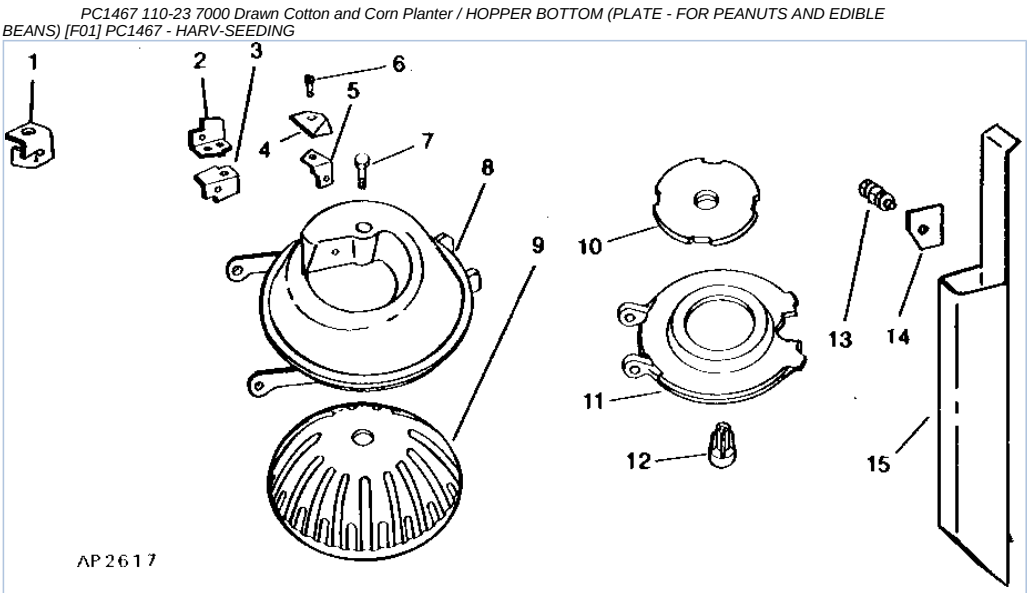

Список деталей

PC1467 110-23 7000 Drawn Cotton and Corn Planter / HOPPER BOTTOM (PLATE - FOR
PEANUTS AND EDIBLE BEANS) [F01] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	B30060	GATE	1		(USE WITH B31723 AND A22235) LARGE
2	B30058	GATE	1		(USE WITH B31724) MEDIUM
3	B30057	GATE	1		(USE WITH B31724) SMALL
4	B30061	COVER	1		
5	B28962	GATE	1		(USE WITH B31723) SMALL AND MEDIUM
6	H2841B	SCREW	1		
7	19H2971	CAP SCREW	1		5/16" X 2"
8	B30026	PLATE	1		
9	B31723	PLATE	1		LARGE
9	B31724	PLATE	1		EXTRA SMALL
9	A22235	PLATE	1		EXTRA LARGE
10	B28725	PLATE	1		
11	A22318	PLATE	1		
12	B28973	ALIGNER	1		
13	19H2023	CAP SCREW	1		3/8" X 3-1/4"
13	12H304	LOCK WASHER	1		3/8"
13	14H1076	NUT	1		3/8"
14	B30959	STRAP	1		
15	AB17931	TUBE	1		

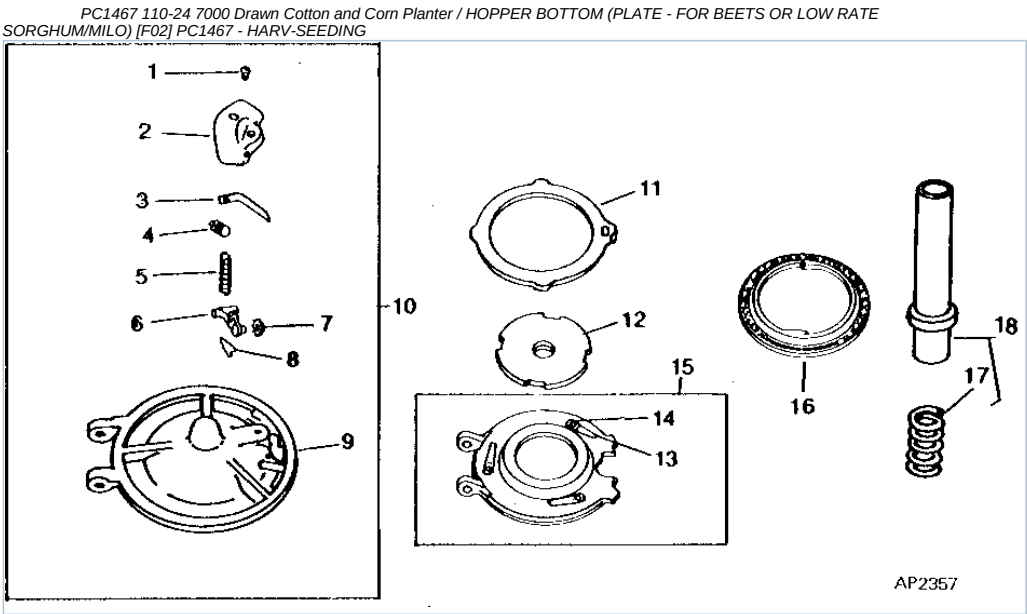


Список деталей

PC1467 110-24 7000 Drawn Cotton and Corn Planter / HOPPER BOTTOM (PLATE - FOR
BEETS OR LOW RATE SORGHUM/MILO) [F02] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	21H1303	SCREW	1		1/4" X 3/4"
2	A20043	CAP	1	_____-1977	(SUB A33166)
2	A33166	CAP	1		
3	B31273	GATE	1		(SUB A63617)
3	A63617	GATE	1		
4	21H1301	SCREW	1		0.190" X 1/2"
4	12H246	LOCK WASHER	1		0.190"
4	14H778	NUT	1		0.190"
5	Y2624B	COMPRESSION SPRING	1		
6	B30042	KNOCKER	1	_____-1977	(SUB A29848)
6	A29848	KNOCKER	1	_____-1979	(SUB A36012)
6	A36012	KNOCKER	1		
7	N2701DB	RIM	1		
8	B12602	DEFLECTOR	1		
9	B29473	BOTTOM	1		
10	AA20383	DEFLECTOR	1	_____-1977	(SUB AA26571) BEET
10	AA26571	DEFLECTOR	1		BEET
11	B27053	PLATE	1	_____-1977	(SUB A23055)
11	A23055	PLATE	1	_____-1982	(SUB A45626)
11	A45626	PLATE	1		
12	B28725	PLATE	1		
13	Y5523B	SPRING	3		
14	16H104	RIVET	3		1/8" X 7/16"
15	AD10193	PLATE	1		
16		PLATE	1		
17	B28971	SPRING	1		
18	AB17360	TUBE	1		

PC1467 110-25 7000 Drawn Cotton and Corn Planter / CELL DROP HOPPER BOTTOM (PLATE - FOR ACID OR MECHANICALLY DELINTED COTTON AND SOYBEANS) [F03] PC1467 - HARV-SEEDING

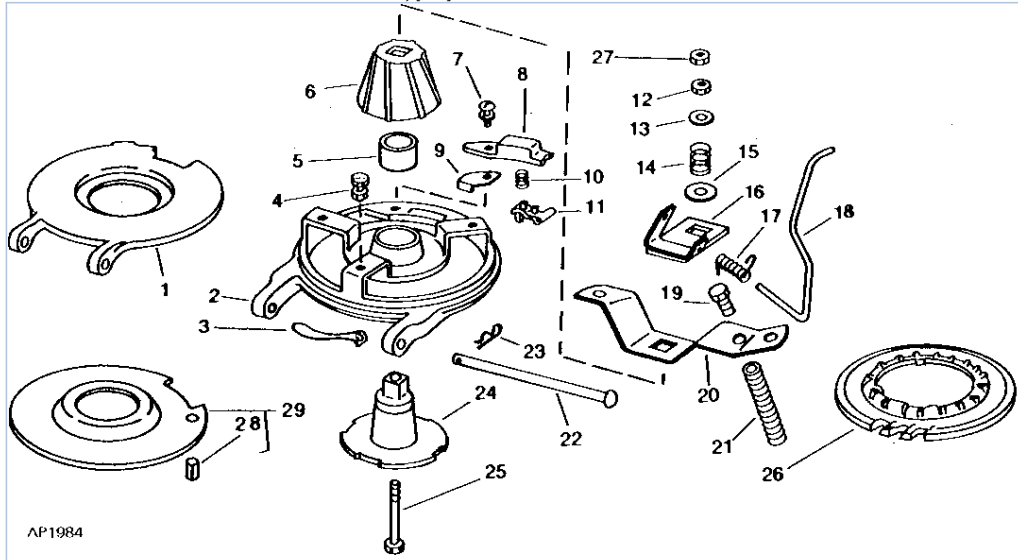


Список деталей

PC1467 110-25 7000 Drawn Cotton and Corn Planter / CELL DROP HOPPER BOTTOM
(PLATE - FOR ACID OR MECHANICALLY DELINTED COTTON AND SOYBEANS) [F03] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	B32350	PLATE	1		
2	A20289	CAP	1		
3	B32340	CLIP	2		
4	19H1227	CAP SCREW	2		1/4" X 1/2"
4	B14174	LOCK NUT	2	1986	6.350 MM (1/4") (SUB K40001)
4	K40001	LOCK NUT	2		6.350 MM (1/4")
5	C16321	BUSHING	1		
6	B32349	AGITATOR	1		
7	21H1302	SCREW	1		1/4" X 5/8"
7	12H302	LOCK WASHER	1		1/4"
8	B32342	CAP	1		
9	B32339	SWEEP	1		
10	B32333	SPRING	1		
11	B32341	KNOCKER	1		
12	14H1076	NUT	1		3/8"
13	24H1219	WASHER	1		7/16" X 1" X 0.083"
14	H47DB	SPRING	1		
15	24H1653	WASHER	1		13/32" X 1-1/4" X 0.120"
16	AB19001	PIVOT	1		
17	B32336	SPRING	1		
18	B32346	AGITATOR	1		
19	19H1924	CAP SCREW	3		7/16" X 3/4"
20	A26926	AGITATOR	1		
21	P2685B	SPRING	3		
22	B28999	PIN FASTENER	1		7.798 X 158.750 MM (0.307" X 6-1/4")
23	J16931	PIN	1		
24	A20716	DRIVE	1		
25	19H1733	CAP SCREW	1		3/8" X 2-1/2"
26	A24080	PLATE	1		48 CELL, FOR ACID DELINTED COTTON (USE WITH AA23018 FALSE RING)
26	B32344	SEED PLATE	1		24 CELL
26	B32345	SEED PLATE	1		24 CELL
27	14H732	NUT	1		3/8"
28	34H241	SPRING PIN	1		1/8" X 3/8"
29	AA23018	RING	1		(USE WITH A24080) FOR ACID DELINTED COTTON

PC1467 110-26 7000 Drawn Cotton and Corn Planter / HOPPER BOTTOM (CORN, ACID DELINTED COTTON, SOYBEANS AND REGULAR SORGHUM/MILO) [F04] PC1467 - HARV-SEEDING

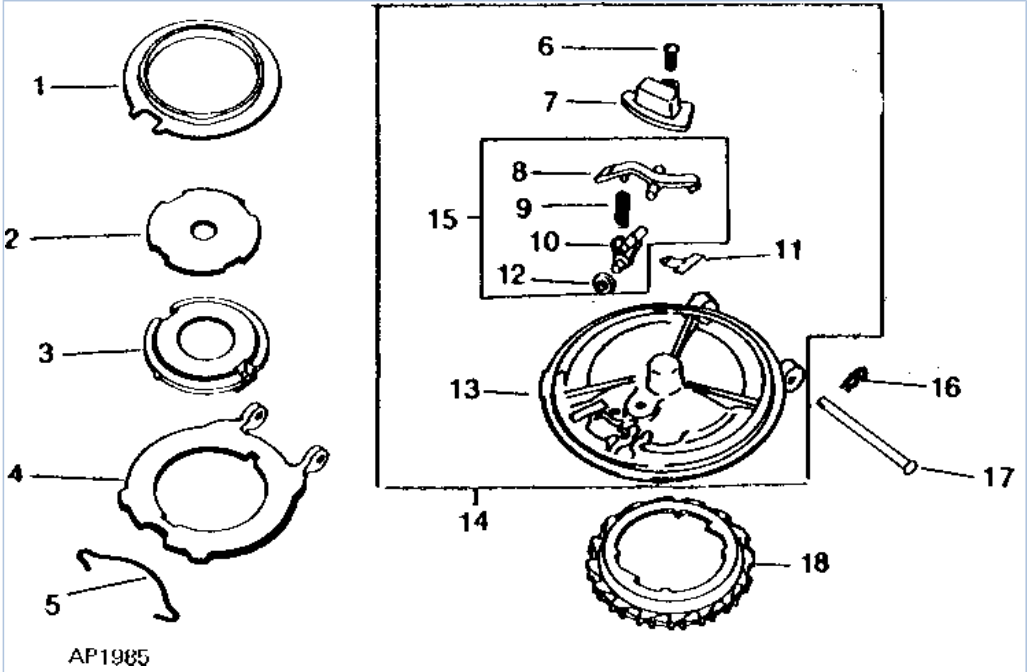


Список деталей

PC1467 110-26 7000 Drawn Cotton and Corn Planter / HOPPER BOTTOM (CORN, ACID
DELINTED COTTON, SOYBEANS AND REGULAR SORGHUM/MILO) [F04] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	Y2630B	PLATE	1	1983	(A) (B) (SUB A44988)
1	Y3313B	PLATE	1	1983	(A) (B) (SUB A45582)
1	Y5055B	PLATE	1	1982	(A) (B) (SUB A45582)
1	A45582	PLATE	1		(A) (B)
1	A44988	PLATE	1		(A) (B) (USE WITH A47490) 3.68 MM (.145") THICK
1	A48500	PLATE	1		(A) (B) (USE WITH A47483) 3.68 MM (.145") THICK
1	A50730	PLATE	1		(A) (B) (USE WITH A47483) 1.52 MM (.060") THICK
1	A47468	PLATE	1		(A) (B)
2	B28725	PLATE	1		
3	B30410	RETAINER	1	1984	(SUB A47482) CAST IRON
3	A47482	GROMMET	1		(USE WITH A47483, A47490 AND A47491) PLASTIC
4	H685B	PLATE	1	1984	(B) (SUB A47482 AND A47483 OR A47482 AND A47490) CAST IRON, GROOVED ON ONE SIDE
4	A47483	PLATE	1		(B) STEEL, FLAT ON BOTH SIDES, NEEDS A47482
4	A47490	PLATE	1		STEEL, GROOVED ON BOTH SIDES, NEEDS A47482
4	H1264B	PLATE	1		(A) (B) (SUB A44988)
4	H1279B	PLATE	1	1984	(A) (B) (SUB A47482 AND A47491) CAST IRON, GROOVED ON ONE SIDE
4	A47491	PLATE	1		STEEL, GROOVED ON ONE SIDE
4	H1280B	PLATE	1	1984	(A) (B) CAST IRON, GROOVED ON ONE SIDE
4	H1323B	PLATE	1	1985	(A) (B) (SUB A47482, A47483 AND A50730)
4	H1346B	PLATE	1	1984	(A) (B) (SUB A47483 AND A48500) CAST IRON
4	AH306B	PLATE	1	1983	(A) (B)
4	AD10193	PLATE	1		(A) (B)
4	A47492	PLATE	1	1984	(A) (B) STEEL, GROOVED ON ONE SIDE
5	B31562	SPRING	1		
6	21H1303	SCREW	1		1/4" X 3/4"
7	B30027	CAP	1	1977	(SUB A29451)
7	A29451	EXHAUST CAP	1	1980	(SUB A40518)
7	A40518	CAP	1		
8	Y2598B	KNOCKER	1	1981	(SUB A35968)
8	A35968	GATE	1		
9	Y2624B	COMPRESSION SPRING	1		
10	B30042	KNOCKER	1	1977	(SUB A29848)
10	A29848	KNOCKER	1		(SUB A36012)
10	A36012	KNOCKER	1		
11	B12602	DEFLECTOR	1		
12	Y2600B	WHEEL	1		
13	B29473	BOTTOM	1		
14	AB18001	BOTTOM	1	1977	(SUB AA26581)
14	AA26581	PAN	1	1980	(SUB AA30642)
14	AA30642	PLATE	1		
15	AB18171	KNOCKER	1	1977	(SUB AA27815) (PACKAGE OF TWO)
15	AA27815	KNOCKER	1		(PACKAGE OF TWO)
16	J16931	PIN	1		
17	B28999	PIN FASTENER	1		7.798 X 158.750 MM (0.307" X 6-1/4")
18		SEED PLATE	1		(B)

PC1467 110-28 7000 Drawn Cotton and Corn Planter / BAFFLE (HIGH-RATE MILO AND CORN HOPPER) [F06] PC1467 - HARV-SEEDING

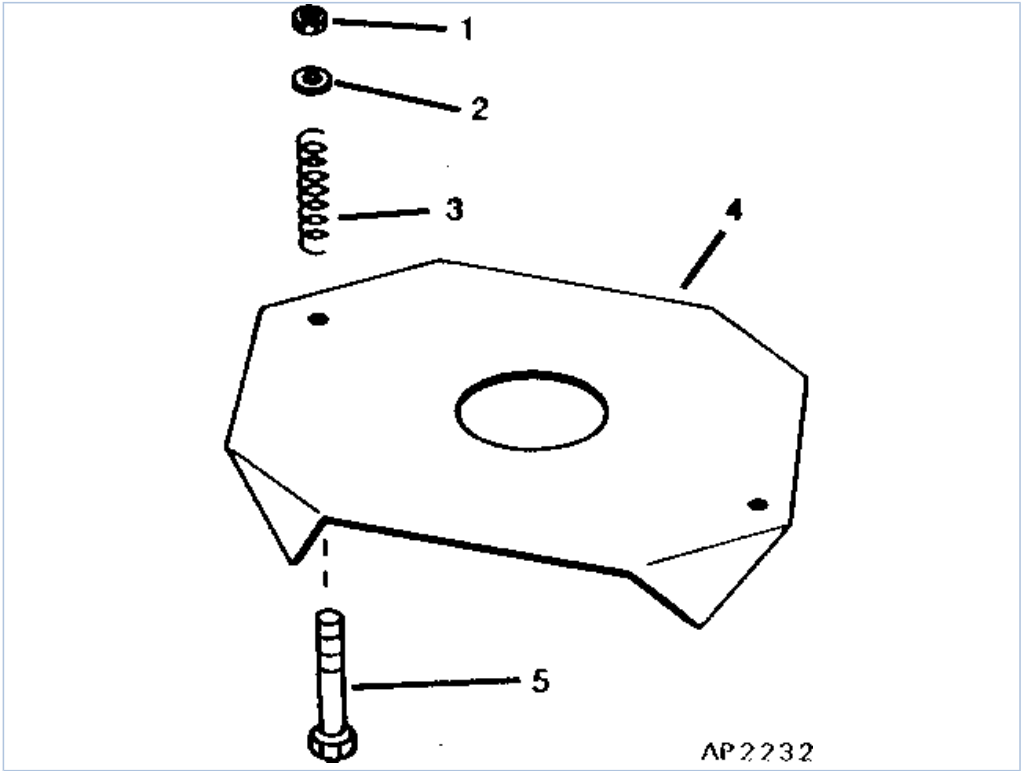


Список деталей

PC1467 110-28 7000 Drawn Cotton and Corn Planter / BAFFLE (HIGH-RATE MILO AND CORN HOPPER) [F06] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	B14174	LOCK NUT	2	_____-1986	6.350 MM (1/4") (SUB K40001)
1	K40001	LOCK NUT	2		6.350 MM (1/4")
2	24H1287	WASHER	2		9/32" X 5/8" X 0.065"
3	Y2624B	COMPRESSION SPRING	2		
4	B32432	PLATE	1		
5	19H2240	CAP SCREW	2		1/4" X 3-1/4"

HARV-SEEDING

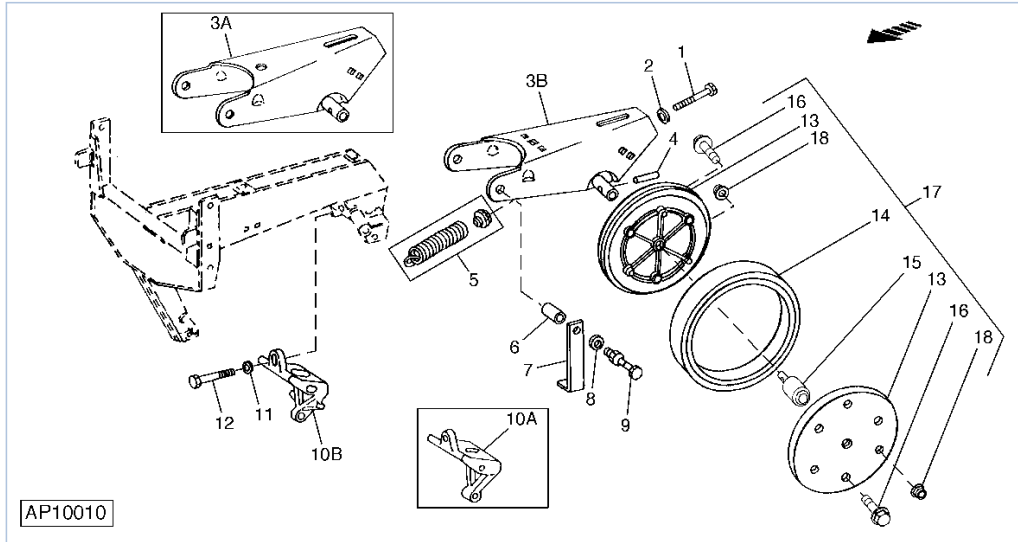

Список деталей

PC1467 110-29 7000 Drawn Cotton and Corn Planter / CLOSING WHEEL, ARM, AND HOSE
HOLDER [F07] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H2218	CAP SCREW	1		1/2" X 5"
2	12H292	LOCK WASHER	1		1/2"
3A	AA23118	ARM	1	- 064400	(SUB A34723 AND AA31217)
3B	AA31217	ARM	1		(SUB FOR AA27587)
4	A26311	PIN	2		(SUB FOR A26312)
5	AA23116	SPRING ASSEMBLY	1		
6	A22724	WASHER	2	- 064400	
6	A34723	WASHER	2	064401-	
7	A37548	ANGLE	1	-1979	(SUB FOR A24112) INSECTICIDE ATTACHMENT ONLY
7	A50762B	ANGLE	1	1985-	(SUB FOR A50762)
8	24H1211	WASHER	2		9/16" X 1-3/8" X 0.105"
9	19H1831	CAP SCREW	2		1/2" X 2"
9	12H301	LOCK WASHER	2	-1977	1/2"
9	14H1040	NUT	2	-1977	1/2"
9	K40014	LOCK NUT	2	1977-	
9	14H826	NUT	2		1/2", USE IN PLACE OF 14H1040 WHEN USING A24112 HOLDER
10A	A28135	STOP	1	- 064400	(SUB A33879)
10B	A33879	STOP	1		
11	12H304	LOCK WASHER	1		3/8"
12	19H1732	CAP SCREW	1		3/8" X 1-1/4"
12	24H1305	WASHER	1		13/32" X 13/16" X 0.065"
13	A45576	WHEEL	4		(SUB FOR A26017)
14	A22325	TIRE	2		25 MM X 305 MM (1" X 12") SEMI-PNEUMATIC
15	AA35741	BALL BEARING	2		(SUB FOR AA21015)
16	19M7863	SCREW	6		M6 X 25
17	AA43899	WHEEL	1		(SUB FOR AA22801 AND AA33297)
18	H137327	LOCK NUT	6		M6

(1977-) [F08] PC1467 - HARV-SEEDING




Список деталей

PC1467 110-30 7000 Drawn Cotton and Corn Planter / HEAVY-DUTY CLOSING WHEEL,
ARM, AND HOSE HOLDER (1977-) [F08] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H2218	CAP SCREW	1		1/2" X 5"
2	12H292	LOCK WASHER	1		1/2"
3A	AA23118	ARM	1	- 064400	(SUB A34723 AND AA31217)
3B	AA27587	ARM	1	-1981	(SUB AA31217)
3B	AA31217	ARM	1		
4A	A26312	SPRING PIN	2	-1979	(SUB A26311)
4A	A26311	PIN	2	-1979	6.350 X 31.750 MM (1/4" X 1-1/4")
4B	19H1791	CAP SCREW	2	1979-1980	1/4" X 1-1/4"
4B	K40001	LOCK NUT	2	1979-	6.350 MM (1/4")
4B	19H2992	SCREW	2	1980-1980	1/4" X 1-1/4"
4B	19H1898	CAP SCREW	2	1980-	1/4" X 1-1/2"
5	AA23116	SPRING ASSEMBLY	1		
6	A22724	WASHER	2	- 064400	12.954 X 19.050 X 5.334 MM (0.510" X 3/4" X 0.210")
6	A34723	WASHER	2	064401-	13.310 X 25.400 X 5.300 MM (0.524" X 1" X 0.209")
7	A24112	GUIDE	1	-1979	(SUB A37548) INSECTICIDE ATTACHMENT ONLY
7	A37548	ANGLE	1	-1985	INSECTICIDE ATTACHMENT ONLY
7	A50762B	ANGLE	1	1985-	(SUB FOR A50762)
8	24H1211	WASHER	2		9/16" X 1-3/8" X 0.105"
9	19H1831	CAP SCREW	2		1/2" X 2"
9	12H301	LOCK WASHER	2	-1977	1/2"
9	14H1040	NUT	2	-1977	1/2"
9	K40014	LOCK NUT	2	1977-	12.700 MM (1/2")
9	14H826	NUT	2		1/2", USE IN PLACE OF 14H1040 WHEN USING A24112 HOLDER
10A	A28135	STOP	1	- 064400	(SUB A33879)
10B	A33879	STOP	1		
11	19H1732	CAP SCREW	1		3/8" X 1-1/4"
11	24H1305	WASHER	1		13/32" X 13/16" X 0.065"
12	12H304	LOCK WASHER	1		3/8"
13	AA21015	BALL BEARING	2	-1986	(SUB AA35741)
13	AA35741	BALL BEARING	2		
14	AA25841	WHEEL	2		

PC1467 110-31 7000 Drawn Cotton and Corn Planter / GAUGE WHEEL, BEARING, AND TIRE [F09] PC1467 - HARV-SEEDING

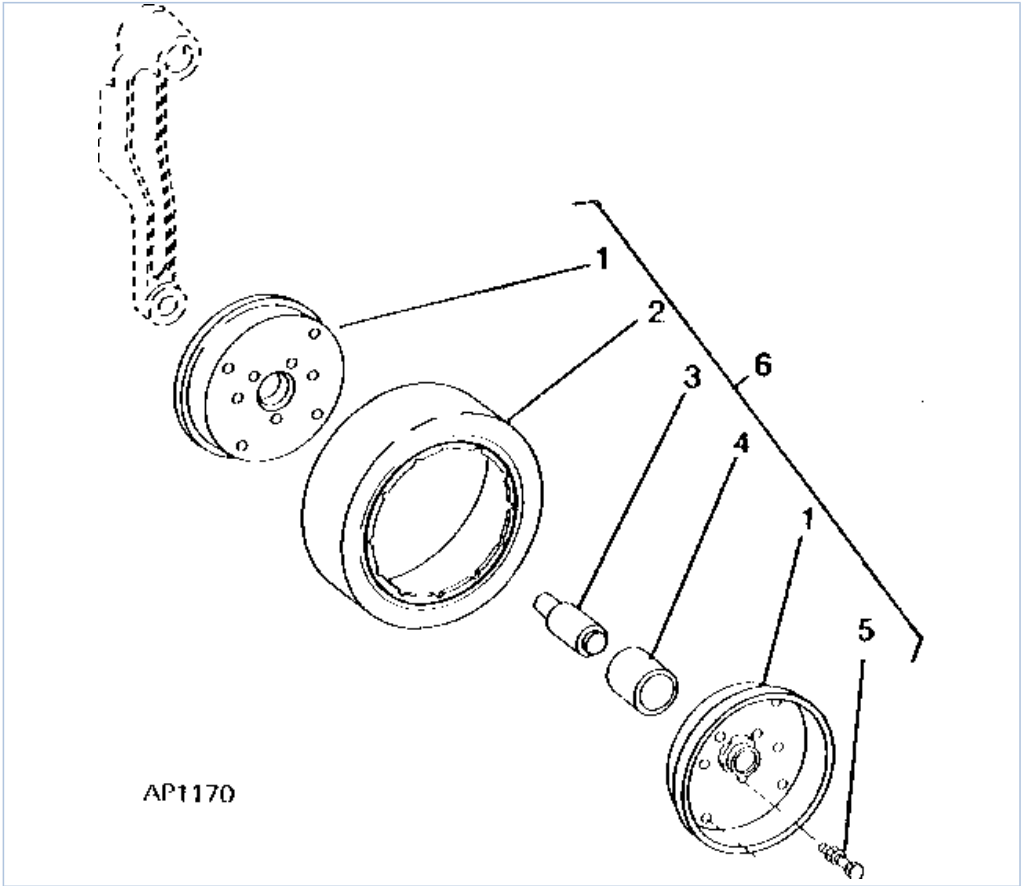


Список деталей

TIRE [F09] PC1467 - HARV-SEEDING

PC1467 110-31 7000 Drawn Cotton and Corn Planter / GAUGE WHEEL, BEARING, AND

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A22780	WHEEL	2		
2	C1231N	TIRE	1		RUNNER OPENER
2	A84050	TIRE	1		(SUB FOR A22884) TRU-VEE OPENER
3	AA35741	BALL BEARING	1	_____-1986	(SUB FOR AA21015)
4	A25915	BUSHING	1		
5	19H1813	CAP SCREW	7		5/16" X 5/8"
5	N10213	LOCK NUT	7	_____-1974	
5	M40699	NUT	7	1974-1976	
5	K40002	LOCK NUT	7		(SUB FOR T25249)
6	AA32046	WHEEL	1		(INCLUDES A22884)


PC1467 110-32 7000 Drawn Cotton and Corn Planter / DUAL GAUGE WHEEL ATTACHMENT (1978-1986) [F10] PC1467 - HARV-SEEDING

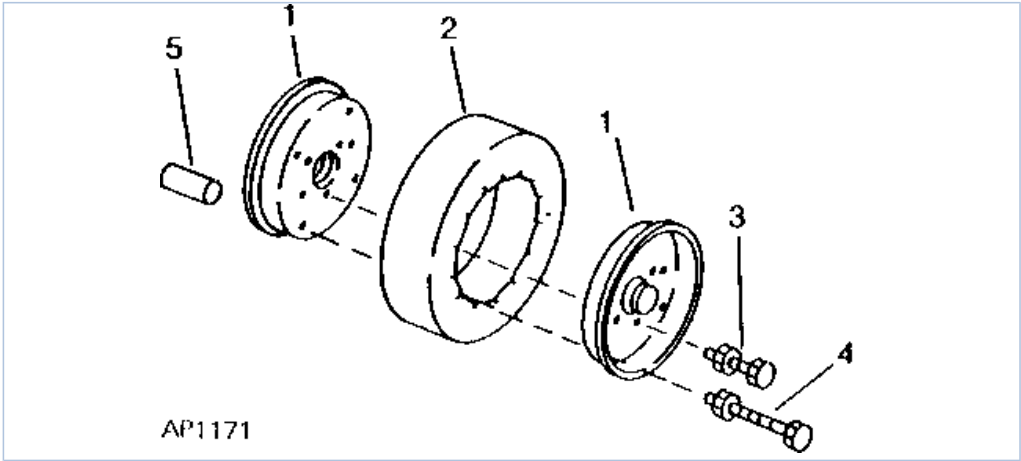

Список деталей

PC1467 110-32 7000 Drawn Cotton and Corn Planter / DUAL GAUGE WHEEL
ATTACHMENT (1978-1986) [F10] PC1467 - HARV-SEEDING


КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A22780	WHEEL	2		
2	A84050	TIRE	1		(SUB FOR A22884)
3	19H1813	CAP SCREW	5		5/16" X 5/8"
3	K40002	LOCK NUT	5		(SUB FOR T25249)
4	19H2288	CAP SCREW	4		5/16" X 5"
4	K40002	LOCK NUT	4		(SUB FOR T25249)
5	28H1601	BUSHING	4	_____-1986	0.546" X 0.840" X 4-1/8", (SUB FOR B28418)

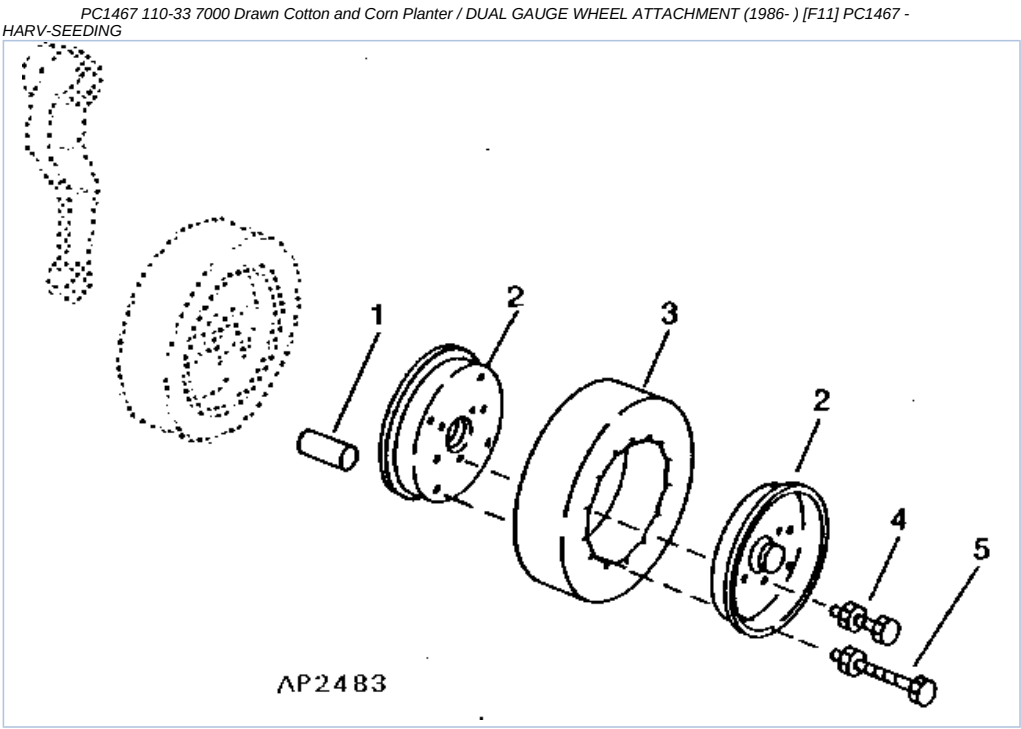

Список деталей

PC1467 110-33 7000 Drawn Cotton and Corn Planter / DUAL GAUGE WHEEL
 ATTACHMENT (1986-) [F11] PC1467 - HARV-SEEDING


КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	28H1601	BUSHING	4		0.546" X 0.840" X 4-1/8"
2	A22780	WHEEL	2		
3	A84050	TIRE	1		(SUB FOR A22884)
4	19M7162	CAP SCREW	5		M8 X 16
4	E64256	LOCK NUT	5		
5	19M8262	CAP SCREW	4		M8 X 130
5	E64256	LOCK NUT	4		

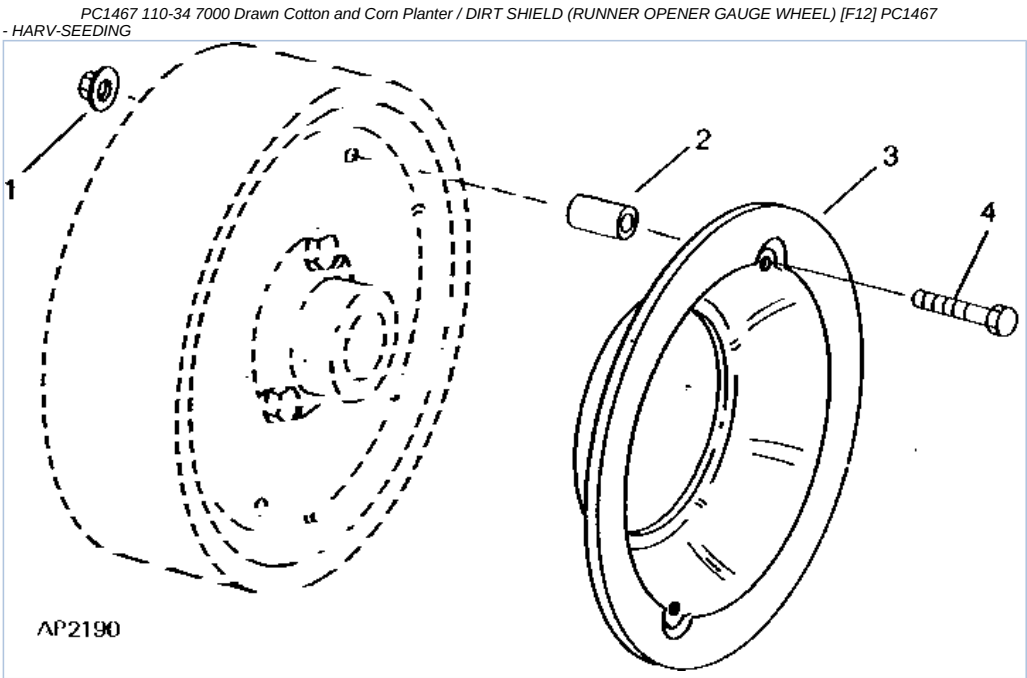

Список деталей

PC1467 110-34 7000 Drawn Cotton and Corn Planter / DIRT SHIELD (RUNNER OPENER
GAUGE WHEEL) [F12] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	N10213	LOCK NUT	2		7.925 MM (5/16")
2	28H1633	BUSHING	2		1/4" X 1.562"
3	A25346	SHIELD	1		
4	19H1913	CAP SCREW	2		5/16" X 2-1/4"

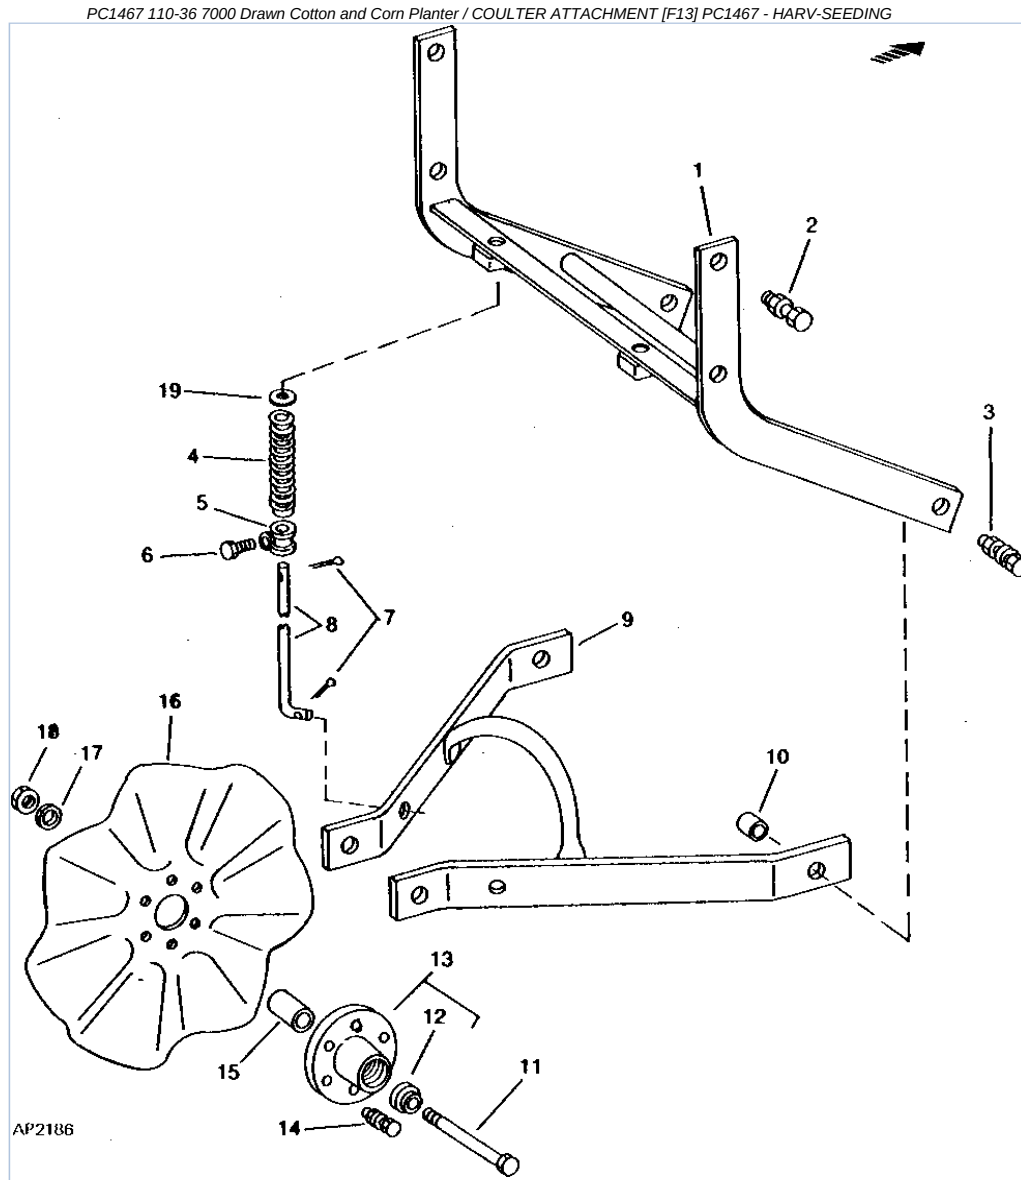


Список деталей

PC1467 110-36 7000 Drawn Cotton and Corn Planter / COULTER ATTACHMENT [F13]

PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA22290	FRAME	1		
2	19H2706	CAP SCREW	4		5/8" X 2"
2	14H1039	NUT	4		5/8"
3	19H1777	CAP SCREW	2		1/2" X 1-3/4"
3	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
3	14H1040	NUT	2		1/2"
4	A25695	SPRING	2		
5	B14242	LOCKING COLLAR	2		
6	22H818	SET SCREW	2		5/16" X 3/4"
7	11H284	COTTER PIN	4		7/32" X 1-1/2"
8	A24813	PIN FASTENER	2		
9	AA22420	ARM	1		
10	H1815B	BUSHING	2	_____-1974	
10	B10202	BUSHING	2	1974-____	
11	19H2331	CAP SCREW	1	_____-1974	5/8" X 7"
11	19H3309	CAP SCREW	1	1974-____	5/8" X 7-1/4"
12	JD9214	BALL BEARING	2		
13	AB18494	HUB	2		
14	19H1801	CAP SCREW	6		3/8" X 2"
14	12H304	LOCK WASHER	6	_____-1983	3/8"
14	14H1076	NUT	6	_____-1983	3/8"
14	K40003	LOCK NUT	6		9.525 MM (3/8")
15	B31261	SPACER	1	_____-1975	(SUB A31152)
15	A31152	SPACER	1		
16	A24996	DISK COLTER	1		(SUB A73911) (ILLUSTRATED) FLUTED
16	A73911	DISK COLTER	1		
16	A73910	DISK COLTER	1		(SUB FOR A24997) RIPPLED
16	A51872	DISK COLTER	1		(SUB A74493) FLUTED
17	12H294	LOCK WASHER	1		5/8"
18	14H1039	NUT	1		5/8"
19	24H1111	WASHER	2		17/32" X 1-1/16" X 0.090"


PC1467 110-38 7000 Drawn Cotton and Corn Planter / HEAVY-DUTY COULTER ATTACHMENT (1977-1980) [F15]
PC1467 - HARV-SEEDING

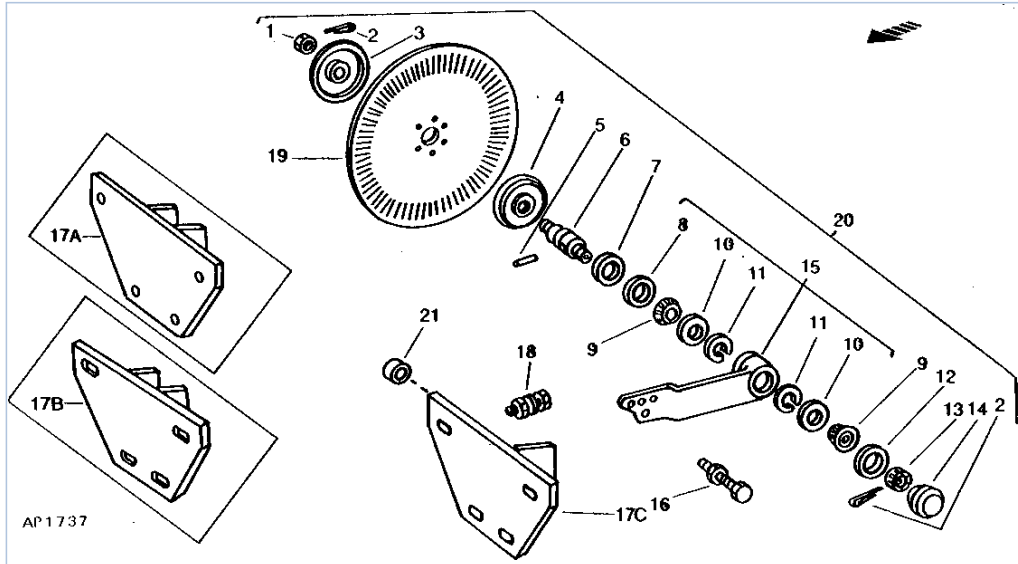

Список деталей

PC1467 110-38 7000 Drawn Cotton and Corn Planter / HEAVY-DUTY COULTER
ATTACHMENT (1977-1980) [F15] PC1467 - HARV-SEEDING


КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	14H872	NUT	1		1"
2	11H218	COTTER PIN	2		3/16" X 1-1/2"
3	A21040	WASHER	1		
4	A21041	WASHER	1		
5	34H386	SPRING PIN	1		1/4" X 2"
6	A21038	SPINDLE	1		
7	B13294	SEAL	1		
8	A14643	BUSHING	1	_____- 1978	(SUB B32687)
8	B32687	SEAL	1		
9	JD8187	BEARING CONE	2		
10	JD8225	BEARING CUP	2		
11	32166	SNAP RING	2		
12	24H1452	WASHER	1		1-1/32" X 1-3/4" X 0.105"
13	A12188	LOCK NUT	1		25.400 MM (1")
14	D10025	CAP	1		
15	AA26214	ARM	1	1977-1970	(SUB AA30310)
15	AA32179	ARM	1	_____- 1983	(SUB AA32692) (SUB FOR AA30310)
15	AA32692	ARM	1		
16	19H2328	CAP SCREW	2		5/8" X 4"
16	K40015	LOCK NUT	2		15.875 MM (5/8")
17A	AA25458	BRACKET	1	_____- 1978	(SUB AA27918)
17B	AA27918	BRACKET	1	_____- 1979	(SUB AA29179)
17B	AA29179	BRACKET	1	_____- 1981	(SUB AA32693 AND N147291)
17C	AA32693	BRACKET	1		(SUB FOR AA32037)
18	19H1815	CAP SCREW	4		1/2" X 1-1/4"
18	K40014	LOCK NUT	4		12.700 MM (1/2")
18	24H1211	WASHER	4	1978- _____	9/16" X 1-3/8" X 0.105"
19	A24996	DISK COLTER	1		(SUB A73911) 405 MM (16") FLUTED
19	A73911	DISK COLTER	1		
19	A73910	DISK COLTER	1		(SUB FOR A24997) 405 MM (16") RIPPLED (ILLUSTRATED)
19	A51872	DISK COLTER	1		(SUB A74493) FLUTED
20	AA26045	ARM	1	_____- 1980	(SUB AA30311)
20	AA30311	ARM	1		
21	N233469	SPACER	1	_____- 1984	(SUB FOR N134341)
21	N147291	BUSHING	1		

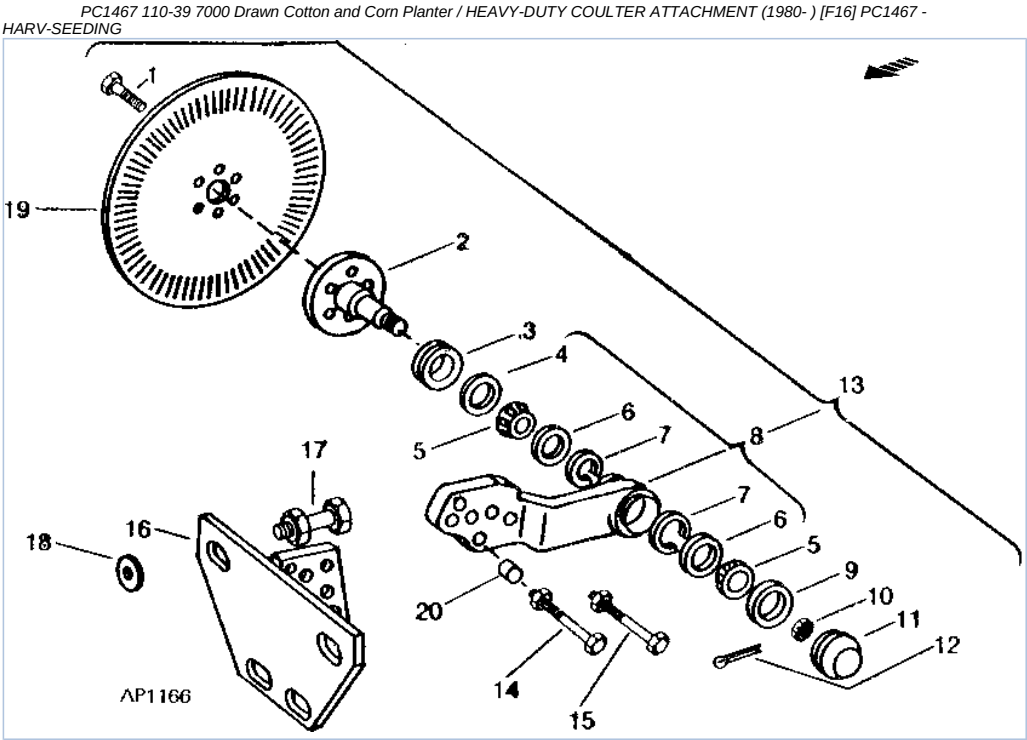

Список деталей

PC1467 110-39 7000 Drawn Cotton and Corn Planter / HEAVY-DUTY COULTER
ATTACHMENT (1980-) [F16] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H1936	CAP SCREW	6		3/8" X 3/4"
2	AA31898	SPINDLE	1		(SUB FOR AA29387)
3	B13294	SEAL	1		
4	B32687	SEAL	1		
5	JD8187	BEARING CONE	2		
6	JD8225	BEARING CUP	2		
7	32166	SNAP RING	2		
8	AA32179	ARM	1	_____- 1982	(SUB FOR AA30310) (SUB AA32692)
8	AA32692	ARM	1		
9	24H1452	WASHER	1		
10	A12188	LOCK NUT	1		25.400 MM (1")
11	D10025	CAP	1		
12	11H218	COTTER PIN	1		3/16" X 1-1/2"
13	AA32180	ARM	1	_____- 1982	(SUB AA32694) (SUB FOR AA30311)
13	AA32694	ARM	1		
14	19H2328	CAP SCREW	1		5/8" X 4"
14	K40015	LOCK NUT	1		15.875 MM (5/8")
15	19H2072	CAP SCREW	1		5/8" X 3-1/4"
15	K40015	LOCK NUT	1		15.875 MM (5/8")
16	AA32037	BRACKET	1	_____- 1982	(SUB FOR AA29426) (SUB AA32693)
16	AA32693	BRACKET	1		
17	19H1815	CAP SCREW	4		1/2" X 1-1/4"
17	K40014	LOCK NUT	4		12.700 MM (1/2")
18	24H1211	WASHER	4		9/16" X 1-3/8" X 0.105"
19	A24996	DISK COLTER	1		(SUB A73911) 405 MM (16") FLUTED
19	A73911	DISK COLTER	1		
19	A73910	DISK COLTER	1		(SUB FOR A24997) 405 MM (16") RIPPLED (ILLUSTRATED)
19	A51872	DISK COLTER	1	1989- _____- 1981	(SUB A74493) FLUTED
20	N233469	SPACER	1	_____- 1981	(SUB FOR N134341)
20	N147291	BUSHING	1		

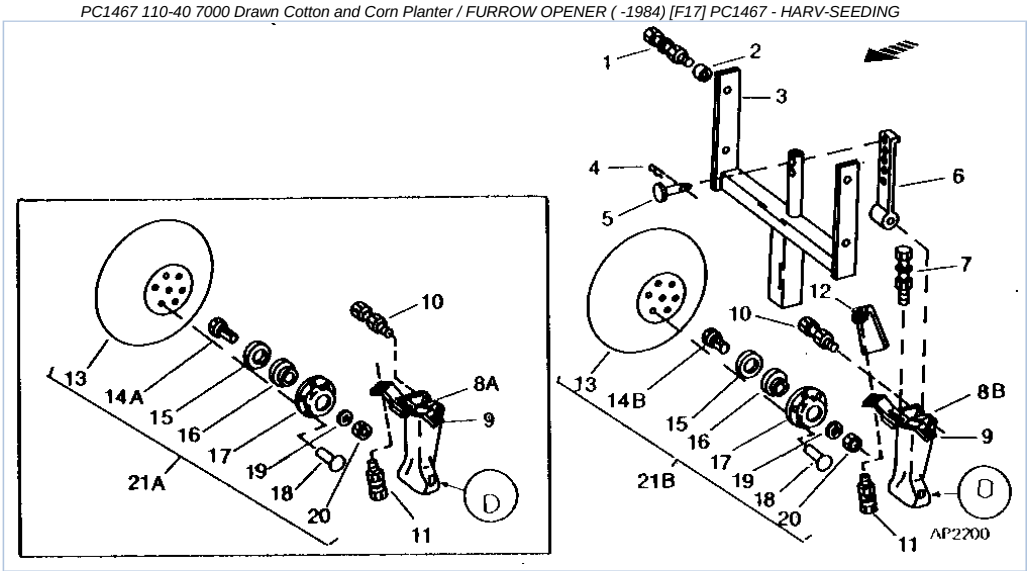


Список деталей

PC1467 110-40 7000 Drawn Cotton and Corn Planter / FURROW OPENER (-1984) [F17]

PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H1721	CAP SCREW	4		1/2" X 1-1/2"
1	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
1	K40014	LOCK NUT	4		
2	H1815B	BUSHING	4		
3	AA22745	SUPPORT	1		
4	S2955DW	PIN	1	_____-1985	(SUB A15147)
4	A15147	SPRING LOCKING PIN	1		
5	B27469	PIN FASTENER	1		
6	AA22895	STRAP	1		
7	19H1905	CAP SCREW	2		5/16" X 1"
7	12H303	LOCK WASHER	2		5/16"
7	14H785	NUT	2		5/16"
8A	A26114	SHANK	1	_____-1978	(USE WITH AA22581 AND AA61568)
8B	A36140	SHANK	1	1978-____	(USE WITH AA27929 AND AA61569)
9	A25652	BAR	1		
10	19H1974	CAP SCREW	1		1/2" X 2-3/4"
10	K40014	LOCK NUT	1		
11	03H1268	BOLT	4		5/16" X 3/4"
11	12H291	LOCK WASHER	4		5/16"
11	14H785	NUT	4		5/16"
12	B32104	SCRAPER	1		305 MM (12") R.H.
12	B32105	SCRAPER	1		305 MM (12") L.H.
13	AB16829	OPENER	2		(SUB AA61567)
13	AA61567	DISK COLTER	2		
14A	A25916	STUD	2	_____-1978	(USE WITH AA22581 AND AA61568)
14B	A33872	BOLT	2	1978-____	(USE WITH AA27929 AND AA61569)
15	A41683	WASHER	2		(SUB FOR A25062)
16	A27002	BALL BEARING	2		
17	A26032	PRESSED FLANGED HOUSING	2		
18	16H658	RIVET	6		1/4" X 5/8"
19	12H247	LOCK WASHER	2		5/8"
20	14H1083	NUT	2		5/8"
21A	AA22581	BEARING	2	_____-1978	(SUB AA61568)
21A	AA61568	DISK COLTER	2		
21B	AA27929	DISK BLADE	2	1978-____	(SUB AA61569)
21B	AA61569	DISK COLTER	2		


PC1467 110-42 7000 Drawn Cotton and Corn Planter / CONSERVATION FURROW OPENER (1984-) [F18] PC1467 - HARV-SEEDING

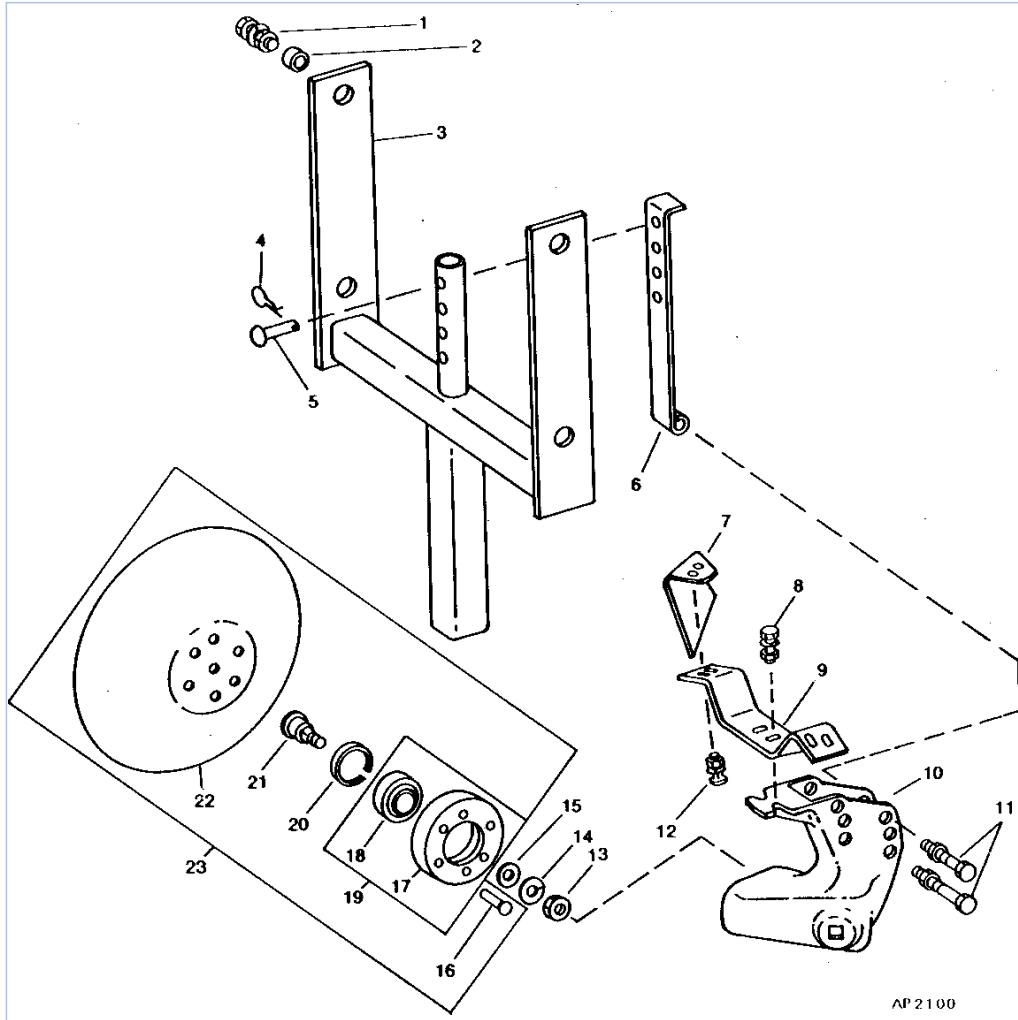

Список деталей

PC1467 110-42 7000 Drawn Cotton and Corn Planter / CONSERVATION FURROW
OPENER (1984-) [F18] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H1721	CAP SCREW	4		1/2" X 1-1/2"
1	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
1	K40014	LOCK NUT	4		12.700 MM (1/2")
2	H1815B	BUSHING	4		
3	AA34465	SUPPORT	1		
4	S2955DW	PIN	1	1985	(SUB A15147)
4	A15147	SPRING LOCKING PIN	1		
5	B27469	PIN FASTENER	1		11.125 X 44.450 MM (7/16" X 1-3/4")
6	A42501	STRAP	1		
7	B32104	SCRAPER	1		R.H.
7	B32105	SCRAPER	1		L.H.
8	03H1524	BOLT	2		5/16" X 1"
8	12H303	LOCK WASHER	2		5/16"
8	14H785	NUT	2		5/16"
9	A47746	BRACKET	1		
10	A48102	SHANK	1		
11	19H1820	CAP SCREW	2		1/2" X 3"
11	K40014	LOCK NUT	2		12.700 MM (1/2")
12	03H1268	BOLT	4		5/16" X 3/4"
12	12H291	LOCK WASHER	4		5/16"
12	14H785	NUT	4		5/16"
13	14M7289	NUT	2		M16
14	12H247	LOCK WASHER	2		5/8"
15	24H1825	WASHER	2		11/16" X 1-1/2" X 0.194"
16	16H750	RIVET	12		1/4" X 1-3/4"
17	A47974	HOUSING	2		
18	AA34616	BALL BEARING	2		
19	AA34617	BEARING WITH HOUSING	2		
20	A47973	WASHER	2		
21	A47791	BOLT	2		
22	AA57748	DISK BLADE	1		(SUB FOR AA33718) (ILLUSTRATED) SMOOTH, INCLUDES B28068 SLUG
22	AA57749	DISK BLADE	1		(SUB FOR AA33719) NOTCHED, INCLUDES B28068 SLUG
23	AA58320	DISK BLADE	1		(SUB FOR AA34619) NOTCHED
23	AA58319	DISK BLADE	1		(SUB FOR AA34618) (ILLUSTRATED) SMOOTH

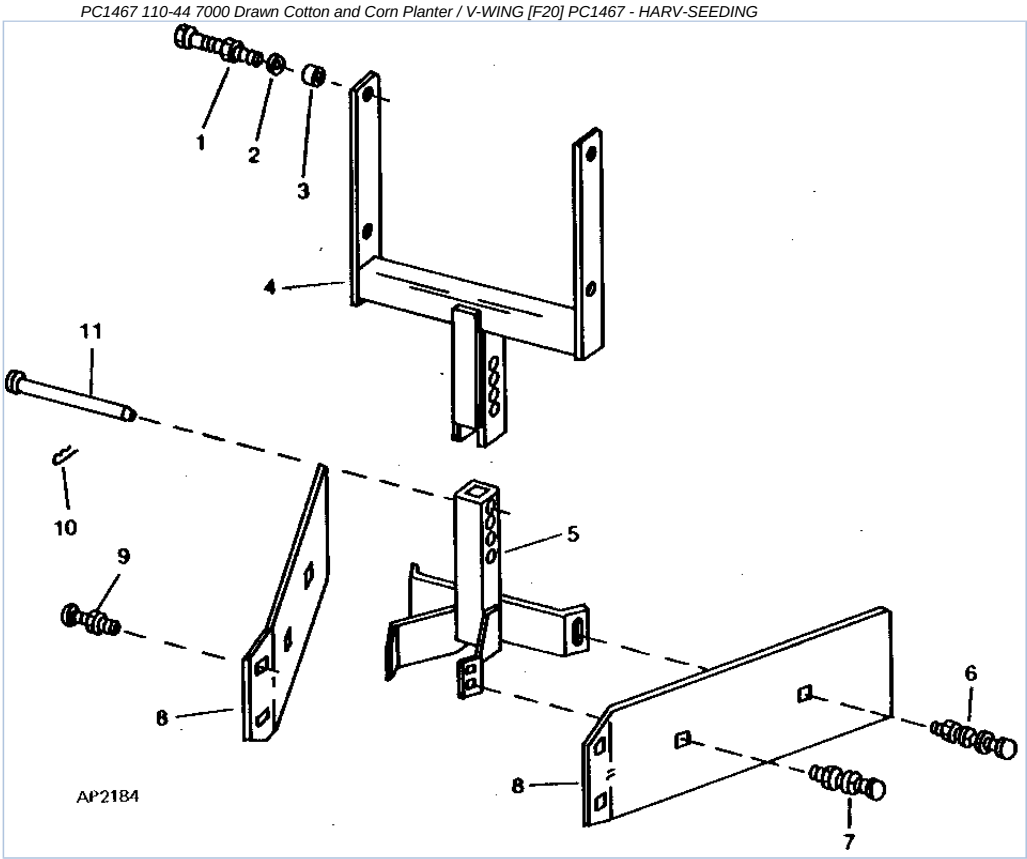


Список деталей
SEEDING

PC1467 110-44 7000 Drawn Cotton and Corn Planter / V-WING [F20] PC1467 - HARV-

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	19H1721	CAP SCREW	4		1/2" X 1-1/2"
1	K40014	LOCK NUT	4		12.700 MM (1/2")
2	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
3	H1815B	BUSHING	4		
4	AA22987	SUPPORT	1		
5	AA22623	SHANK	1		
6	03H1500	BOLT	2		3/8" X 1"
6	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
6	12H304	LOCK WASHER	2		3/8"
6	14H1076	NUT	2		3/8"
7	03H1500	BOLT	2		3/8" X 1"
7	12H304	LOCK WASHER	2		3/8"
7	14H1076	NUT	2		3/8"
8	A24205	DEFLECTOR	2		
9	03H1463	BOLT	2		3/8" X 3/4"
9	14H1076	NUT	2		3/8"
10	S2955DW	PIN	1	_____-1985	(SUB A15147)
10	A15147	SPRING LOCKING PIN	1		
11	KK5293B	PIN FASTENER	1		12.700 X 88.900 MM (1/2" X 3-1/2")

PC1467 120-1 7000 Drawn Cotton and Corn Planter / LEFT-HAND MARKER LIFT CABLE (4R NARROW, 4R WIDE AND 6R NARROW) [G02] PC1467 - HARV-SEEDING

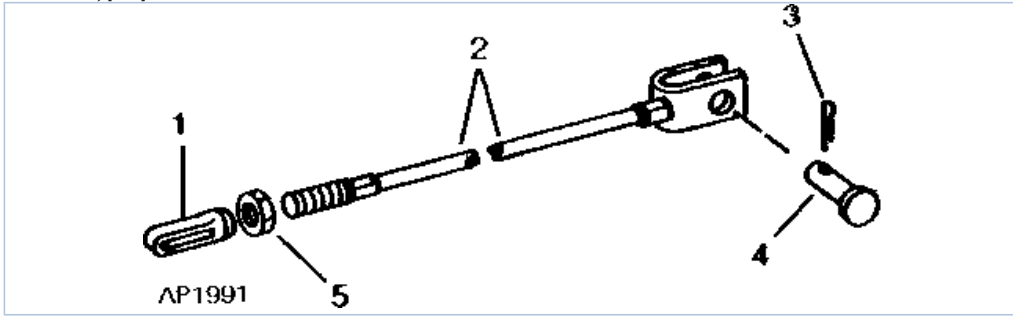

Список деталей

PC1467 120-1 7000 Drawn Cotton and Corn Planter / LEFT-HAND MARKER LIFT CABLE
(4R NARROW, 4R WIDE AND 6R NARROW) [G02] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25997	NUT	1		
2	AA23565	CABLE	1		2 450 MM (96-15/32") FOR 4W, 4N
2	AA23566	CABLE	1		3 212 MM (126-15/32") FOR 6N
3	11H237	COTTER PIN	1		1/8" X 2"
4	A26927	PIN FASTENER	1		15.875 X 39.624 MM (5/8" X 1.560")
5	14H821	NUT	1		5/8"

PC1467 - HARV-SEEDING




Список деталей

PC1467 120-2 7000 Drawn Cotton and Corn Planter / MARKER (4R NARROW, 4R WIDE,
AND 6R NARROW) [G03] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25964	STRAP	2		
2	03H1836	BOLT	2		3/8" X 3-1/2"
2	12H304	LOCK WASHER	2		3/8"
2	14H1076	NUT	2		3/8"
3	M43048	REFLECTOR	2		REAR OF R.H. AND L.H. MARKERS
4	17H1566	RIVET	1		1/2" X 7-1/2"
5	A26127	SPRING	1		
6	A26092	LOCK NUT	1	_____ -1975	(SUB A29188)
6	A29188	NUT	1		
7	AA23526	CLEVIS	1		R.H.
7	AA23525	CLEVIS	1		L.H.
8	19H1732	CAP SCREW	2		3/8" X 1-1/4"
8	12H304	LOCK WASHER	2		3/8"
8	14H1076	NUT	2		3/8"
9	A26927	PIN FASTENER	1		15.875 X 39.624 MM (5/8" X 1.560")
10	11H237	COTTER PIN	1		1/8" X 2"
11	A25994	SPACER	1		
12	A28255	PIN FASTENER	1		12.700 X 222.250 MM (1/2" X 8-3/4")
13	11H216	COTTER PIN	2		3/16" X 1"
14	AA22596	PLATE	1		R.H.
14	AA22595	PLATE	1		L.H.
15	11H218	COTTER PIN	1		3/16" X 1-1/2"
16	19H1947	CAP SCREW	1		(A) (C) 5/16" X 2-1/2", GRADE "B" SHEAR BOLT
16	K40002	LOCK NUT	1		(A) (C) 7.925 MM (5/16") (SUB FOR T25249)
17	A25966	PIN FASTENER	1		
18	24H1265	WASHER	2		13/16" X 1-1/4" X 0.060"
19	A26123	BOLT	1		
20	AW16787	RIVET	6		(SUB FOR B30585)
21	A21768	REFLECTOR	1		
22	AA22417	FRAME	1	_____ -1976	(B) R.H.
22	AA22417	FRAME	1		(A) (C) R.H.
22	AA22418	FRAME	1	_____ -1976	(B) L.H.
22	AA22418	FRAME	1		(A) (C) L.H.
23	AA26276	FRAME	1	1976-064400	(B) (SUB AA27419) R.H.
23	AA27419	FRAME	1		(B) R.H.
23	AA26277	FRAME	1	1976-064400	(B) (SUB AA27420) L.H.
23	AA27420	FRAME	1		(B) L.H.
24A	A33087	EXHAUST CAP	1	1976-064400	(B) (SUB A33644)
24B	A33644	CAP	1		(B)
25	11H208	COTTER PIN	1	1976-_____	(B) 5/16" X 2-1/2"
26	19H1733	CAP SCREW	4	064401-_____	(B) 3/8" X 2-1/2"
26	12H304	LOCK WASHER	4	064401-_____	(B) 3/8"
26	14H1076	NUT	4	064401-_____	(B) 3/8"

PC1467 120-4 7000 Drawn Cotton and Corn Planter / MARKER (-1977)(6R WIDE AND 8R NARROW) [G05] PC1467 - HARV-SEEDING

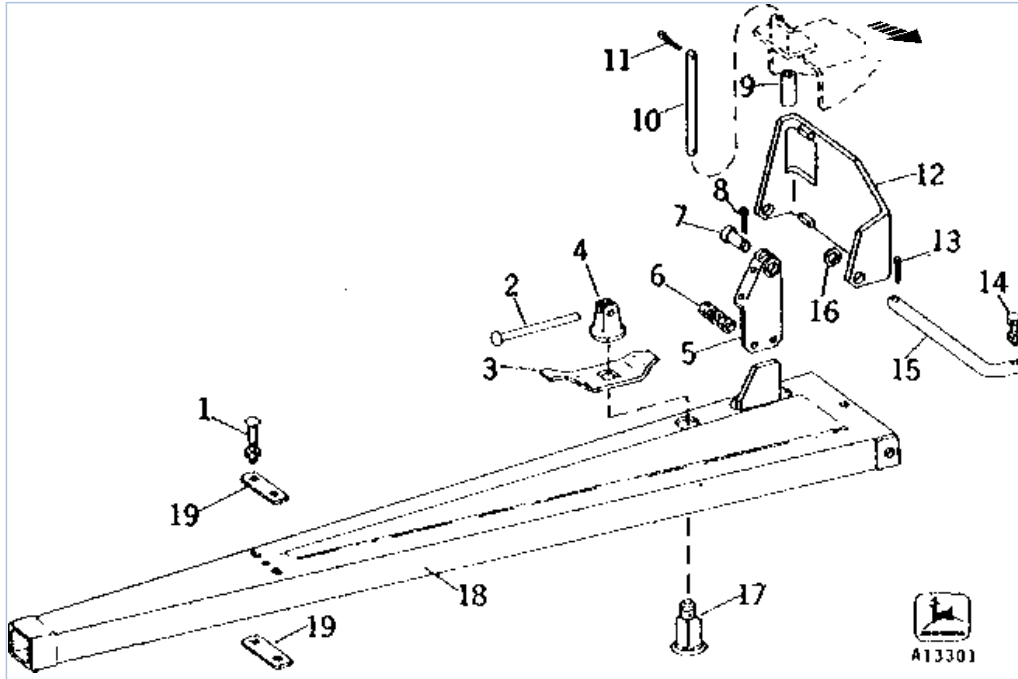


Список деталей

PC1467 120-4 7000 Drawn Cotton and Corn Planter / MARKER (-1977)(6R WIDE AND 8R NARROW) [G05] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1836	BOLT	2		3/8" X 3-1/2"
1	12H304	LOCK WASHER	2		3/8"
1	14H1076	NUT	2		3/8"
2	17H1566	RIVET	1		1/2" X 7-1/2"
3	A26127	SPRING	1		
4	A26092	LOCK NUT	1	_____-1975	(SUB A29188)
4	A29188	NUT	1		
5	AA23526	CLEVIS	1		R.H.
5	AA23525	CLEVIS	1		L.H.
6	19H1732	CAP SCREW	1		3/8" X 1-1/4"
6	12H304	LOCK WASHER	1		3/8"
6	14H1076	NUT	1		3/8"
7	A26927	PIN FASTENER	1		15.875 X 39.624 MM (5/8" X 1.560")
8	11H237	COTTER PIN	1		1/8" X 2"
9	A25994	SPACER	1		
10	A28255	PIN FASTENER	1		12.700 X 222.250 MM (1/2" X 8-3/4")
11	11H216	COTTER PIN	1		3/16" X 1"
12	AA22596	PLATE	1		
12	AA22595	PLATE	1		
13	11H218	COTTER PIN	1		3/16" X 1-1/2"
14	19H1947	CAP SCREW	1		5/16" X 2-1/2", GRADE "B" SHEAR BOLT
14	K40002	LOCK NUT	1		7.925 MM (5/16") (SUB FOR T25249)
15	A25966	PIN FASTENER	1		
16	24H1265	WASHER	2		13/16" X 1-1/4" X 0.060"
17	A26123	BOLT	1		
18	AA22492	FRAME	1		R.H.
18	AA22493	FRAME	1		L.H.
19	A25964	STRAP	2		

PC1467 120-6 7000 Drawn Cotton and Corn Planter / FOLDING MARKER (1977-)(6R WIDE AND 8R NARROW) [G06]
PC1467 - HARV-SEEDING

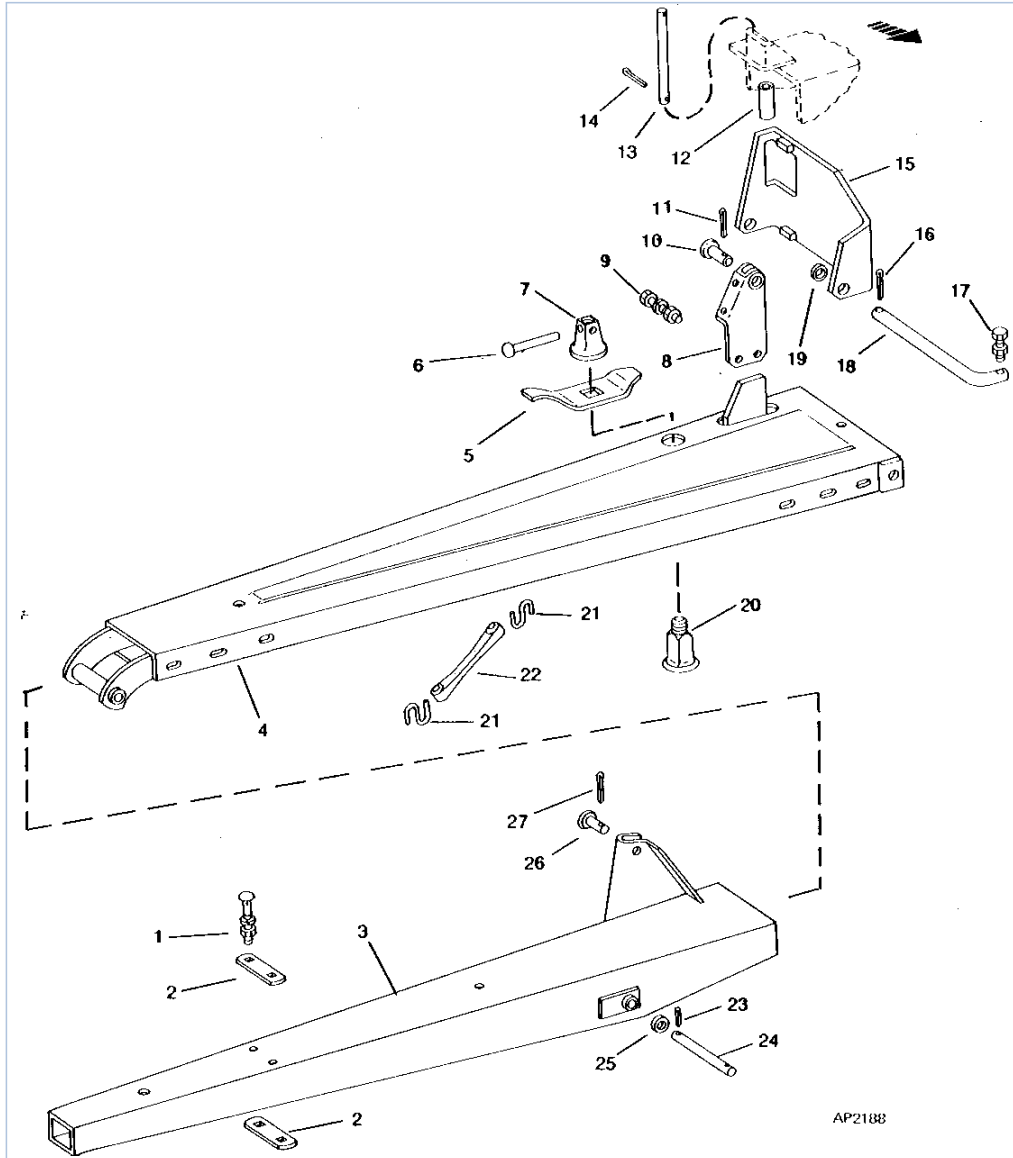


Список деталей

PC1467 120-6 7000 Drawn Cotton and Corn Planter / FOLDING MARKER (1977-)(6R WIDE AND 8R NARROW) [G06] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1836	BOLT	2		3/8" X 3-1/2"
1	12H304	LOCK WASHER	2		3/8"
1	14H1076	NUT	2		3/8"
2	A25964	STRAP	2		
3	AA25520	FRAME	1		R.H. OUTER MARKER
3	AA26298	FRAME	1		L.H. OUTER MARKER
4	AA25487	FRAME	1		R.H. INNER MARKER
4	AA25488	FRAME	1		L.H. INNER MARKER
5	A26127	SPRING	1		
6	17H1566	RIVET	1		1/2" X 7-1/2"
7	A29188	NUT	1		
8	AA23526	CLEVIS	1		R.H.
8	AA23525	CLEVIS	1		L.H.
9	19H1732	CAP SCREW	2		3/8" X 1-1/4"
9	12H304	LOCK WASHER	2		3/8"
9	14H1076	NUT	2		3/8"
10	A26927	PIN FASTENER	1		15.875 X 39.624 MM (5/8" X 1.560")
11	11H237	COTTER PIN	1		1/8" X 2"
12	A25994	SPACER	1		
13	A28255	PIN FASTENER	1		12.700 X 222.250 MM (1/2" X 8-3/4")
14	11H216	COTTER PIN	2		3/16" X 1"
15	AA22596	PLATE	1		
15	AA22595	PLATE	1		
16	11H218	COTTER PIN	1		3/16" X 1-1/2"
17	19H1947	CAP SCREW	1		5/16" X 2-1/2", GRADE "B" SHEAR BOLT
17	K40002	LOCK NUT	1		7.925 MM (5/16") (SUB FOR T25249)
18	A25966	PIN FASTENER	1		
19	24H1265	WASHER	2		13/16" X 1-1/4" X 0.060"
20	A26123	BOLT	1		
21	A26375	HOOK	2		
22	A26181	STRAP	1		
23	11H215	COTTER PIN	2		1/4" X 1-1/2"
24	A25931	PIN FASTENER	1		
25	24H1265	WASHER	2		13/16" X 1-1/4" X 0.060"
26	A23089	PIN FASTENER	1		
27	11H239	COTTER PIN	1		5/32" X 1"

PC1467 120-8 7000 Drawn Cotton and Corn Planter / FOLDING MARKER (8R WIDE AND 12R NARROW) [G08] PC1467 - HARV-SEEDING

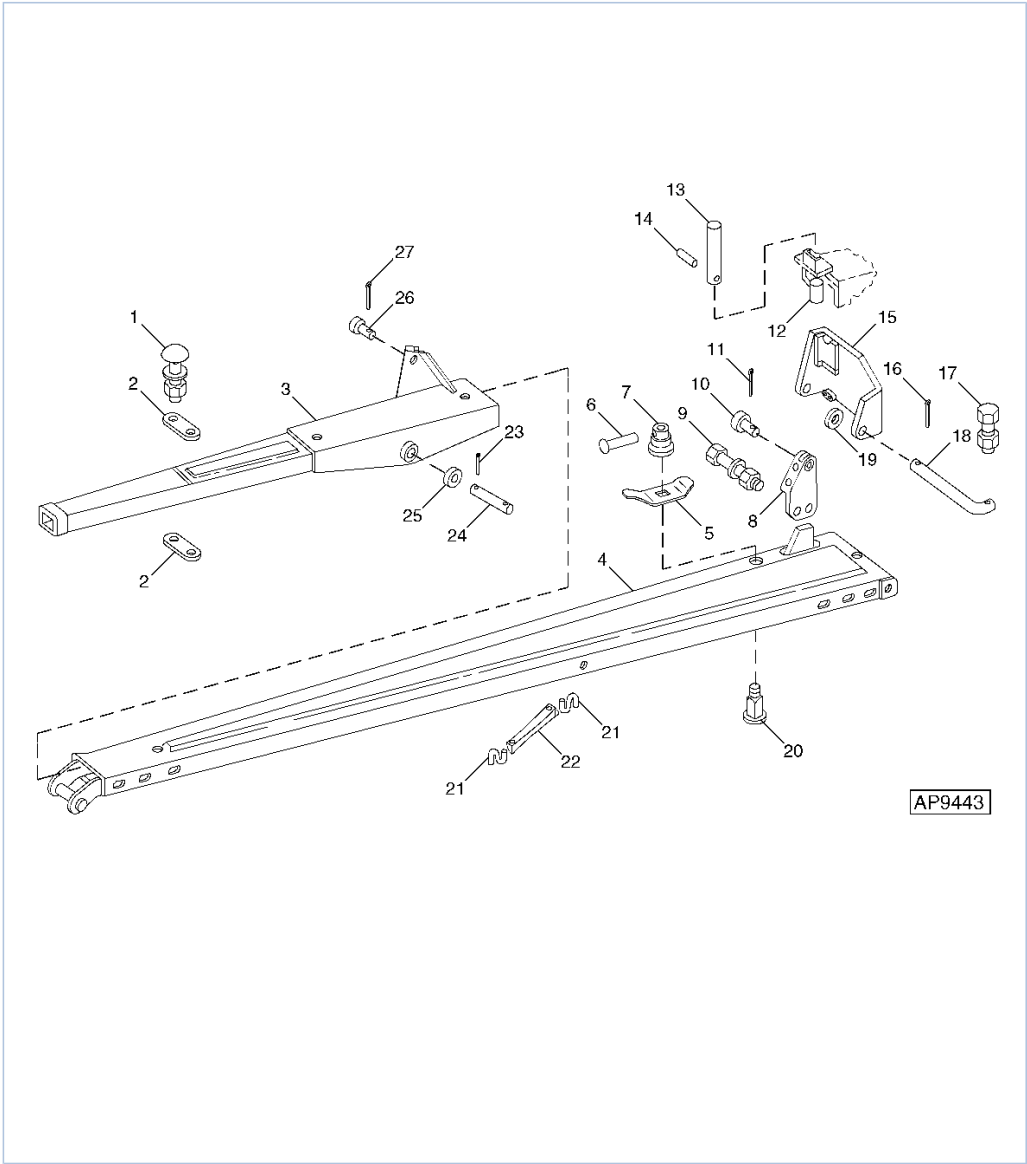


Список деталей

PC1467 120-8 7000 Drawn Cotton and Corn Planter / FOLDING MARKER (8R WIDE AND 12R NARROW) [G08] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1836	BOLT	2		3/8" X 3-1/2"
1	12H304	LOCK WASHER	2		3/8"
1	14H1076	NUT	2		3/8"
2	A25964	STRAP	2		
3	AA22677	FRAME	1		R.H. OUTER MARKER
3	AA22678	FRAME	1		L.H. OUTER MARKER
4	AA23091	FRAME	1		R.H. INNER MARKER, FOR 12-ROW NARROW OR TWO 6-ROW NARROW PLTRS. W/530 HITCH
4	AA23090	FRAME	1		L.H. INNER MARKER, FOR 12-ROW NARROW OR TWO 6-ROW NARROW PLTRS. W/530 HITCH
4	AA23087	FRAME	1		R.H. INNER MARKER, FOR 8-ROW WIDE
4	AA23085	FRAME	1		L.H. INNER MARKER, FOR 8-ROW WIDE
5	A26127	SPRING	1		
6	17H1566	RIVET	1		1/2" X 7-1/2"
7	A26092	LOCK NUT	1	1975	(SUB A29188)
7	A29188	NUT	1		
8	AA23526	CLEVIS	1		R.H.
8	AA23525	CLEVIS	1		L.H.
9	19H1732	CAP SCREW	2		3/8" X 1-1/4"
9	12H304	LOCK WASHER	2		3/8"
9	14H1076	NUT	2		3/8"
10	A26927	PIN FASTENER	1		
11	11H237	COTTER PIN	1		1/8" X 2"
12	A25994	SPACER	1		
13	A28255	PIN FASTENER	1		
14	11H216	COTTER PIN	2		3/16" X 1"
15	AA22655	BRACKET	1	1982	(SUB AA28955) R.H.
15	AA28955	BRACKET	1		R.H.
15	AA22656	BRACKET	1	1982	(SUB AA28956) L.H.
15	AA28956	BRACKET	1		L.H.
16	11H218	COTTER PIN	1		3/16" X 1-1/2"
17	19H1947	CAP SCREW	1		5/16" X 2-1/2", (GRADE "B" SHEAR BOLT)
17	K40002	LOCK NUT	1		7.925 MM (5/16") (SUB FOR T25249)
18	A25936	PIN FASTENER	1		
19	24H1265	WASHER	1		13/16" X 1-1/4" X 0.060"
20	A26123	BOLT	1		
21	A26375	HOOK	2		
22	A26181	STRAP	1		
23	11H215	COTTER PIN	2		1/4" X 1-1/2"
24	A25931	PIN FASTENER	1		19.050 X 184.150 MM (3/4" X 7-1/4")
25	24H1265	WASHER	2		13/16" X 1-1/4" X 0.060"
26	A23089	PIN FASTENER	1		12.675 X 31.750 MM (0.499" X 1-1/4")
27	11H239	COTTER PIN	1		5/32" X 1"


PC1467 120-10 7000 Drawn Cotton and Corn Planter / LEFT-HAND MARKER LIFT CABLE (6R WIDE, 8R NARROW, 8R WIDE, AND 12R NARROW) [G10] PC1467 - HARV-SEEDING

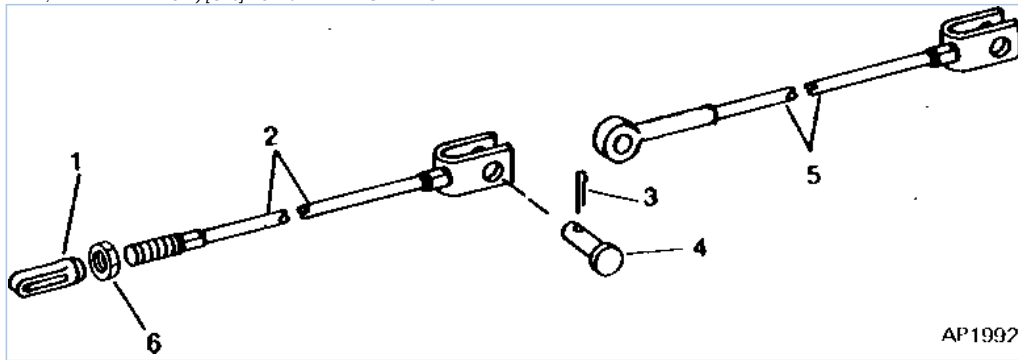

Список деталей

PC1467 120-10 7000 Drawn Cotton and Corn Planter / LEFT-HAND MARKER LIFT CABLE
(6R WIDE, 8R NARROW, 8R WIDE, AND 12R NARROW) [G10] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25997	NUT	1		
2	AA23570	CABLE	1		600 MM (23-5/8")
3	11H237	COTTER PIN	1		1/8" X 2"
4	A26927	PIN FASTENER	1		15.875 X 39.624 MM (5/8" X 1.560")
5	AA23567	CABLE	1		4 136 MM (162-27/32") FOR 6W, 8N
5	AA23568	CABLE	1		5 914 MM (232-27/32") FOR 8W
5	AA23569	CABLE	1		7 184 MM (282-27/32") FOR 12N
6	14H821	NUT	1		5/8"

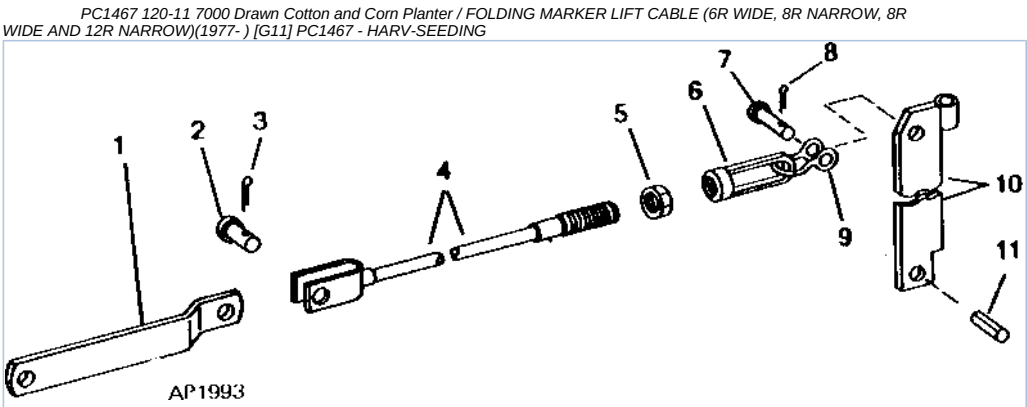


Список деталей

PC1467 120-11 7000 Drawn Cotton and Corn Planter / FOLDING MARKER LIFT CABLE (6R WIDE, 8R NARROW, 8R WIDE AND 12R NARROW)(1977-) [G11] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25932	LINK	1		
2	A23089	PIN FASTENER	1		12.675 X 31.750 MM (0.499" X 1-1/4")
3	11H240	COTTER PIN	1		5/32" X 1-1/2"
4	AA23571	CABLE	1		1 964 MM (77-5/16") FOR 8W
4	AA23572	CABLE	1		2 362 MM (93") FOR 12N
4	AA26316	PUSH PULL CABLE	1	1977- _____	1 295 MM (51") FOR 6W, 8N
5	14H821	NUT	1		5/8"
6	A25997	NUT	1		
7	P2416B	PIN FASTENER	1		9.525 X 34.925 MM (3/8" X 1-3/8")
8	11H239	COTTER PIN	1		5/32" X 1"
9	P560B	CLEVIS	1		
10	AA23388	BAR	1		
11	34H351	SPRING PIN	1		3/8" X 1-1/2"

PC1467 120-12 7000 Drawn Cotton and Corn Planter / OUTER MARKER ARM, BEARING AND DISK (4R NARROW, 4R WIDE, 6R NARROW, 6R WIDE & 8R NARROW)(-1974) [G12] PC1467 - HARV-SEEDING

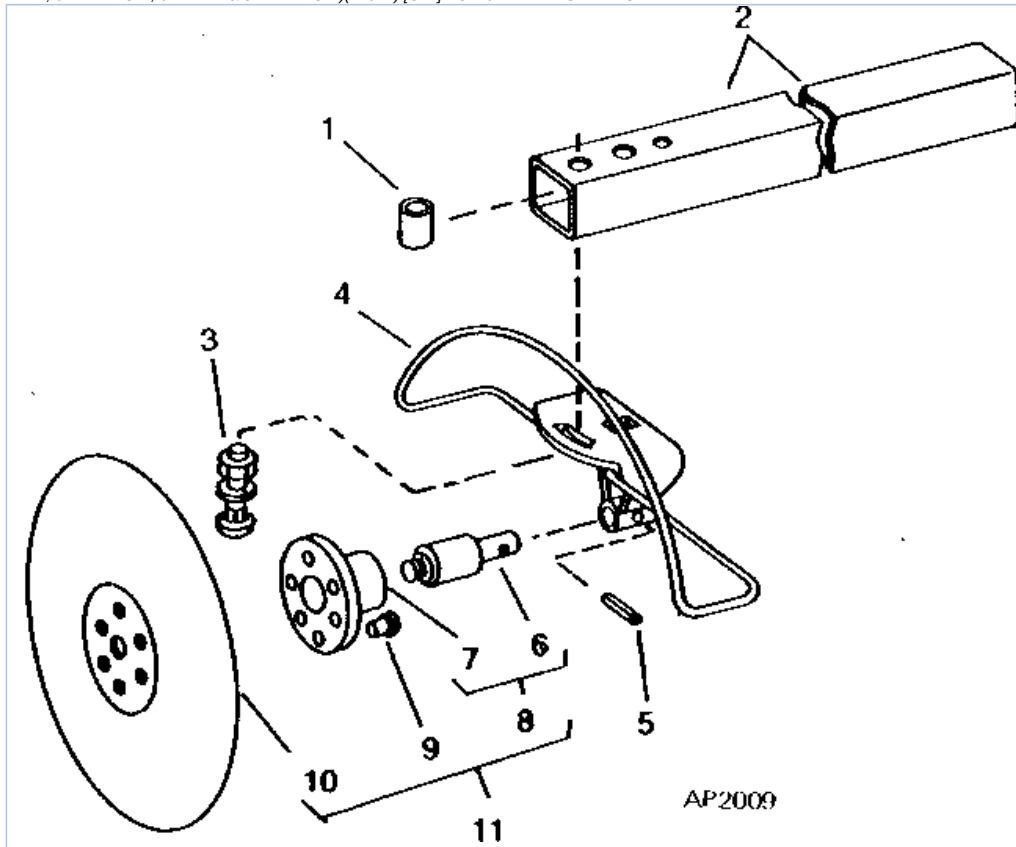


Список деталей

PC1467 120-12 7000 Drawn Cotton and Corn Planter / OUTER MARKER ARM, BEARING
AND DISK (4R NARROW, 4R WIDE, 6R NARROW, 6R WIDE & 8R NARROW)(-1974) [G12] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25987	BUSHING	1	_____-1975	(SUB 28H3184)
1	28H3184	SPACER	1		3/4" X 1.438"
2	A25259	STRUCTURAL TUBING	1		1 277.600 MM (50.299") FOR 4W, 6N
2	A25259	STRUCTURAL TUBING	1		1 277.600 MM (50.299") FOR 6W, 8N
2	A32847	BEAM	1		908 MM (35-3/4") FOR 4N
3	03H1594	BOLT	2		1/2" X 2-3/4"
3	12H301	LOCK WASHER	2		1/2"
3	14H1040	NUT	2		1/2"
4	AA23043	BRACKET	1		
5	A26311	PIN	1		6.350 X 31.750 MM (1/4" X 1-1/4")
6	AA21015	BALL BEARING	1	_____-1986	(SUB AA35741)
6	AA35741	BALL BEARING	1		
7	A22742	BEARING HOUSING W/O BEARING	1		
8	AA23384	BEARING	1		
9	16H697	RIVET	6		1/4" X 1"
10	AA57807	DISK BLADE	1		(SUB FOR AA23006) INCLUDES B28068 SLUG
11	AA21443	DISK COLTER	1		

PC1467 120-13 7000 Drawn Cotton and Corn Planter / OUTER MARKER ARM, BEARING & DISK (1974-)4R, 6R, 8R AND 12R NARROW) [G13] PC1467 - HARV-SEEDING

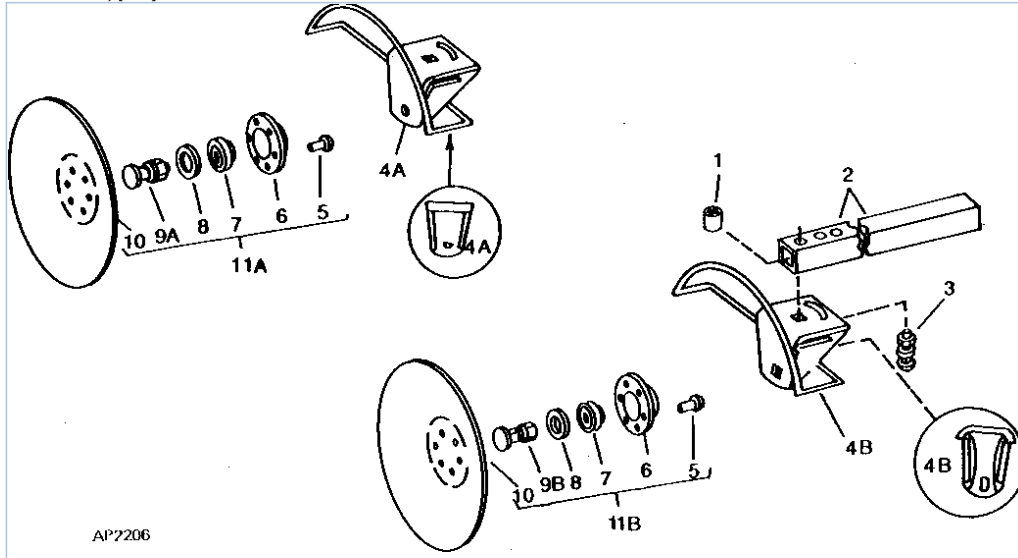


Список деталей

PC1467 120-13 7000 Drawn Cotton and Corn Planter / OUTER MARKER ARM, BEARING & DISK (1974-)4R, 6R, 8R AND 12R NARROW) [G13] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25987	BUSHING	1	- 1975	(SUB 28H3184)
1	28H3184	SPACER	1		3/4" X 1.438"
2	A25928	STRUCTURAL TUBING	1		1 395 MM (54-25/32") FOR 8W, 12N
2	A25259	STRUCTURAL TUBING	1	1977-	1 277.600 MM (50.299") 1 275 MM (50-9/32") FOR 4W, 6N, 6W, 8N
2	A32847	BEAM	1	1976-	908 MM (35.748") 908 MM (35-3/4") FOR 4N
3	03H1594	BOLT	2		1/2" X 2-3/4"
3	12H301	LOCK WASHER	2		1/2"
3	14H1040	NUT	2		1/2"
4A	AA24317	BRACKET	1	- 1977	(SUB AA25906)
4A	AA25906	BRACKET	1	- 1978	
4B	AA27924	BRACKET	1	1978-	
5	16H658	RIVET	6		1/4" X 5/8"
6	A26032	PRESSED FLANGED HOUSING	1		
7	A27002	BALL BEARING	1		
8	A41683	WASHER	1		(SUB FOR A25062)
9A	A25916	STUD	1	- 1978	
9A	12H294	LOCK WASHER	1	- 1978	5/8"
9A	14H1083	NUT	1	- 1978	5/8"
9B	A33872	BOLT	1	1978-	
9B	12H294	LOCK WASHER	1	1978-	5/8"
9B	14H1083	NUT	1	1978-	5/8"
10	AA57807	DISK BLADE	1		(SUB FOR AA23006) INCLUDES B28068 SLUG
11A	AA24318	DISK BLADE	1	- 1978	
11B	AA27928	DISK COLTER	1	1978-	


PC1467 150-1 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL HOPPER [G16] PC1467 - HARV-SEEDING

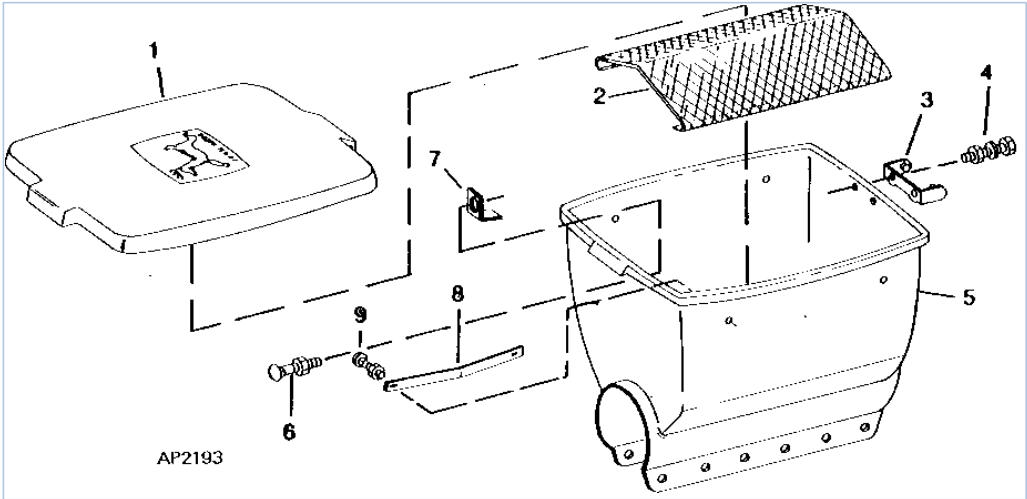

Список деталей

PC1467 150-1 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL
 HOPPER [G16] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA23225	COVER	1		
2	A26508	ISOLATOR	1		
3	A22689	HINGE	1		
4	19H1948	CAP SCREW	2		1/4" X 3/4"
4	24H1287	WASHER	2		9/32" X 5/8" X 0.065"
4	14H786	NUT	2		1/4"
5	AA23837	HOPPER	1		
6	03H1540	BOLT	6		5/16" X 3/4"
6	14H785	NUT	6		5/16"
7	A27355	ANGLE	2		
8	A28237	ANGLE	2	1974-_____	
9	03H1268	BOLT	4	1974-_____	5/16" X 3/4"
9	14H785	NUT	4	1974-_____	5/16"

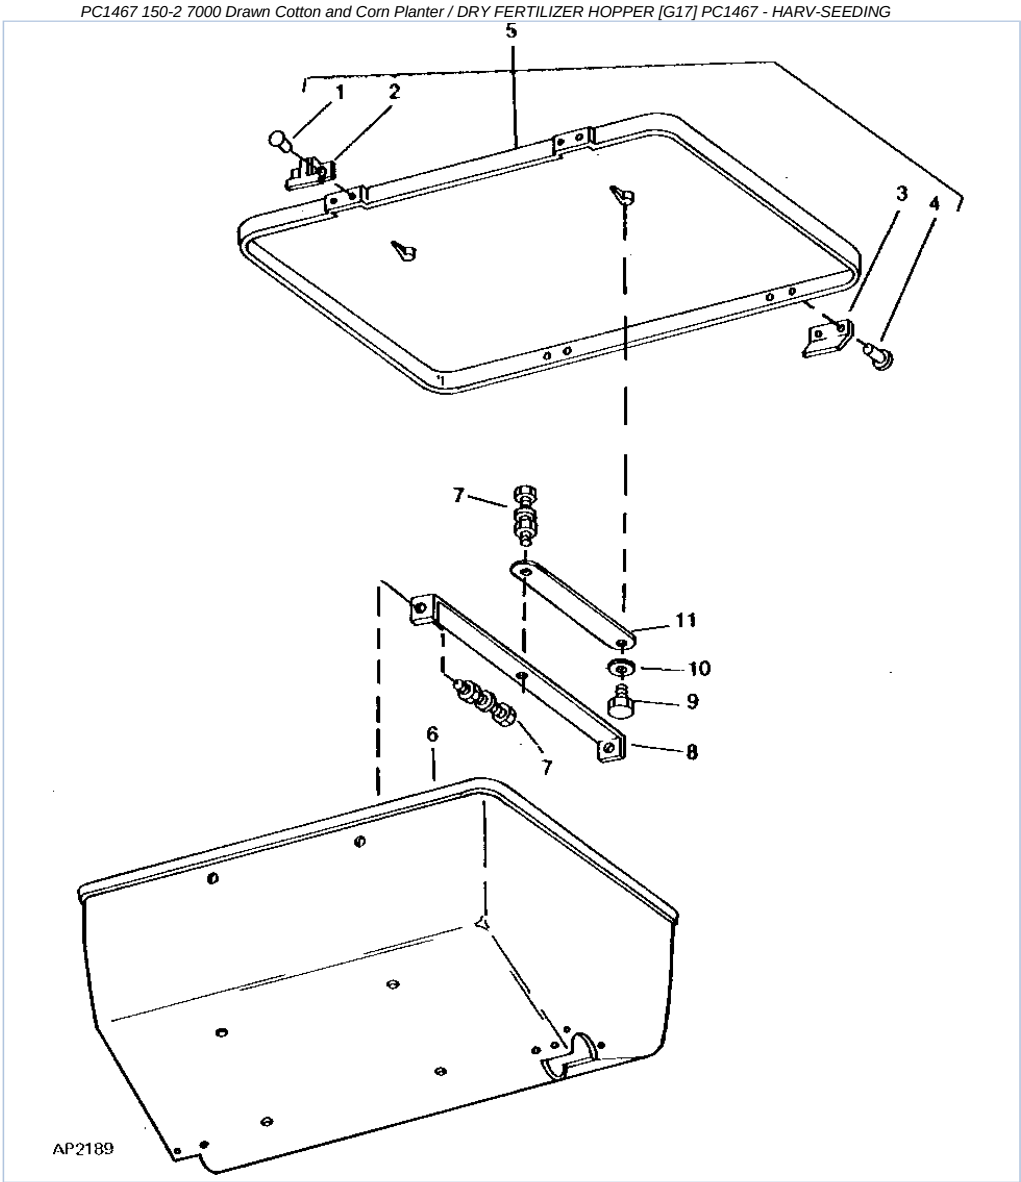


Список деталей

PC1467 150-2 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER HOPPER [G17]

PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	16H246	RIVET	4		3/16" X 3/8"
2	A25830	LATCH	2		
3	A24097	LATCH	2		
4	16H235	RIVET	4		3/16" X 1/4"
5	AA22087	COVER	1		
6	A22413	HOPPER	1		
7	19H1948	CAP SCREW	6		1/4" X 3/4"
7	24H1288	WASHER	6		9/32" X 1" X 1/16"
7	A23441	WASHER	6		
7	14H786	NUT	6		1/4"
8	A23433	CLEVIS	1		
9	19H1919	CAP SCREW	2		1/4" X 5/8"
10	24H1288	WASHER	2		9/32" X 1" X 1/16"
11	A23153	STRAP	2		

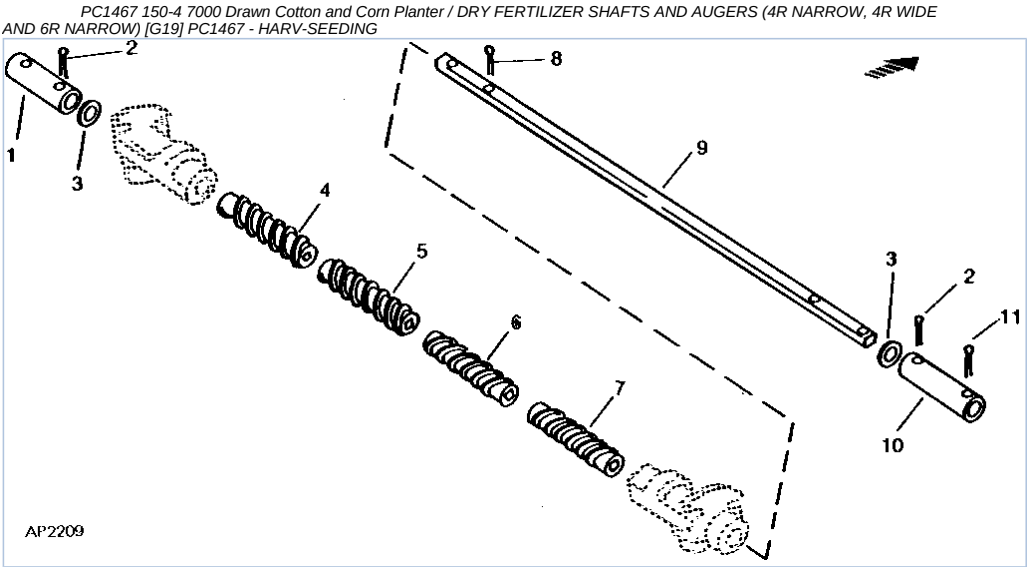


Список деталей

PC1467 150-4 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER SHAFTS AND AUGERS (4R NARROW, 4R WIDE AND 6R NARROW) [G19] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A24008	BUSHING	1		(321 MM) FOR 6-ROW NARROW
2	11H215	COTTER PIN	1		1/4" X 1-1/2", FOR 6-ROW NARROW
3	24H1167	WASHER	AR		15/16" X 1-3/8" X 0.105"
4	B10571	AUGER	2		L.H., OUTSIDE, REGULAR RATE; FOR 4-ROW
4	B10571	AUGER	3		L.H., OUTSIDE, REGULAR RATE; FOR 6-ROW NARROW
4	B12073	AUGER	2		L.H., OUTSIDE, LOW RATE; FOR 4-ROW
4	B12073	AUGER	3		L.H., OUTSIDE, LOW RATE; FOR 6-ROW NARROW
4	B10575	AUGER	2		L.H., OUTSIDE, HIGH RATE; FOR 4-ROW
4	B10575	AUGER	3		L.H., OUTSIDE, HIGH RATE; FOR 6-ROW NARROW
5	B10573	AUGER	2		L.H., INSIDE, REGULAR RATE; FOR 4-ROW
5	B10573	AUGER	3		L.H., INSIDE, REGULAR RATE; FOR 6-ROW NARROW
5	B11547	AUGER	2		L.H., INSIDE, LOW RATE; FOR 4-ROW
5	B11547	AUGER	3		L.H., INSIDE, LOW RATE; FOR 6-ROW NARROW
5	B10577	AUGER	2		L.H., INSIDE, HIGH RATE; FOR 4-ROW
5	B10577	AUGER	3		L.H., INSIDE, HIGH RATE; FOR 6-ROW NARROW
6	B10572	AUGER	2		R.H., INSIDE, REGULAR RATE; FOR 4-ROW
6	B10572	AUGER	3		R.H., INSIDE, REGULAR RATE; FOR 6-ROW NARROW
6	B11546	AUGER	2		R.H., INSIDE, LOW RATE; FOR 4-ROW
6	B11546	AUGER	3		R.H., INSIDE, LOW RATE; FOR 6-ROW NARROW
6	B10576	AUGER	2		R.H., INSIDE, HIGH RATE; FOR 4-ROW
6	B10576	AUGER	3		R.H., INSIDE, HIGH RATE; FOR 6-ROW NARROW
7	B10570	AUGER	2		R.H., OUTSIDE, REGULAR RATE; FOR 4-ROW
7	B10570	AUGER	3		R.H., OUTSIDE, REGULAR RATE; FOR 6-ROW NARROW
7	B12072	AUGER	2		R.H., OUTSIDE, LOW RATE; FOR 4-ROW
7	B12072	AUGER	3		R.H., OUTSIDE, LOW RATE; FOR 6-ROW NARROW
7	B10574	AUGER	2		R.H., OUTSIDE, HIGH RATE; FOR 4-ROW
7	B10574	AUGER	3		R.H., OUTSIDE, HIGH RATE; FOR 6-ROW NARROW
8	11H218	COTTER PIN	4		3/16" X 1-1/2", FOR 4-ROW
8	11H218	COTTER PIN	6		3/16" X 1-1/2", FOR 6-ROW NARROW
9	B16051	SHAFT	2		FOR 4-ROW
9	B16051	SHAFT	3		FOR 6-ROW NARROW
10	A24007	BUSHING	1		L.H., 56 MM (2-3/16") FOR 4-ROW
10	A24009	PIPE	1		R.H., 650 MM (25-9/16") FOR 4-ROW
10	A24006	BUSHING	2		68 MM (2-11/16") FOR 6-ROW NARROW
11	11H218	COTTER PIN	1		3/16" X 1-1/2"


PC1467 150-5 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER HOPPER SUPPORTS AND SPOUTS [G20]
PC1467 - HARV-SEEDING

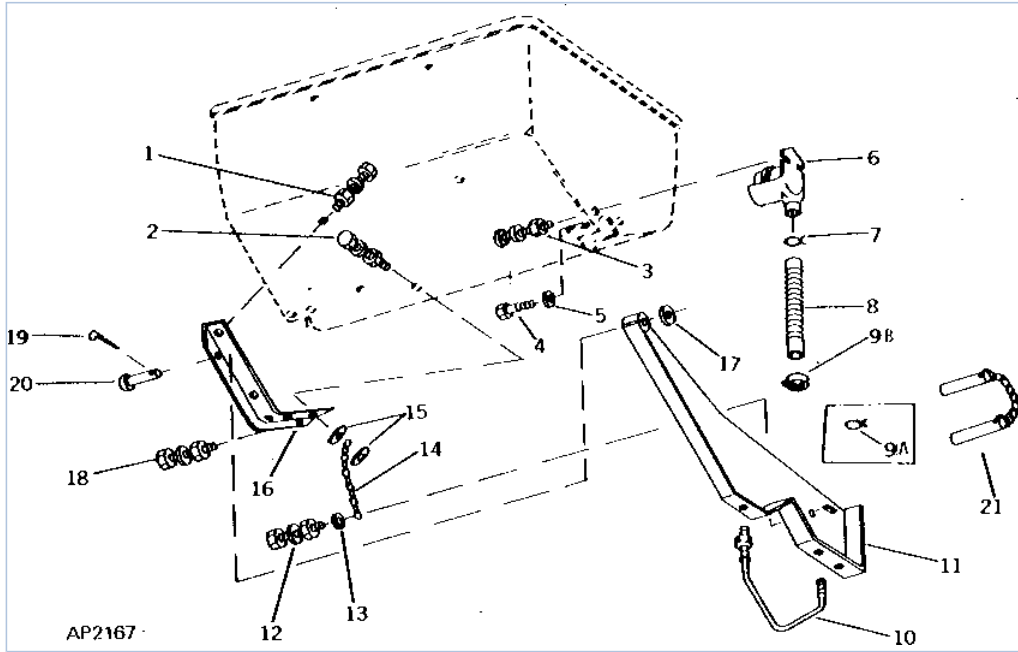

Список деталей

PC1467 150-5 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER HOPPER
SUPPORTS AND SPOUTS [G20] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	YEAR	ПРИМЕЧАНИЯ
1	19H1731	CAP SCREW	4		3/8" X 1"
1	24H1219	WASHER	4		7/16" X 1" X 0.083"
1	A23441	WASHER	4		
1	14H1076	NUT	4		3/8"
2	19H1732	CAP SCREW	2		3/8" X 1-1/4"
2	24H1219	WASHER	2		7/16" X 1" X 0.083"
2	A23441	WASHER	2		
2	14H1076	NUT	2		3/8"
3	03H1463	BOLT	4		3/8" X 3/4"
3	24H1219	WASHER	4		7/16" X 1" X 0.083"
3	14H732	NUT	4		3/8"
4	19H1936	CAP SCREW	4		3/8" X 3/4"
5	24H1219	WASHER	4		7/16" X 1" X 0.083"
6	A22412	SPOUT	2		
7	H2903B	CLAMP	2	_____-1985	(SUB AR21840)
7	AR21840	HOSE CLAMP	2		
8	B35601	HOSE	2		
9A	A21567	HOSE	2	_____-1976	(SUB AR21840)
9B	AR21840	HOSE CLAMP	2		
10	A23434	U-BOLT	2		127 MM X 178 MM (5" X 7")
10	A23435	U-BOLT	2		178 MM X 178 MM (7" X 7")
10	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
10	14H1040	NUT	4		1/2"
11	AA21440	SUPPORT	1		(ILLUSTRATED), R.H.
11	AA21441	SUPPORT	1		L.H.
12	19H1936	CAP SCREW	2		3/8" X 3/4"
12	24H1219	WASHER	2		7/16" X 1" X 0.083"
12	14H1076	NUT	2		3/8"
13	24H1219	WASHER	2		7/16" X 1" X 0.083"
14	A25758	LINK CHAIN	2		457 MM (14") 10 LINKS
15	24H1219	WASHER	4		7/16" X 1" X 0.083"
16	A24002	SADDLE	2		
17	24H1219	WASHER	2		7/16" X 1" X 0.083"
18	19H1936	CAP SCREW	2		3/8" X 3/4"
18	24H1219	WASHER	2		7/16" X 1" X 0.083"
18	14H1076	NUT	2		3/8"
19	11H236	COTTER PIN	2		1/8" X 1"
20	X1301C	PIN FASTENER	2		
21	AB10150	TOOL	1		

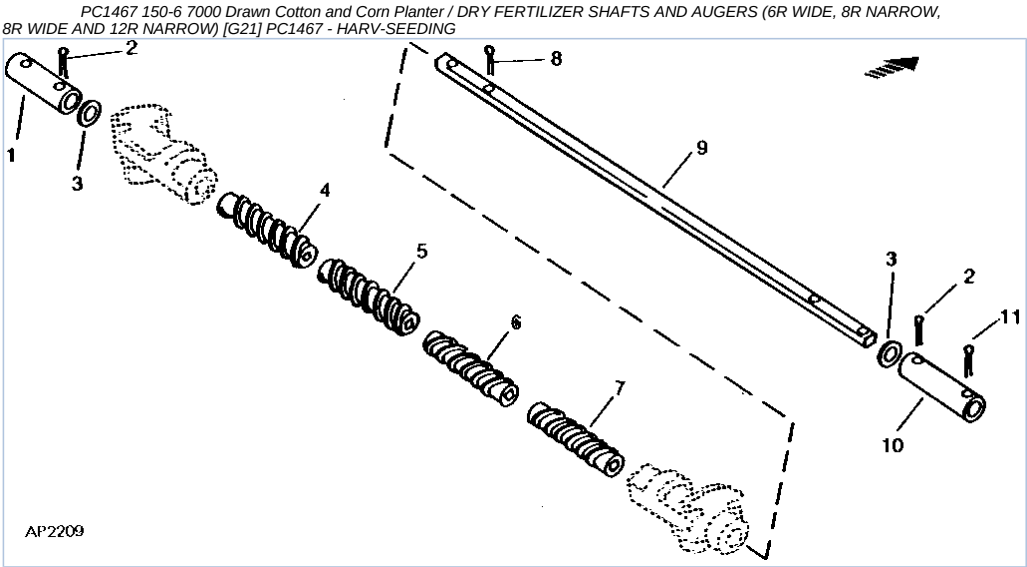


Список деталей

PC1467 150-6 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER SHAFTS AND AUGERS (6R WIDE, 8R NARROW, 8R WIDE AND 12R NARROW) [G21] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25588	SPACER	2		140 MM (5-1/2") FOR 6-ROW WIDE AND 8-ROW NARROW
1	A25402	PIPE	2		835 MM (32-7/8") FOR 8-ROW WIDE
1	A25141	SPACER	2		289 MM (11-29/64") FOR 12-ROW NARROW
1	A31850	PIPE	1		957 MM (38-15/16") FOR 6-ROW WIDE
2	11H215	COTTER PIN	4		1/4" X 1-1/2", FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
2	11H215	COTTER PIN	8		1/4" X 1-1/2", 12-ROW NARROW
3	24H1167	WASHER	AR		15/16" X 1-3/8" X 0.105"
4	B10571	AUGER	4		L.H., OUTSIDE, REGULAR RATE; FOIR 6-ROW NARROW, 8-ROW NARROW, 8-ROW WIDE
4	B10571	AUGER	6		L.H., OUTSIDE, REGULAR RATE; FOR 12-ROW NARROW
4	B12073	AUGER	4		L.H., OUTSIDE, LOW RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
4	B12073	AUGER	6		L.H., OUTSIDE, LOW RATE FOR 12-ROW NARROW
4	B10575	AUGER	4		L.H., OUTSIDE, HIGH RATE FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
4	B10575	AUGER	6		L.H., OUTSIDE, HIGH RATE FOR 12-ROW NARROW
5	B10573	AUGER	4		L.H., INSIDE, REGULAR RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
5	B10573	AUGER	6		L.H., INSIDE, REGULAR RATE; FOR 12-ROW NARROW
5	B11547	AUGER	4		L.H., INSIDE, LOW RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
5	B11547	AUGER	6		L.H., INSIDE, LOW RATE; FOR 12-ROW NARROW
5	B10577	AUGER	4		L.H., INSIDE, HIGH RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
5	B10577	AUGER	6		L.H., INSIDE, HIGH RATE; FOR FOR 12-ROW NARROW
6	B10572	AUGER	4		R.H., INSIDE, REGULAR RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
6	B10572	AUGER	6		R.H., INSIDE, REGULAR RATE; FOR 12-ROW NARROW
6	B11546	AUGER	4		R.H., INSIDE, LOW RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
6	B11546	AUGER	6		R.H., INSIDE, LOW RATE; FOR 12-ROW NARROW
6	B10576	AUGER	4		R.H., INSIDE, HIGH RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
6	B10576	AUGER	6		R.H., INSIDE, HIGH RATE; FOR 12-ROW NARROW
7	B10570	AUGER	4		R.H., OUTSIDE, REGULAR RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
7	B10570	AUGER	6		R.H., OUTSIDE, REGULAR RATE; FOR 12-ROW NARROW
7	B12072	AUGER	4		R.H., OUTSIDE, LOW RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
7	B12072	AUGER	6		R.H., OUTSIDE, LOW RATE; FOR 12-ROW NARROW
7	B10574	AUGER	4		R.H., OUTSIDE, HIGH RATE; FOR 6-ROW WIDE, 8-ROW NARROW, 8-ROW WIDE
7	B10574	AUGER	6		R.H., OUTSIDE, HIGH RATE; FOR 12-ROW NARROW
8	11H218	COTTER PIN	6		3/16" X 1-1/2", FOR 6-ROW WIDE
8	11H218	COTTER PIN	8		3/16" X 1-1/2", FOR 8-ROW NARROW, 8-ROW WIDE
8	11H218	COTTER PIN	12		3/16" X 1-1/2", FOR 12-ROW NARROW
9	B16051	SHAFT	3		FOR 6-ROW WIDE
9	B16051	SHAFT	4		FOR 8-ROW NARROW, 8-ROW WIDE
9	B16051	SHAFT	6		12-ROW NARROW
10	A25141	SPACER	2		289 MM (11-3/8") FOR 6-ROW WIDE, 8-ROW NARROW, 12-ROW NARROW
10	A25403	LOCKING COLLAR	2		350 MM (13-3/4") FOR 8-ROW WIDE
11	11H218	COTTER PIN	1		3/16" X 1-1/2"

PC1467 150-8 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL ATTACHMENT (4 ROW NARROW, 4 ROW WIDE AND 6 ROW NARROW) [G23] PC1467 - HARV-SEEDING

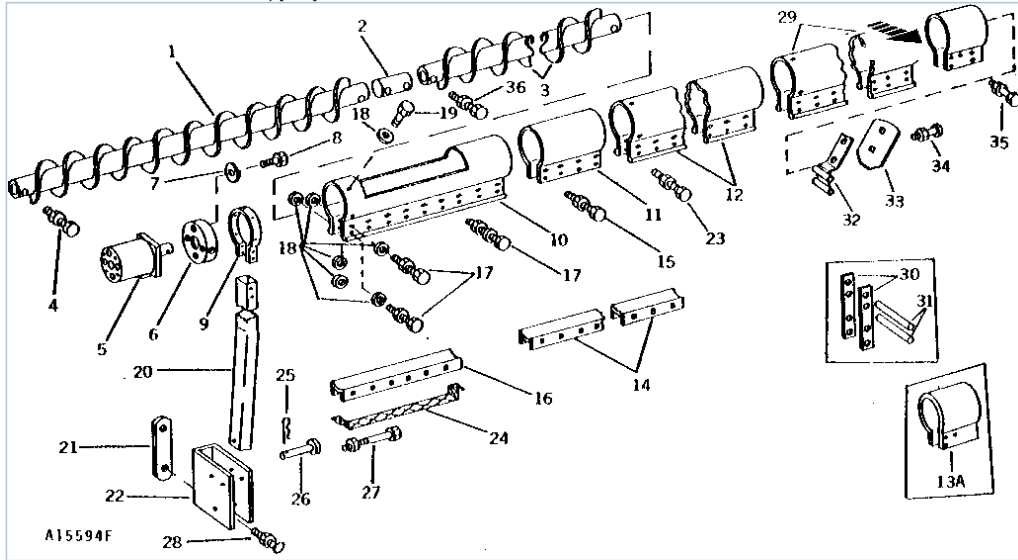


Список деталей

PC1467 150-8 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL
ATTACHMENT (4 ROW NARROW, 4 ROW WIDE AND 6 ROW NARROW) [G23] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	YEAR	ПРИМЕЧАНИЯ
1	AA23531	AUGER	2		(A) (B)
1	AA23531	AUGER	1		(C)
2	A24868	PIN	2	1976-	(SUB A33075)
2	A33075	PIN FASTENER	2		22.225 X 89 MM (7/8" X 3.504")
3	AA23532	AUGER	1		(A) (B)
3	AA23532	AUGER	2		(C)
4	19H2010	CAP SCREW	1		1/4" X 1-3/4"
4	K40001	LOCK NUT	1		6.350 MM (1/4")
5	AA23541	MOTOR	1	1989-	(SUB AA36915) (MARKED 101-1409-007)
5	AA36915	HYDRAULIC MOTOR	1		(MARKED 101-1409-009)
6	A26754	HOUSING	1		
7	12H304	LOCK WASHER	4		3/8"
8	19H1936	CAP SCREW	4		3/8" X 3/4"
9	A24777	CLAMP	1		
10	A26506	TUBE	1		
11	A24863	BAND	2		
12	A26407	TUBE	1		(A) (B)
12	A26407	TUBE	2		(C)
13A	AA24078	GUARD	1	1974-	(SUB A27250, (2) A28162, (2) H84473, (4) K40002 AND (4) 19H1900)
13B	A27250	CLAMP	1		
14	A26933	BUSHING	1		(A) (B) 1473 MM (58") (CUT TO LENGTH REQUIRED)
14	A26933	BUSHING	2		(C) 1473 MM (58") (CUT TO LENGTH REQUIRED)
15	19H1900	CAP SCREW	AR		5/16" X 3/4"
15	K40002	LOCK NUT	AR		7.925 MM (5/16") (SUB FOR T25249)
16	A26932	CHANNEL	1		508 MM (20") (CUT TO LENGTH REQUIRED)
17	19H1921	CAP SCREW	AR		5/16" X 3-1/4"
17	K40002	LOCK NUT	AR		7.925 MM (5/16") 5/16", (SUB FOR T25249)
18	24H1224	WASHER	AR		11/32" X 1" X 1/16"
19	19H1900	CAP SCREW	AR		5/16" X 3/4"
20	A24463	SUPPORT	2		
21	A26737	STRAP	2	1980-	
21	A40318	STRAP	2	1980-	
22	A24778	BRACKET	2		
23	19H1904	CAP SCREW	5		(A) (B) 5/16" X 3", 2 USED PER SUPPORT TUBE
23	24H1224	WASHER	5		(A) (B) 11/32" X 1" X 1/16", 2 USED PER SUPPORT TUBE
23	K40002	LOCK NUT	5		(A) (B) 7.925 MM (5/16") (SUB FOR T25249) (2 PER SUPPORT TUBE)
23	19H1904	CAP SCREW	8		(C) 5/16" X 3"
23	24H1224	WASHER	8		(C) 11/32" X 1" X 1/16"
23	K40002	LOCK NUT	8		(C) 7.925 MM (5/16") (SUB FOR T25249) (2 PER SUPPORT TUBE)
24	A27332	GUARD	2	1976-	(A) (B) (SUB A31839)
24	A31839	SCREEN	2		(A) (B)
24	A27332	GUARD	3	1976-	(C) (SUB A31839)
24	A31839	SCREEN	3		(C)
25	S2955DW	PIN	2		(SUB A15147)
26	B10027	PIN FASTENER	2		11.125 X 76.200 MM (7/16" X 3")
27	19H2444	CAP SCREW	4		7/16" X 3-1/4"
27	K40006	LOCK NUT	4		11.125 MM (7/16")
28	03H2052	BOLT	2		1/2" X 6-1/2"
28	19H3535	CAP SCREW	2	1980-	1/2" X 6"
28	19H3542	CAP SCREW	2	1980-	1/2" X 6-1/2"
28	19H1991	CAP SCREW	2	1980-	1/2" X 8"
28	14H1040	NUT	2		1/2"
29	A27517	TUBE	1		(A) (B)
30	A28162	STRAP	2	1974-1976	
31	H84473	DOWEL PIN	2	1976-	
32	AA25611	SUPPORT	1	1975-	

33	A31642	SHIELD	1	1975-	
34	03H1709	BOLT	2	1975-1988	5/16" X 1"
34	K40002	LOCK NUT	2	1975-1988	7.925 MM (5/16") (SUB FOR T25249)
34	03M7184	BOLT	2	1988-	M8 X 20
34	E64256	LOCK NUT	2	1988-	M8
35	19H1904	CAP SCREW	2	1975-	5/16" X 3"
35	K40002	LOCK NUT	2	1975-	7.925 MM (5/16") (SUB FOR T25249)
36	19H1765	CAP SCREW	2		3/8" X 1-3/4"
36	K40003	LOCK NUT	2		9.525 MM (3/8")

PC1467 150-10 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL ATTACHMENT (6 ROW WIDE, 8 ROW NARROW, 8 ROW WIDE AND 12 ROW NARROW) [H01] PC1467 - HARV-SEEDING

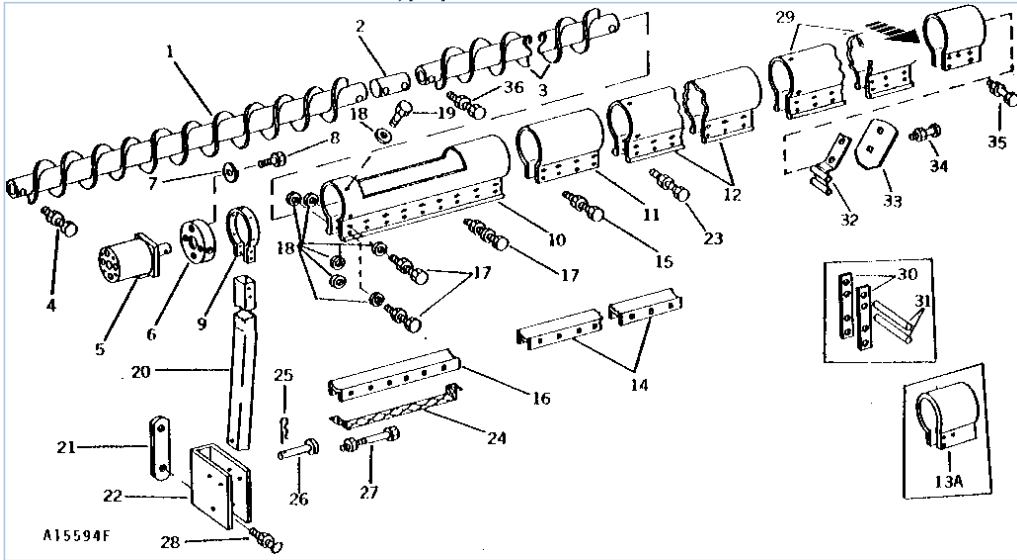


Список деталей

PC1467 150-10 7000 Drawn Cotton and Corn Planter / DRY FERTILIZER AUGER FILL
ATTACHMENT (6 ROW WIDE, 8 ROW NARROW, 8 ROW WIDE AND 12 ROW NARROW) [H01] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA23531	AUGER	1		
2	A24868	PIN	3	1976-	(A) (B) (SUB A33075)
2	A33075	PIN FASTENER	3		(A) (B) 22.225 X 89 MM (7/8" X 3.504")
2	A24868	PIN	4	1976-	(C) (SUB A33075)
2	A33075	PIN FASTENER	4		(C) 22.225 X 89 MM (7/8" X 3.504")
2	A24868	PIN	5	1976-	(D) (SUB A33075)
2	A33075	PIN FASTENER	5		(D) 22.225 X 89 MM (7/8" X 3.504")
3	AA23532	AUGER	3		(A) (B)
3	AA23532	AUGER	4		(C)
3	AA23532	AUGER	5		(D)
4	19H2010	CAP SCREW	1		1/4" X 1-3/4"
4	K40001	LOCK NUT	1		6.350 MM (1/4")
5	AA23541	MOTOR	1	1989-	(SUB AA36915) (MARKED 101-1409-007)
5	AA36915	HYDRAULIC MOTOR	1		(MARKED 101-1409-009)
6	A26754	HOUSING	1		
7	12H304	LOCK WASHER	4		3/8"
8	19H1936	CAP SCREW	4		3/8" X 3/4"
9	A24777	CLAMP	1		
10	A26506	TUBE	1		
11	A24863	BAND	3		(A) (B)
11	A24863	BAND	4		(C)
11	A24863	BAND	5		(D)
12	A26407	TUBE	3		(A) (B)
12	A26407	TUBE	4		(C)
12	A26407	TUBE	5		(D)
13A	AA24078	GUARD	1	1974-	(SUB A27250, (2) A28162, (2) H84473, (4) K40002 AND (4) 19H1900)
13B	A27250	CLAMP	1	1974-	
14	A26933	BUSHING	3		(A) (B) 1473 MM (58") (CUT TO LENGTH REQUIRED)
14	A26933	BUSHING	4		(C) 1473 MM (58") (CUT TO LENGTH REQUIRED)
14	A26933	BUSHING	5		(D) 1473 MM (58") (CUT TO LENGTH REQUIRED)
15	19H1900	CAP SCREW	AR		5/16" X 3/4"
15	K40002	LOCK NUT	AR		7.925 MM (5/16") (SUB FOR T25249)
16	A26932	CHANNEL	1		508 MM (20") (CUT TO LENGTH REQUIRED)
17	19H1921	CAP SCREW	AR		5/16" X 3-1/4"
17	K40002	LOCK NUT	AR		7.925 MM (5/16") 5/16", (SUB FOR T25249)
18	24H1224	WASHER	AR		11/32" X 1" X 1/16"
19	19H1900	CAP SCREW	AR		5/16" X 3/4"
20	A24463	SUPPORT	3		(A) (B)
20	A24463	SUPPORT	4		(C) (D)
21	A26737	STRAP	3	1980-	(A) (B)
21	A40318	STRAP	3	1980-	(A) (B)
21	A26737	STRAP	4	1980-	(C) (D)
21	A40318	STRAP	4	1980-	(C) (D)
22	A24778	BRACKET	3		(A) (B)
22	A24778	BRACKET	4		(C) (D)
23	19H1904	CAP SCREW	8		(A) 5/16" X 3", (2 USED PER SUPPORT TUBE)
23	24H1224	WASHER	8		(A) 11/32" X 1" X 1/16"
23	K40002	LOCK NUT	8		(A) 7.925 MM (5/16") (SUB FOR T25249)
23	19H1904	CAP SCREW	10		(B) (C) 5/16" X 3", (2 USED PER SUPPORT TUBE)
23	24H1224	WASHER	10		(B) (C) 11/32" X 1" X 1/16"
23	K40002	LOCK NUT	10		(B) (C) 7.925 MM (5/16") (SUB FOR T25249)
23	19H1904	CAP SCREW	16		(D) 5/16" X 3", (2 USED PER SUPPORT TUBE)
23	24H1224	WASHER	16		(D) 11/32" X 1" X 1/16"
23	K40002	LOCK NUT	16		(D) 7.925 MM (5/16") (SUB FOR T25249)
24	A27332	GUARD	4	1976-	(A) (B) (C) (SUB A31839)
24	A31839	SCREEN	4		(A) (B) (C)
24	A27332	GUARD	6		(D) (SUB A31839)

				1976	
24	A31839	SCREEN	6		(D)
25	S2955DW	PIN	3	- 1985	(A) (B) (SUB A15147)
25	A15147	SPRING LOCKING PIN	3		(A) (B)
25	S2955DW	PIN	4	- 1985	(C) (D) (SUB A15147)
25	A15147	SPRING LOCKING PIN	4		(C) (D)
26	B10027	PIN FASTENER	3		(A) (B) 11.125 X 76.200 MM (7/16" X 3")
26	B10027	PIN FASTENER	4		(C) (D) 11.125 X 76.200 MM (7/16" X 3")
27	19H2444	CAP SCREW	6		(A) (B) 7/16" X 3-1/4"
27	K40006	LOCK NUT	6		(A) (B) 11.125 MM (7/16")
27	19H2444	CAP SCREW	8		(C) (D) 7/16" X 3-1/4"
27	K40006	LOCK NUT	8		(C) (D) 11.125 MM (7/16")
28	03H2206	BOLT	6	- 1980	(A) (B) (C) 1/2" X 8-1/2"
28	19H1991	CAP SCREW	6	1980-	(A) (B) (C) 1/2" X 8"
28	14H1040	NUT	6		(A) (B) (C) 1/2"
28	03H2206	BOLT	8	- 1980	(D) 1/2" X 8-1/2"
28	19H3285	CAP SCREW	8	1980-	(D) 1/2" X 8-1/2"
28	14H1040	NUT	8		(D) 1/2"
29	A27517	TUBE	1		4-ROW PLANTERS ONLY
30	A28162	STRAP	2	1974-1976	
31	H84473	DOWEL PIN	2	1974-1976	
32	AA25611	SUPPORT	1	1975-	
33	A31642	SHIELD	1	1975-	
34	03H1709	BOLT	2	1975-1988	5/16" X 1"
34	K40002	LOCK NUT	2	1975-1988	7.925 MM (5/16") (SUB FOR T25249)
34	03M7184	BOLT	2	1988-	M8 X 20
34	E64256	LOCK NUT	2	1988-	M8
35	19H1904	CAP SCREW	2	1975-	5/16" X 3"
35	K40002	LOCK NUT	2	1975-	7.925 MM (5/16") (SUB FOR T25249)
36	19H1765	CAP SCREW	2		3/8" X 1-3/4"
36	K40003	LOCK NUT	2		9.525 MM (3/8")

PC1467 150-12 7000 Drawn Cotton and Corn Planter / FERTILIZER OPENER (LIQUID AND DRY) [H03] PC1467 - HARV-SEEDING

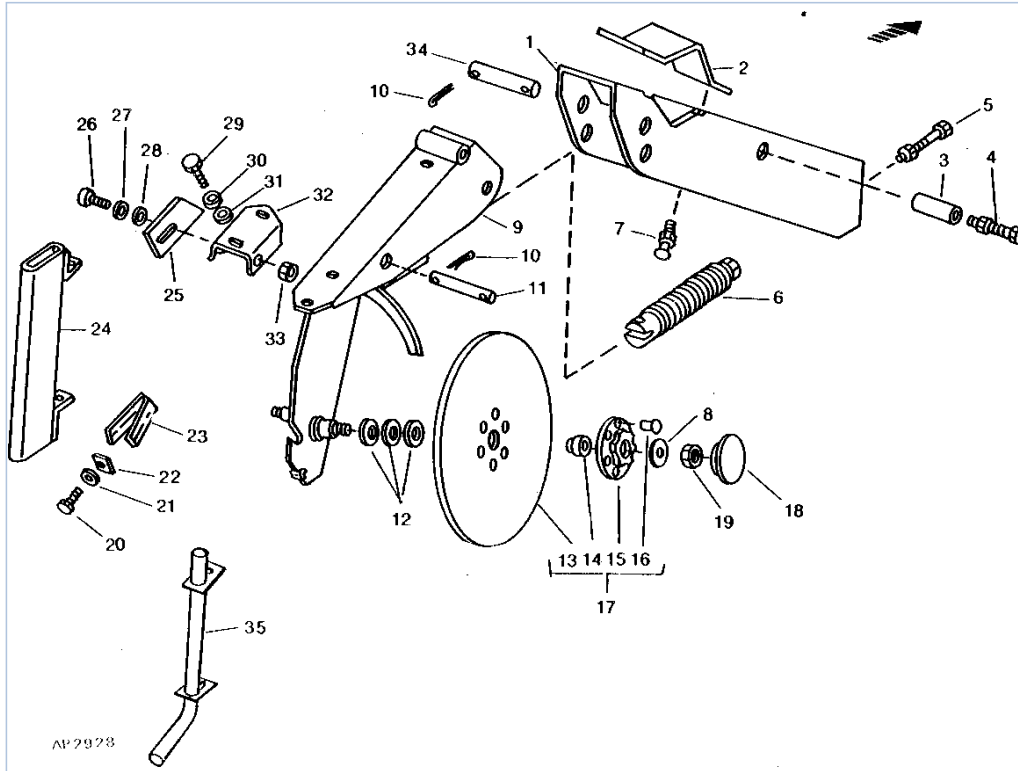


Список деталей

DRY) [H03] PC1467 - HARV-SEEDING

PC1467 150-12 7000 Drawn Cotton and Corn Planter / FERTILIZER OPENER (LIQUID AND

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA23115	BRACKET	1		
2	A26777	CLAMP	1		
3	A23662	BUSHING	1		
4	19H1781	CAP SCREW	1		1/2" X 3-1/2"
4	K40014	LOCK NUT	1		12.700 MM (1/2")
5	H77638	WHEEL BOLT	1		
5	14H866	NUT	1		
6	AA23987	SPRING ASSEMBLY	1		
7	03H1603	BOLT	2		5/8" X 2"
7	14H1039	NUT	2		5/8"
8	24H1111	WASHER	2		17/32" X 1-1/16" X 0.090"
9	AA24096	OPENER	1		
10	11H216	COTTER PIN	4		3/16" X 1"
11	A26714	PIN FASTENER	1		12.700 X 85.852 MM (1/2" X 3.380")
12	J16160	SHIM	AR		
13	A22949	DISK	2		343 MM X 3 MM (13-1/2" X .120")
14	AA21480	BALL BEARING	2		
15	A22785	HOUSING	2	- 1975	(SUB A30368)
15	A30368	HOUSING	2		(SUB B32457, B29400 AND (6) 16H735) THIS APPLICATION ONLY
15	B32457	BEARING HOUSING W/O BEARING	2		
16	16H658	RIVET	12	- 1977	1/4" X 5/8"
16	16H735	RIVET	12	1977-	1/4" X 1-1/2"
17	AA22093	BLADE	2	- 1977	(SUB AA27458, B29400) THIS APPLICATION ONLY
17	AA57466	DISK COLTER	2		(SUB FOR AA27458)
18	A22836	CAP	2	- 1977	
18	B29400	PLUG	2	1977-	
19	14H826	NUT	1		1/2", R.H. THREAD
19	14H939	NUT	1		1/2", L.H. THREAD
20	19H1900	CAP SCREW	1		5/16" X 3/4"
21	12H303	LOCK WASHER	1		5/16"
22	B35912	STRAP	1		
23	B35913	SCRAPER	1		
24	AA38905	SPOUT	1		(SUB FOR AA23112) DRY ONLY
25	A24085	SCRAPER	2		
26	03H1765	BOLT	2		3/8" X 3/4"
27	12H304	LOCK WASHER	2		3/8"
28	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
29	19H1731	CAP SCREW	2		3/8" X 1"
30	12H304	LOCK WASHER	2		3/8"
31	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
32	AA23223	BRACKET	1	- 1974	(SUB A26264)
32	A26264	BRACKET	1		
33	14H1076	NUT	1		3/8"
34	A24173	PIN FASTENER	1		12.700 X 98.552 MM (1/2" X 3.880")
35	AA23113	SPOUT	1		

PC1467 150-14 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING PUMP (4 ROW NARROW, 4 ROW WIDE, 6 ROW NARROW AND 6 ROW WIDE) [H05] PC1467 - HARV-SEEDING

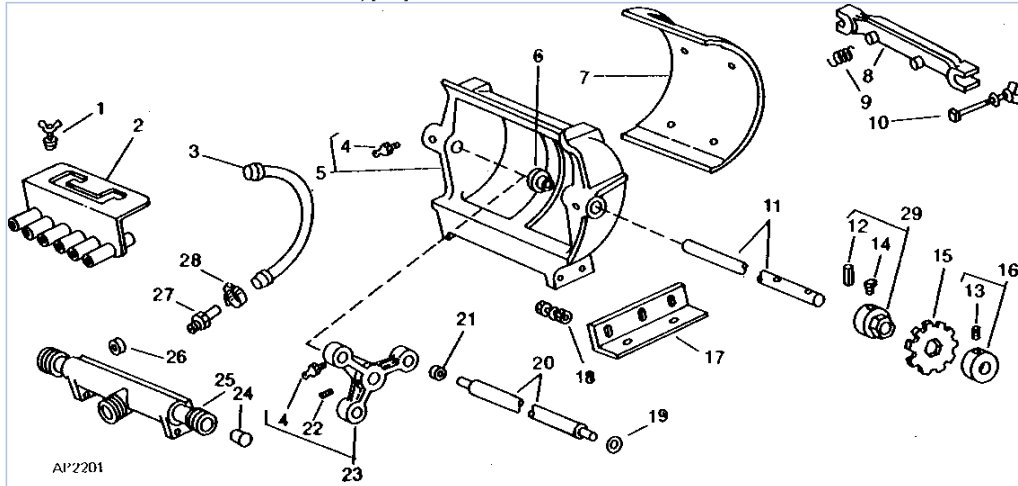


Список деталей

PC1467 150-14 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING
PUMP (4 ROW NARROW, 4 ROW WIDE, 6 ROW NARROW AND 6 ROW WIDE) [H05] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1709	BOLT	2		5/16" X 1"
1	24H1136	WASHER	2		11/32" X 11/16" X 0.065"
1	14H819	WING NUT	2		5/16"
2	AB18600	MANIFOLD	1		
3	AB18561	TUBE	1	_____-1977	(SUB A35778) SET OF 6
3	A35778	HOSE	6		
4	JD7765	LUBRICATION FITTING	3		
5	AB18560	FRAME	1		
6	B31400	BUSHING	2		
7	B31403	PLATE	1		
8	B31407	ANCHOR	2		
9	B31405	COMPRESSION SPRING	4		
10	08H4332	BOLT	4		5/16" X 1-3/4"
10	24H1136	WASHER	4		11/32" X 11/16" X 0.065"
10	14H819	WING NUT	4		5/16"
11	B31401	COUNTERSHAFT	1		
12	B31406	SPRING PIN	1	_____-1977	
12	34H344	SPRING PIN	1	1977-____	5/16" X 3-3/4"
13	22H817	SET SCREW	4		3/8" X 3/4"
14	22H844	SET SCREW	1	1978-____	3/8" X 1/2"
15	B31425	DRIVE SPROCKET	1		8-TOOTH
15	A24937	DRIVE SPROCKET	1		9-TOOTH
15	B31426	DRIVE SPROCKET	1		10-TOOTH
15	B31427	DRIVE SPROCKET	1		15-TOOTH
15	A24936	DRIVE SPROCKET	1		20-TOOTH
15	A24935	CHAIN SPROCKET	1		22-TOOTH
16	AA23706	RETAINER	1		WITH SET SCREW
17	B31404	BASE	2		FOR SHIPPING PURPOSES ONLY
18	19H1731	CAP SCREW	6		3/8" X 1"
18	14H1076	NUT	6		3/8"
19	B31410	WASHER	6		13.106 X 25.400 X 0.787 MM (33/64" X 1" X 1/32")
20	AB18602	ROLLER	3		
21	B31411	ROLLER BEARING	6	_____-1977	(SUB A35933)
21	JD9962	NEEDLE BEARING	6	_____-1985	
21	A35933	CYLINDRICAL ROLLER BEARING	6	1985-____	
22	22H817	SET SCREW	4		3/8" X 3/4"
23	AB18601	ARM	2	_____-1977	(SUB AA27692)
23	AA27692	ARM	2		
24	B31408	PLUG	2		
25	B31414	INTAKE MANIFOLD	1		
26	B31402	EXHAUST CAP	1		(AS REQUIRED)
27	B31413	ADAPTER FITTING	6		
28	B31416	HOSE CLAMP	12	_____-1976	(SUB AR77962)
28	AR77962	HOSE CLAMP	12		
29	AB18603	ADAPTER FITTING	1		

PC1467 150-16 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING PUMP (8 ROW NARROW AND 8 ROW WIDE) [H07] PC1467 - HARV-SEEDING

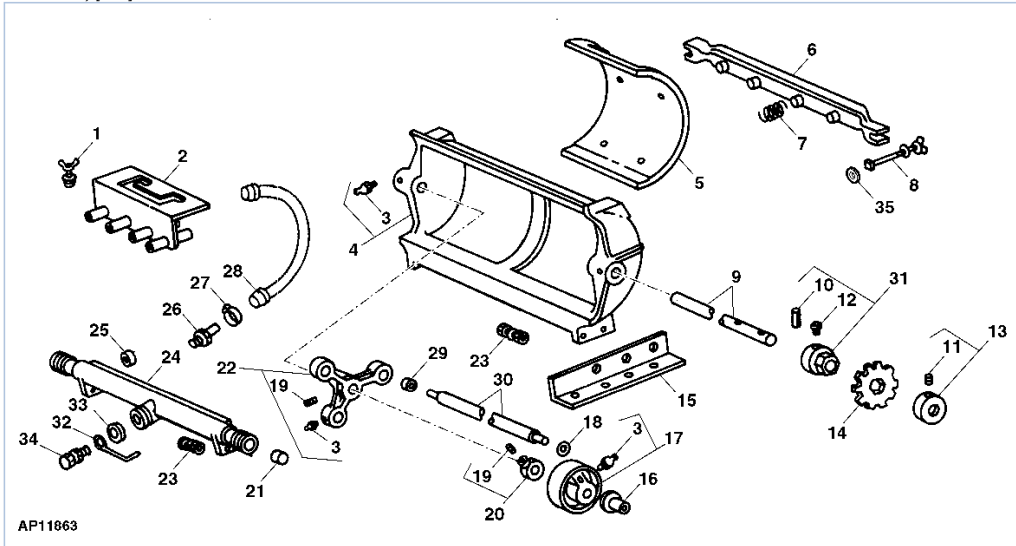


Список деталей

PC1467 150-16 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING
PUMP (8 ROW NARROW AND 8 ROW WIDE) [H07] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1709	BOLT	4		5/16" X 1"
1	24H1136	WASHER	4		11/32" X 11/16" X 0.065"
1	14H819	WING NUT	4		5/16"
2	AB18606	MANIFOLD	2		
3	JD7765	LUBRICATION FITTING	3		
4	AB18563	FRAME	1		
5	B31403	PLATE	2		
6	B31419	ANCHOR	2		
7	B31405	COMPRESSION SPRING	4		BOTTOM SPRING
7	A41695	SPRING	4		TOP SPRING
8	08H4332	BOLT	4		5/16" X 1-3/4"
8	24H1136	WASHER	4		11/32" X 11/16" X 0.065"
8	14H819	WING NUT	4		5/16"
9	B31078	PIN FASTENER	1		22.225 X 596.900 MM (7/8" X 23-1/2")
10	34H344	SPRING PIN	1		5/16" X 3-3/4"
11	22H817	SET SCREW	4		3/8" X 3/4"
12	22H844	SET SCREW	1	1978-_____	3/8" X 1/2"
13	AA23706	RETAINER	1		
14	B31425	DRIVE SPROCKET	1		8-TOOTH
14	A24937	DRIVE SPROCKET	1		9-TOOTH
14	B31426	DRIVE SPROCKET	1		10-TOOTH
14	B31427	DRIVE SPROCKET	1		15-TOOTH
14	A24936	DRIVE SPROCKET	1		20-TOOTH
14	A24935	CHAIN SPROCKET	1		22-TOOTH
15	B31420	BASE	1		R.H. FOR SHIPPING PURPOSES ONLY
15	B31421	BASE	1		L.H. FOR SHIPPING PURPOSES ONLY
16	B31400	BUSHING	2		
17	AB18608	ROLLER	1		
18	B31410	WASHER	6		
19	22H817	SET SCREW	6		3/8" X 3/4"
20	AB18605	LOCKING COLLAR	2		
21	B31408	PLUG	2		
22	AA27692	ARM	2		
23	19H1732	CAP SCREW	6		3/8" X 1-1/4"
23	14H1076	NUT	6		3/8"
24	B31424	INTAKE MANIFOLD	1		
25	B31402	EXHAUST CAP	4		
26	B31413	ADAPTER FITTING	8		
27	AR77962	HOSE CLAMP	16		
28	A35778	HOSE	8		
29	JD9962	NEEDLE BEARING	6	_____1985	
29	A35933	CYLINDRICAL ROLLER BEARING	6	1985-_____	
30	AB18607	ROLLER	3		
31	AB18603	ADAPTER FITTING	1		
32	A36730	PIN FASTENER	1	1979-_____	
33	A37576	PAD	1	1979-_____	
34	19H1948	CAP SCREW	1	1979-_____	1/4" X 3/4"
34	14H786	NUT	1	1979-_____	1/4"
35	24M7178	WASHER	4		10.500 X 30 X 2.500 MM

PC1467 150-18 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING PUMP (12 ROW NARROW) [H09]
PC1467 - HARV-SEEDING

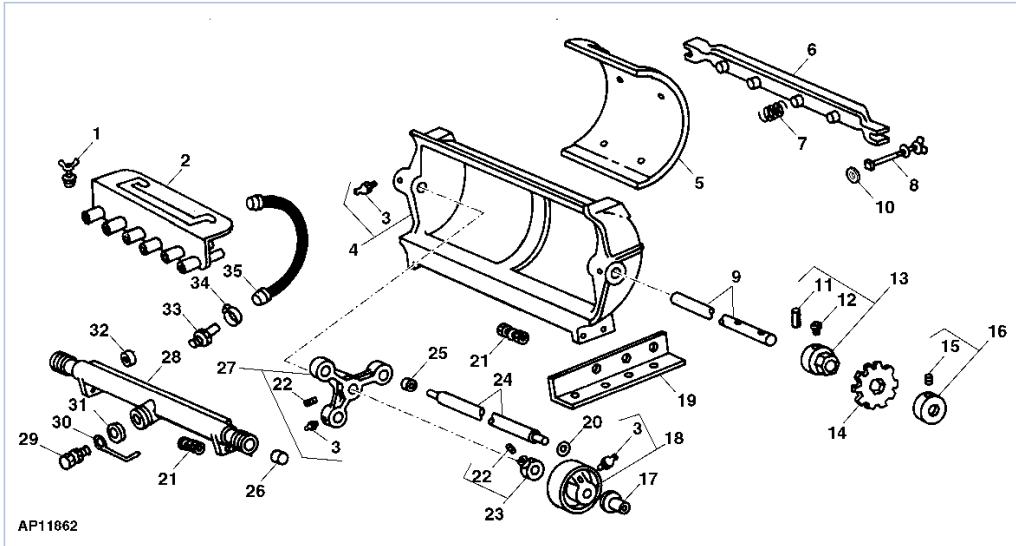


Список деталей

PC1467 150-18 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER METERING
PUMP (12 ROW NARROW) [H09] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	03H1709	BOLT	4		5/16" X 1"
1	24H1136	WASHER	4		11/32" X 11/16" X 0.065"
1	14H819	WING NUT	4		5/16"
2	AB18600	MANIFOLD	2		
3	JD7765	LUBRICATION FITTING	3		
4	AB18563	FRAME	1		
5	B31403	PLATE	2		
6	B31419	ANCHOR	2		
7	B31405	COMPRESSION SPRING	4		BOTTOM SPRING
7	A41695	SPRING	4		TOP SPRING
8	08H4332	BOLT	4		5/16" X 1-3/4"
8	24H1136	WASHER	4		11/32" X 11/16" X 0.065"
8	14H819	WING NUT	4		5/16"
9	B31078	PIN FASTENER	1		22.225 X 596.900 MM (7/8" X 23-1/2")
10	24M7178	WASHER	4		10.500 X 30 X 2.500 MM
11	B31406	SPRING PIN	1	_____-1977	
11	34H344	SPRING PIN	1	1977-____	5/16" X 3-3/4"
12	22H844	SET SCREW	1	1978-____	3/8" X 1/2"
13	AB18603	ADAPTER FITTING	1		
14	B31425	DRIVE SPROCKET	1		8-TOOTH
14	A24937	DRIVE SPROCKET	1		9-TOOTH
14	B31426	DRIVE SPROCKET	1		10-TOOTH
14	B31427	DRIVE SPROCKET	1		15-TOOTH
14	A24936	DRIVE SPROCKET	1		20-TOOTH
14	A24935	CHAIN SPROCKET	1		22-TOOTH
15	22H817	SET SCREW	3		3/8" X 3/4"
16	AA23706	RETAINER	1		WITH SET SCREW
17	B31400	BUSHING	2		
18	AB18608	ROLLER	1		
19	B31420	BASE	1		R.H. FOR SHIPPING PURPOSES ONLY
19	B31421	BASE	1		L.H. FOR SHIPPING PURPOSES ONLY
20	B31410	WASHER	6		
21	19H1732	CAP SCREW	6		3/8" X 1-1/4"
21	14H1076	NUT	6		3/8"
22	22H817	SET SCREW	6		3/8" X 3/4"
23	AB18605	LOCKING COLLAR	2		
24	AB18607	ROLLER	3		
25	B31411	ROLLER BEARING	6	_____-1977	(SUB A35933)
25	JD9962	NEEDLE BEARING	6	_____-1985	
25	A35933	CYLINDRICAL ROLLER BEARING	6	1985-____	
26	B31408	PLUG	2		
27	AB18601	ARM	2	_____-1977	(SUB AA27692)
27	AA27692	ARM	2		
28	A26266	MANIFOLD	1		
29	19H2036	CAP SCREW	1		1/4" X 7/8"
29	14H786	NUT	1		1/4"
30	A36730	PIN FASTENER	1		
31	A37576	PAD	1		
32	B31402	EXHAUST CAP	4		
33	B31413	ADAPTER FITTING	12		
34	B31416	HOSE CLAMP	24	_____-1976	(SUB AR77962)
34	AR77962	HOSE CLAMP	24		
35	AB18561	TUBE	1	_____-1977	(SUB A35778)
35	A35778	HOSE	12		

PC1467 150-20 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER HOSES, CLAMPS AND FITTINGS (8 ROW NARROW AND 8 ROW WIDE) [H11] PC1467 - HARV-SEEDING

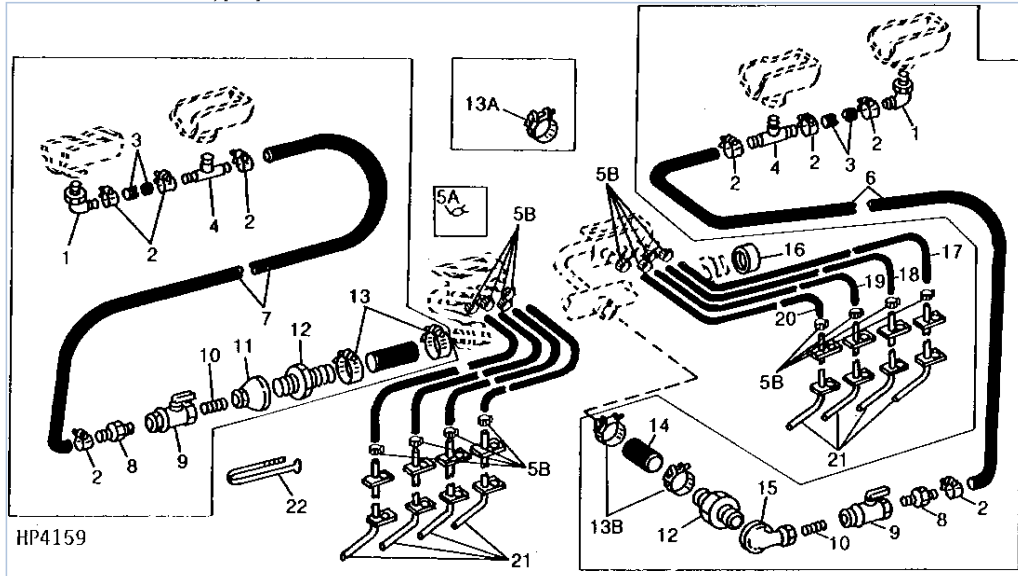


Список деталей

PC1467 150-20 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER HOSES,
CLAMPS AND FITTINGS (8 ROW NARROW AND 8 ROW WIDE) [H11] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25842	ELBOW FITTING	2	_____-1979	
2	AR21837	CLAMP	8	_____-1979	
3		HOSE	2	_____-1979	(B) (MAKE FROM A26272) 19 MM X 2 134 MM (3/4" X 84")
3		HOSE	2	_____-1979	(A) (MAKE FROM A26272) 19 MM X 1 372 MM (3/4" X 54")
4	A25807	TEE FITTING	1	_____-1979	
5A	H3185B	CLAMP	16	_____-1979	(SUB AR21837)
5B	AR21837	CLAMP	16		
6		HOSE	1	_____-1979	(B) (MAKE FROM A26272) 19 MM X 1 067 MM (3/4" X 42")
6		HOSE	1	_____-1979	(A) (MAKE FROM A26272) 19 MM X 915 MM (3/4" X 36")
7		HOSE	1	_____-1979	(B) (MAKE FROM A26272) 19 MM X 915 MM (3/4" X 36")
7		HOSE	1	_____-1979	(A) (MAKE FROM A26272) 19 MM X 610 MM (3/4" X 24")
8	A27238	HOSE FITTING	2	_____-1979	19 MM (3/4")
9	AA22965	VALVE	2	_____-1975	(SUB AN114582)
9	AN114582	VALVE	2	_____-1979	
10	29H706	THREADED NIPPLE	2	_____-1979	3/4" X 1-1/4"
11	15H631	COUPLING	1	_____-1979	1-1/4" X 3/4"
12	A24912	FITTING	2	_____-1979	32 MM (1-1/4")
13A	AB15238	CLAMP	4	_____-1978	(SUB AR21839)
13B	AR21839	CLAMP	4	_____-1979	
14	A24916	HOSE	2	_____-1979	32 MM X 76 MM (1-1/4" X 3")
15	15H668	ELBOW FITTING	1	_____-1979	3/4" X 1-1/4"
16	B31408	PLUG	2		
17		HOSE	2		(B) (MAKE FROM A26275) 13 MM X 4 267 MM (1/2" X 168")
17		HOSE	2		(A) (MAKE FROM A26275) 13 MM X 3 658 MM (1/2" X 144")
18		HOSE	2		(B) (MAKE FROM A26275) 13 MM X 3 658 MM (1/2" X 144")
18		HOSE	2		(A) (MAKE FROM A26275) 13 MM X 3 048 MM (1/2" X 120")
19		HOSE	2		(B) (MAKE FROM A26275) 13 MM X 2 134 MM (1/2" X 84")
19		HOSE	2		(A) (MAKE FROM A26275) 13 MM X 2 134 MM (1/2" X 84")
20		HOSE	2		(B) (MAKE FROM A26275) 13 MM X 1 372 MM (1/2" X 54")
20		HOSE	2		(A) (MAKE FROM A26275) 13 MM X 1 371 MM (1/2" X 54")
21	AA23113	SPOUT	8		
22	H77698	TIE BAND	12		360 MM (14-3/16")
..	A26272	HOSE	1		19 MM X 5 791 MM (3/4" X 228")
..	A26275	HOSE	1		13 MM X 11 176 MM (1/2" X 440")

PC1467 150-22 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER HOSES, CLAMPS AND FITTINGS (12 ROW NARROW) [H13] PC1467 - HARV-SEEDING

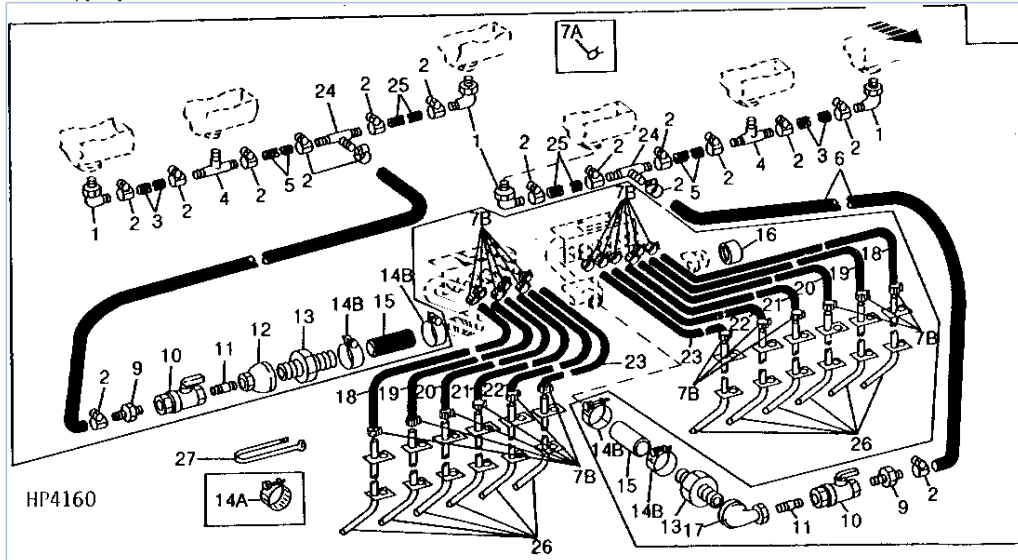


Список деталей

PC1467 150-22 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER HOSES,
CLAMPS AND FITTINGS (12 ROW NARROW) [H13] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A25842	ELBOW FITTING	4	_____-1979	
2	AR21837	CLAMP	16	_____-1979	
3		HOSE	2	_____-1979	(MAKE FROM A26272) 19 MM X 1 372 MM (3/4" X 54")
4	A25807	TEE FITTING	2	_____-1979	
5		HOSE	2	_____-1979	(MAKE FROM A26272) 19 MM X 190 MM (3/4" X 7-1/2")
6		HOSE	1	_____-1979	(MAKE FROM A26272) 19 MM X 2 235 MM (3/4" X 88")
7	H3185B	CLAMP	24		
7A	H3185B	CLAMP	24	_____-1979	(SUB AR21837)
7B	AR21837	CLAMP	24		
8		HOSE	1	_____-1979	(MAKE FROM A26272) 19 MM X 1 700 MM (3/4" X 67")
9	A27238	HOSE FITTING	1	_____-1979	19 MM (3/4")
10	AA22965	VALVE	2	_____-1975	(SUB AN114582)
10	AN114582	VALVE	2	_____-1979	
11	29H706	THREADED NIPPLE	2	_____-1979	1-1/4" X 3/4"
12	15H631	COUPLING	2	_____-1979	1-1/4" X 3/4"
13	A24912	FITTING	2	_____-1979	32 MM (1-1/4")
14A	AB15238	CLAMP	4	_____-1978	(SUB AR21839)
14B	AR21839	CLAMP	4	_____-1979	
15	A24916	HOSE	1	_____-1979	32 MM X 76 MM (1-1/4" X 3")
16	B31408	PLUG	2		
17	15H668	ELBOW FITTING	1	_____-1979	3/4" X 1-1/4"
18		HOSE	2		(MAKE FROM A26275) 13 MM X 5 182 MM (1/2" X 204")
19		HOSE	2		(MAKE FROM A26275) 13 MM X 4 572 MM (1/2" X 180")
20		HOSE	2		(MAKE FROM A26275) 13 MM X 3 658 MM (1/2" X 144")
21		HOSE	2		(MAKE FROM A26275) 13 MM X 2 896 MM (1/2" X 114")
22		HOSE	2		(MAKE FROM A26275) 13 MM X 1 982 MM (1/2" X 78")
23		HOSE	2		(MAKE FROM A26275) 13 MM X 1 372 MM (1/2" X 54")
24	A24915	TEE FITTING	2	_____-1979	
25		HOSE	2	_____-1979	(MAKE FROM A26272) 19 MM X 1 143 MM (3/4" X 45")
26	AA23113	SPOUT	12		
27	H77698	TIE BAND	24		360 MM (14-3/16")
..	A26272	HOSE	1		19 MM X 5 791 MM (3/4" X 228")
..	A26275	HOSE	1		13 MM X 11 176 MM (1/2" X 440")

PC1467 150-24 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER TANK (-1979)(70 GALLON) [H15] PC1467 - HARV-SEEDING

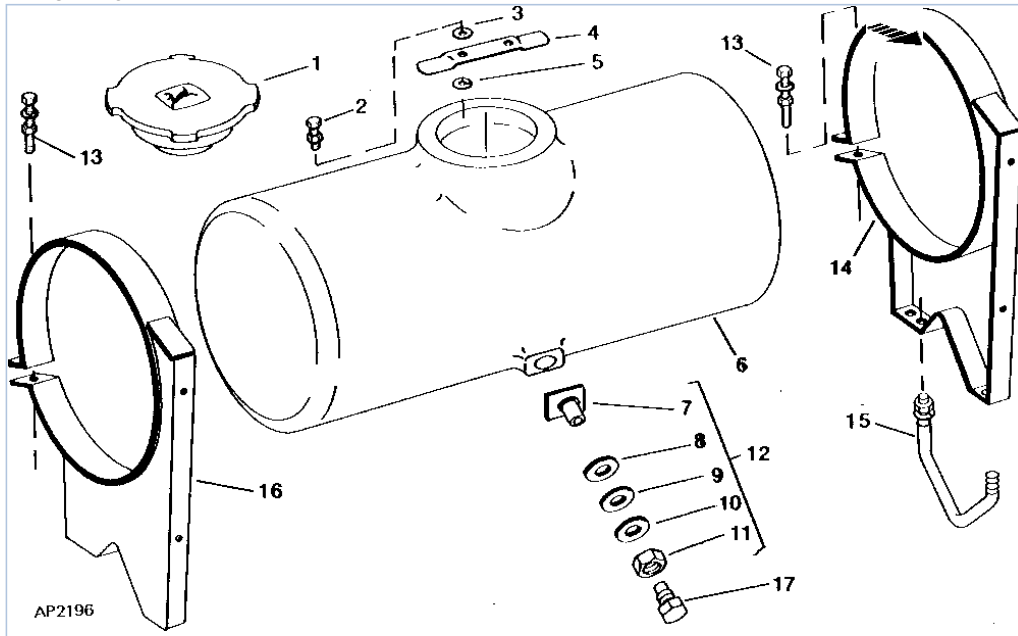


Список деталей

PC1467 150-24 7000 Drawn Cotton and Corn Planter / LIQUID FERTILIZER TANK (-1979)
(70 GALLON) [H15] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	N156025	COVER	1	_____-1988	(SUB FOR A26444)
2	19H1948	CAP SCREW	2	_____-1988	1/4" X 3/4"
2	14H786	NUT	2	_____-1988	1/4"
3	24H1695	WASHER	2		9/32" X 1-3/8" X 0.065"
4	A26445	STRAP	1		
5	12H356	LOCK WASHER	2		1/4"
6	A25772	TANK	1	_____-1988	(SUB A49377, AA28696, AN152898 AND H138583)
7		SCREW	1	_____-1988	(SUB AN113545)
8		WASHER	1	_____-1988	(SUB AN113545)
9		WASHER	1	_____-1988	(SUB AN113545)
10		WASHER	1	_____-1988	(SUB AN113545)
11		NUT	1	_____-1988	(SUB AN113545)
12	AN113545	FITTING	1	_____-1988	
13	19H3162	CAP SCREW	2		3/8" X 2"
13	12H304	LOCK WASHER	2		3/8"
13	14H1076	NUT	2		3/8"
14	AA21135	SUPPORT	1	_____-1977	(SUB AA26565) L.H.
14	AA26565	SUPPORT	1		L.H.
15	A23434	U-BOLT	2		127 MM X 178 MM (5" X 7") FRAME
15	A23435	U-BOLT	2		178 MM X 178 MM (7" X 7") FRAME
15	24H1111	WASHER	4		17/32" X 1-1/16" X 0.090"
15	14H1040	NUT	4		1/2"
16	AA21134	SUPPORT	1	_____-1977	(SUB AA26566) R.H.
16	AA26566	SUPPORT	1		R.H.
17	A35459	PLUG	1	1978-1988	

PC1467 160-2 7000 Drawn Cotton and Corn Planter / HOPPER UNIT (HERBICIDE OR INSECTICIDE) [I09] PC1467 - HARV-SEEDING

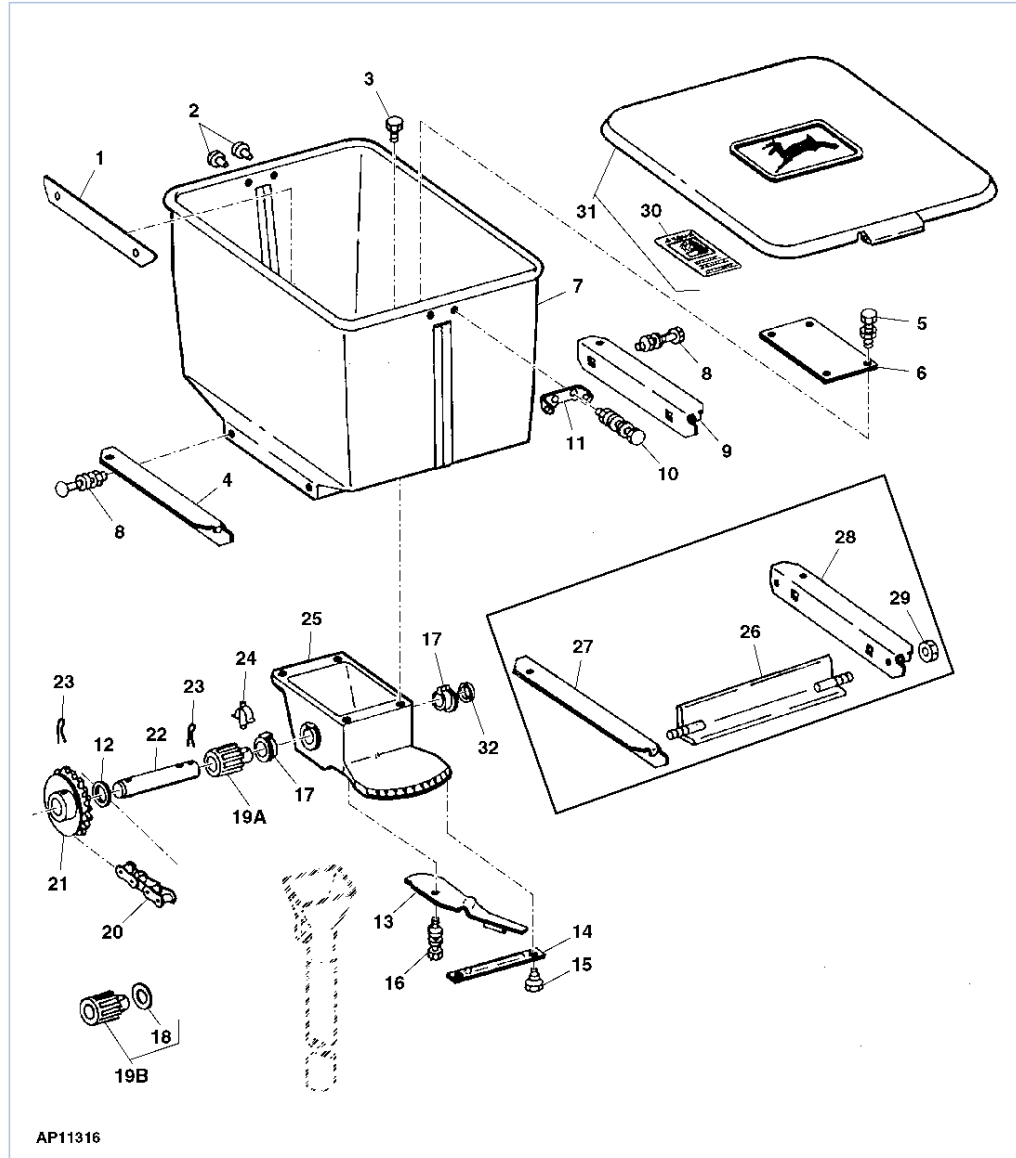


Список деталей

PC1467 160-2 7000 Drawn Cotton and Corn Planter / HOPPER UNIT (HERBICIDE OR INSECTICIDE) [I09] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A33957	STRAP	2	1977-	
2	A26175	PLUG	2		
3	37H24	SCREW	4		1/4" X 3/4"
4	A25896	SUPPORT	1		L.H.
5	19H1227	CAP SCREW	4		1/4" X 1/2", NOT USED WITH DOUBLE ATTACHMENT
5	24H1646	WASHER	4		17/64" X 3/4" X 0.060"
5	K40001	LOCK NUT	8		6.350 MM (1/4")
6	A26176	PLATE	1		NOT USED WITH DOUBLE ATTACHMENT
7	A22417	HOPPER	1		
8	03H1765	BOLT	4		3/8" X 3/4"
8	A23441	WASHER	4		
8	24H1219	WASHER	4		7/16" X 1" X 0.083"
8	K40003	LOCK NUT	4		9.525 MM (3/8")
9	A25897	SUPPORT	1		R.H.
10	19H1948	CAP SCREW	2		1/4" X 3/4"
10	24H1287	WASHER	2		9/32" X 5/8" X 0.065"
10	14H786	NUT	2		1/4"
11	A22689	HINGE	1		
12	24H1265	WASHER	2	1985-	13/16" X 1-1/4" X 0.060"
12	24H1265	WASHER	1	1985-	13/16" X 1-1/4" X 0.060"
13	A33403	GATE	1		
14	A26006	STRAP	1		
15	37H32	SCREW	2		0.190" X 3/8"
16	37H24	SCREW	1		1/4" X 3/4"
16	24H1646	WASHER	1		17/64" X 3/4" X 0.060"
16	B13845	WASHER	1		13.106 X 22.225 X 0.381 MM (33/64" X 7/8" X 0.015")
17	A25845	BUSHING	2		
18	24H1431	WASHER	1	1982-	29/32" X 2" X 0.060", FOR USE WITH SAND CARRIER INSECTICIDE ONLY
19A	AA22977	WHEEL	1		FOR CLAY CARRIER INSECTICIDES ONLY
19B	AA32745	WHEEL	1	1982-	TWO ROWS, FOR USE WITH SAND CARRIER INSECTICIDE ONLY
20	A26048	ROLLER CHAIN	1	1988-	(ASSEMBLE FROM (2) AP20370 AND AP20368) 13 MM (1/2") PITCH, 110 LINKS
21	AA23032	CHAIN SPROCKET	1	1974-	(SUB AA24156) 24-TOOTH
21	AA24156	DRIVE SPROCKET	1	1981-	(SUB AA29734) 24-TOOTH
21	AA29734	CHAIN SPROCKET	1		(24-TOOTH)
22	A25870	PIN FASTENER	1		19.050 X 129.540 MM (3/4" X 5.100")
23	11H240	COTTER PIN	2		5/32" X 1-1/2"
24	AB12703	QUICK LOCK PIN	1		
25	A25774	HOUSING	1	1979-	(SUB AA29122)
25	A36199	HOUSING	1		
26	AA31512	ANGLE	2		(A)
27	A42249	SUPPORT	1		(A) L.H.
28	A42248	SUPPORT	1		(A) R.H.
29	U13184	LOCK NUT	4	1986-	(A) 9.525 MM (3/8") (SUB K40003)
29	K40003	LOCK NUT	4	1986-	9.525 MM (3/8")
30	H138519	SAFETY SIGN	1		"WARNING" (ENGLISH) INSIDE OF HOPPER LID
31	AA23225	COVER	1		
32	24H1746	WASHER	1	1985-	25/32" X 1-1/8" X 0.120"
..	AA29122	HOUSING	1	1979-	(INCLUDES A36199 AND A38103)

PC1467 160-4 7000 Drawn Cotton and Corn Planter / LID FILL CLOSED HANDLING SYSTEM (1990-) [111] PC1467 - HARV-SEEDING

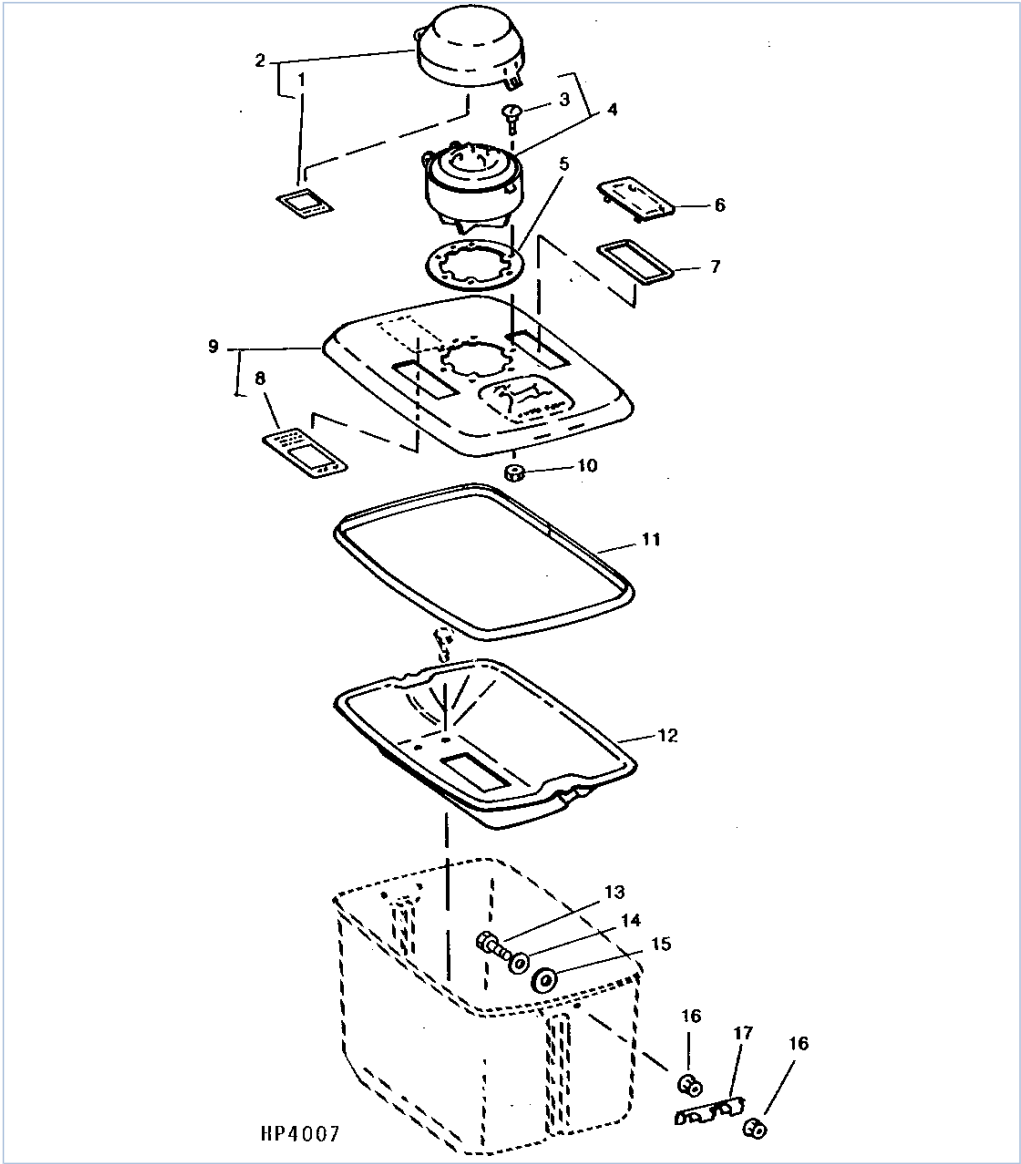


Список деталей

PC1467 160-4 7000 Drawn Cotton and Corn Planter / LID FILL CLOSED HANDLING
SYSTEM (1990-) [111] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A51941	SIGN	1		
2	AA37167	COVER	1		
3	H125891	SCREW	6		
4	AA37187	VALVE	1		
5	A51943	GASKET	1		
6	A51940	WINDOW	2		
7	A51942	GASKET	2		
8	H138519	SAFETY SIGN	1		"WARNING" (ENGLISH) INSIDE OF HOPPER LID
9	AA37171	COVER	1		
10	14H608	NUT	6		0.216", USE T43512 OR TY9370 ON THREADS
11	A51765	ISOLATOR	1		
12	A51944	INSERT	1		USE TY15443 TO SEAL HOPPER BOTTOM INSERT TO INSIDE OF HOPPER
13	19H1948	CAP SCREW	4		1/4" X 3/4"
14	24H1646	WASHER	4		17/64" X 3/4" X 0.060"
15	A21710	WASHER	4		РЕЗИНОВЫЙ
16	N10217	LOCK NUT	8		
17	A51767	BRACKET	4		
..	T43512	SEALANT	1		1.09 FL. OZ. (50 CC)
..	TY9370	SEALANT	1		6 OZ. MEDIUM STRENGTH
..	TY15443	SEALANT	1		10.3 OZ. (305 ML)

PC1467 160-6 7000 Drawn Cotton and Corn Planter / WINDSHIELD ATTACHMENT (1977-)(HERBICIDE) [I13] PC1467 - HARV-SEEDING

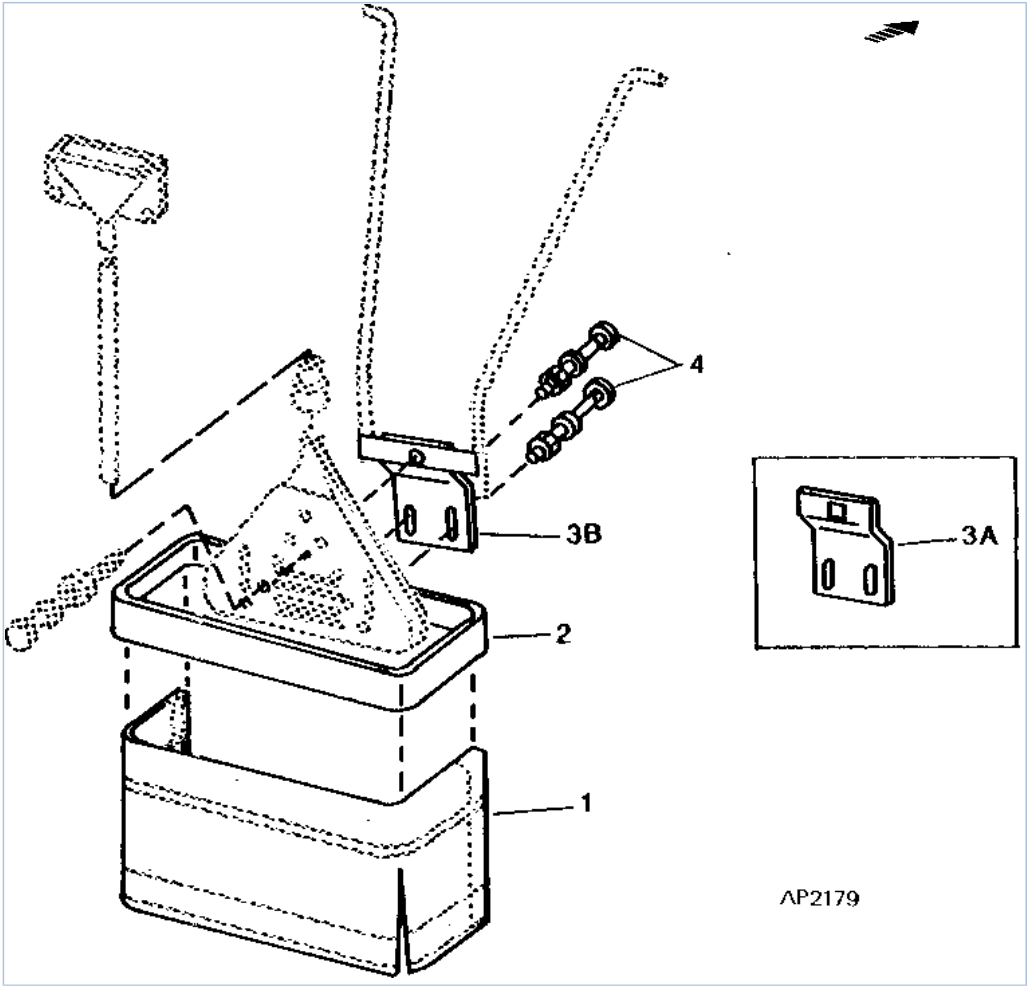


Список деталей

PC1467 160-6 7000 Drawn Cotton and Corn Planter / WINDSHIELD ATTACHMENT (1977-)
(HERBICIDE) [I13] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A33152	SHIELD	1		ILLUSTRATED WITH HERBICIDE SPREADER
2	A32431	BRACKET	1	_____-064400	(SUB A36056)
2	A36056	BRACKET	1		
3A	A32432	PLATE	1	_____-064400	(SUB AA27820)
3B	AA27820	HANGER	1		
4	03H1893	BOLT	2	_____-064400	1/4" X 1/2"
4	03H1701	BOLT	2	064401-____	1/4" X 3/4"
4	12H302	LOCK WASHER	2		1/4"
4	14H786	NUT	2		1/4"

PC1467 160-8 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER ATTACHMENT (-1979) [I15] PC1467 - HARV-SEEDING

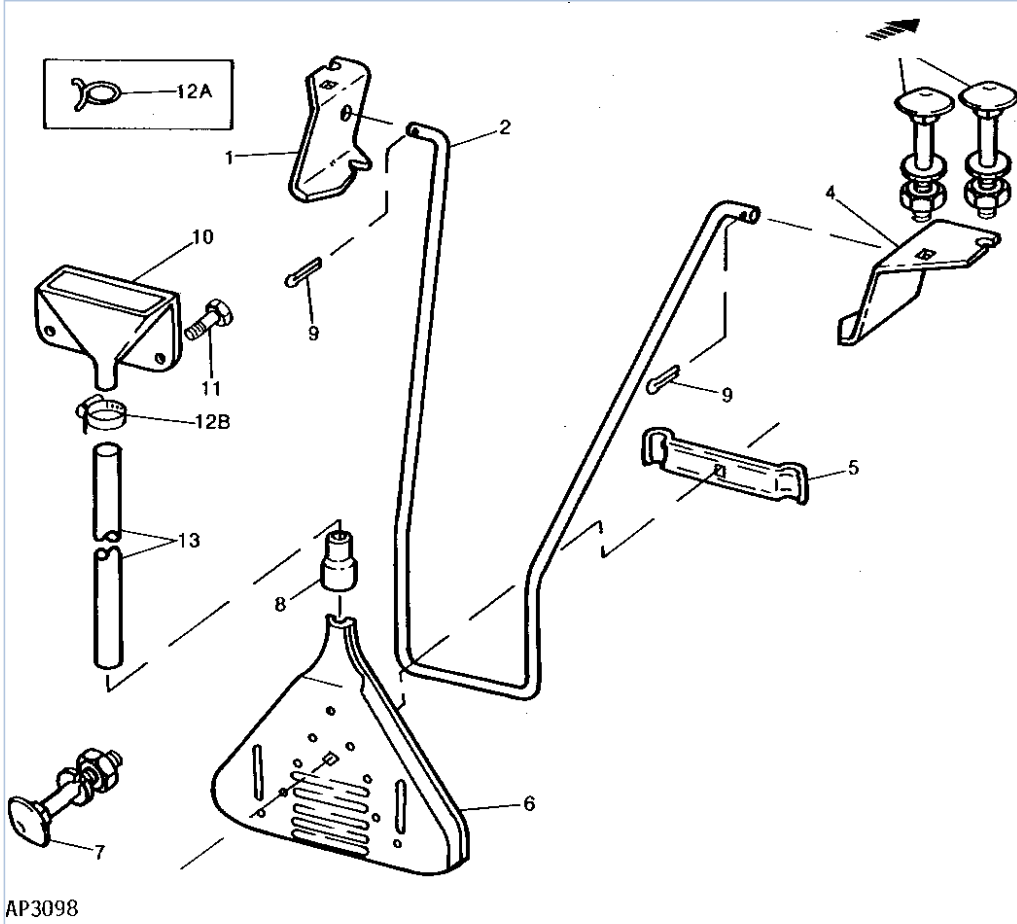


Список деталей

PC1467 160-8 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER
ATTACHMENT (-1979) [115] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A26037	SUPPORT	1		L.H.
2	A22901	HANGER	1		
3	03H1701	BOLT	4		1/4" X 3/4"
3	12H302	LOCK WASHER	4		1/4"
3	14H786	NUT	4		1/4"
4	A26038	SUPPORT	1		R.H.
5	A22902	RETAINER	1		
6	A22922	DIFFUSER	1	_____-1979	(SUB A37494, A37797, AA29121 AND AA30614)
7	03H1834	BOLT	1		3/8" X 2"
7	12H304	LOCK WASHER	1		3/8"
7	14H1076	NUT	1		3/8"
8	A25757	ELECTRICAL CONNECTOR ASSY	1		(A)
8	A37797	BOOT	1		(B)
9	11H235	COTTER PIN	2	_____-1986	1/8" X 1/2"
9	11M7012	COTTER PIN	2	1986-____	3.200 X 16 MM
10	A22786	FUNNEL	1	_____-1977	(SUB A33648)
10	A33648	FUNNEL	1	_____-1979	(A) (SUB AA29121 AND A37494)
10	AA29121	FUNNEL	1	_____-1979	(A)
10	A37497	FUNNEL	1		(B)
11	37H91	SCREW	2		0.190" X 1/2"
12A	H3187B	HOSE CLAMP	1	_____-1977	(SUB H3185B)
12A	H3185B	CLAMP	1	_____-1979	(SUB AR21837)
12B	AR21837	CLAMP	1		
12B	AA29204	HOSE CLAMP	1	1979-____	
13		HOSE	1	_____-1979	(A) (CUT FROM A26275) 13 MM X 635 MM (1/2" X 25")
13	A37494	HOSE	1		(B) 19MM X 14 MM X 635 MM (3/4" X 9/16" X 635 MM)

PC1467 160-10 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER ATTACHMENT (1979-1979) [117] PC1467 - HARV-SEEDING

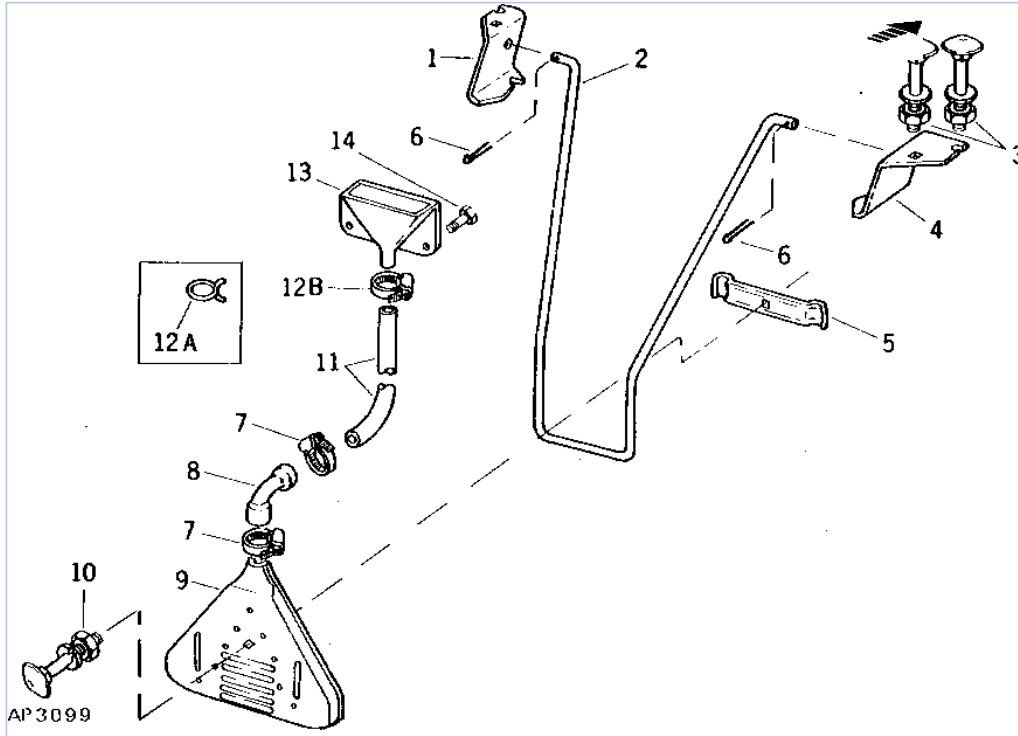


Список деталей

PC1467 160-10 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER
ATTACHMENT (1979-1979) [117] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A26037	SUPPORT	1		L.H.
2	A22901	HANGER	1		
3	03H1701	BOLT	4		1/4" X 3/4"
3	12H302	LOCK WASHER	4		1/4"
3	14H786	NUT	4		1/4"
4	A26038	SUPPORT	1		R.H.
5	A22902	RETAINER	1		
6	11H235	COTTER PIN	2	_____- 1986	1/8" X 1/2"
6	11M7012	COTTER PIN	2	_____- 1986-	3.200 X 16 MM
7	AA29204	HOSE CLAMP	2		(SUB A25757 FOR 1/2" HOSE OR A37797 FOR 3/4" HOSE)
8	A37495	HOSE	1		(SUB A25757 FOR 1/2" HOSE OR A37797 FOR 3/4" HOSE)
9	A22922	DIFFUSER	1	_____- 1979	(SUB AA30614, AA29121, A37797 AND A37494)
10	03H1834	BOLT	1		3/8" X 2"
10	12H304	LOCK WASHER	1		3/8"
10	14H1076	NUT	1		3/8"
11		HOSE	1	_____- 1979	(A) 13 MM X 635 MM (1/2" X 25") (CUT TO LENGTH FROM A26275)
11	A37494	HOSE	1	1979-	(B) 19 MM X 14 MM X 635 MM (3/4" X 9/16" X 25")
12A	H3187B	HOSE CLAMP	1	_____- 1977	(SUB H3185B)
12A	H3185B	CLAMP	1	_____- 1979	(SUB AR21837)
12B	AR21837	CLAMP	1		
12B	AA29204	HOSE CLAMP	1	1979-	
13	A22786	FUNNEL	1	_____- 1977	(SUB A33648)
13	A33648	FUNNEL	1	_____- 1979	(A) (SUB AA29121 AND A37494)
13	A37497	FUNNEL	1	1979-	(B)
14	37H91	SCREW	2		NO. 10 X 1/2"
..	AA29121	FUNNEL	1	1979-	(INCLUDES A37495, A37497, (3) AA29204 AND A38102)

PC1467 160-12 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER ATTACHMENT (1979-) [119] PC1467 - HARV-SEEDING

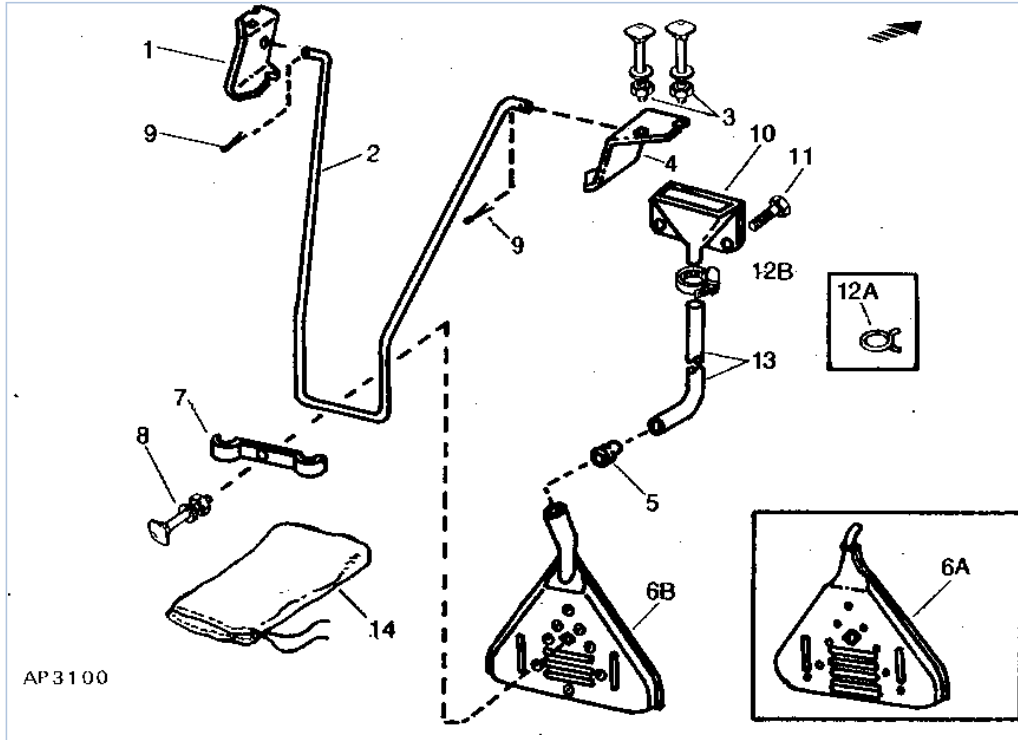


Список деталей

PC1467 160-12 7000 Drawn Cotton and Corn Planter / HERBICIDE DIFFUSER
ATTACHMENT (1979-) [119] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A26037	SUPPORT	1		L.H.
2	A22901	HANGER	1		
3	03H1701	BOLT	4		1/4" X 3/4"
3	12H302	LOCK WASHER	4		1/4"
3	14H786	NUT	4		1/4"
4	A26038	SUPPORT	1		R.H.
5	A25757	ELECTRICAL CONNECTOR ASSY	1		(A)
5	A37797	BOOT	1		(B)
6A	AA28895	DEFLECTOR	1	_____- 1980	(SUB AA30614) (SUB FOR A22922)
6B	AA30614	DEFLECTOR	1		
7	A22902	RETAINER	1		
8	03H1835	BOLT	1		3/8" X 2-3/4"
8	12H304	LOCK WASHER	1		3/8"
8	14H1076	NUT	1		3/8"
9	11H235	COTTER PIN	2	_____- 1986	1/8" X 1/2"
9	11M7012	COTTER PIN	2	1986- _____	3.200 X 16 MM
10	A33648	FUNNEL	1	_____- 1979	(A) (SUB AA29121 AND A37494)
10	A37497	FUNNEL	1		(B)
11	37H91	SCREW	2		0.190" X 1/2"
12A	H3185B	CLAMP	1	_____- 1979	(SUB AR21837)
12B	AR21837	CLAMP	1		
12B	AA29204	HOSE CLAMP	1	1979- _____	
13		HOSE	1	_____- 1979	(A) 13 MM X 635 MM (1/2" X 25") (CUT TO LENGTH FROM A26275)
13	A37494	HOSE	1	1979- _____	(B) 19 MM X 14 MM X 635 MM (3/4" X 9/16" X 25")
14	B13922	BAG	1	_____- 1984	

PC1467 160-13 7000 Drawn Cotton and Corn Planter / REAR MOUNT INSECTICIDE BAND SPREADER (1977-) [120]
PC1467 - HARV-SEEDING

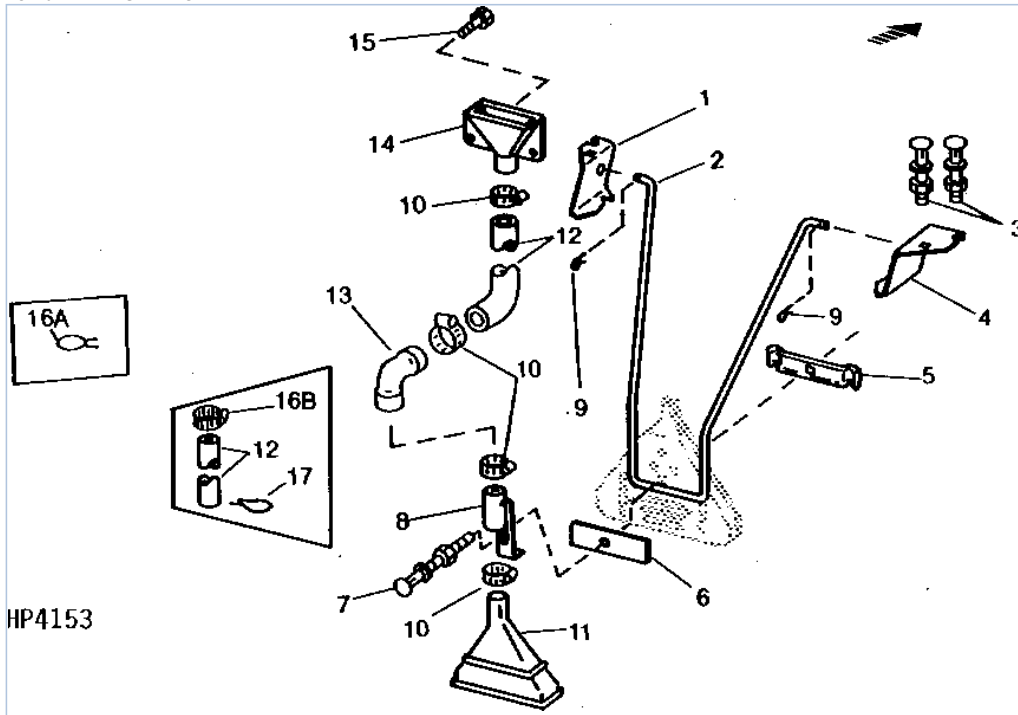


Список деталей

PC1467 160-13 7000 Drawn Cotton and Corn Planter / REAR MOUNT INSECTICIDE BAND
SPREADER (1977-) [120] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A26037	SUPPORT	1		L.H.
2	A22901	HANGER	1		
3	03H1701	BOLT	4		1/4" X 3/4"
3	12H302	LOCK WASHER	4		1/4"
3	14H786	NUT	4		1/4"
4	A26038	SUPPORT	1		R.H.
5	A22902	RETAINER	1		
6	A32369	STRAP	1		
7	03H1558	BOLT	1		3/8" X 1-1/2"
7	12H304	LOCK WASHER	1		3/8"
7	14H1076	NUT	1		3/8"
8	AA26023	BRACKET	1		
9	11H235	COTTER PIN	2	- 1986	1/8" X 1/2"
9	11M7012	COTTER PIN	2	1986-	3.200 X 16 MM
10	AA29204	HOSE CLAMP	4	1979-	
11	B32601	DIFFUSER	1		
12		HOSE	1		(A) 13 MM X 635 MM (1/2" X 25") (CUT TO LENGTH FROM A26275)
12	A37494	HOSE	1	1979-	(B) 19 MM X 14 MM X 635 MM (3/4" X 9/16" X 25")
13	A37495	HOSE	1	1979-	(B)
14	A22786	FUNNEL	1	- 1977	(SUB A33648)
14	A33648	FUNNEL	1	- 1979	(A) (SUB AA29121 AND A37494)
14	AA29121	FUNNEL	1	- 1979	(CONSISTS OF A37495, A37495, A37497 AND (3) AA29204)
14	A37497	FUNNEL	1	1979-	(B)
15	37H91	SCREW	2		0.190" X 1/2"
16A	H3185B	CLAMP	1	- 1979	(A) (SUB AR21837)
16B	AR21837	CLAMP	1		
17	A22740	SPRING LOCKING PIN	1	- 1979	(A)

PC1467 160-14 7000 Drawn Cotton and Corn Planter / HOPPER SUPPORT PANEL AND DRIVE CHAIN TIGHTENER
(SEED, HERBICIDE, AND INSECTICIDE) [I21] PC1467 - HARV-SEEDING

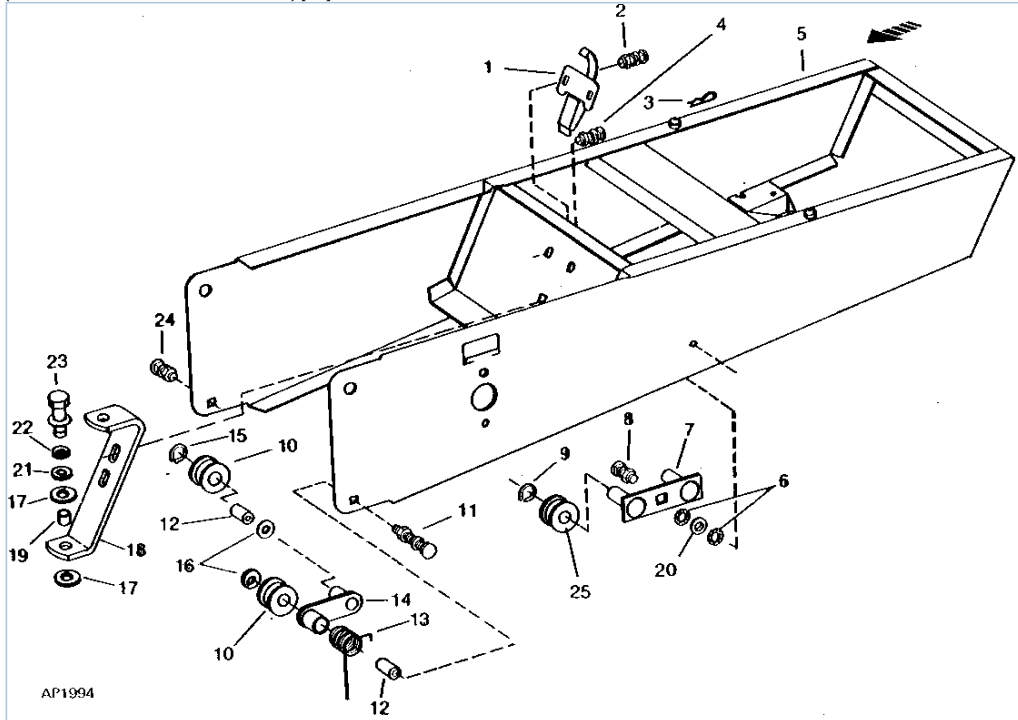


Список деталей

PC1467 160-14 7000 Drawn Cotton and Corn Planter / HOPPER SUPPORT PANEL AND
DRIVE CHAIN TIGHTENER (SEED, HERBICIDE, AND INSECTICIDE) [I21] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	AA22119	LATCH	1		
2	03H2119	BOLT	2		1/4" X 5/8"
2	24H1287	WASHER	2	_____-1978	9/32" X 5/8" X 0.065"
2	N10217	LOCK NUT	2		6.350 MM (1/4")
3	J16931	PIN	2		
4	03H1519	BOLT	2		3/8" X 1"
4	24H1305	WASHER	2		13/32" X 13/16" X 0.065"
4	12H304	LOCK WASHER	2		3/8"
4	14H1076	NUT	2		3/8"
5	AA22050	SUPPORT	1	_____-1979	(SUB AA28976)
5	AA28976	SUPPORT	1		
6	12H335	LOCK WASHER	2		3/8"
7	AA23057	ARM	1	_____-1975	(SUB AA24633)
7	AA24633	ARM	1		
8	03H1500	BOLT	1		3/8" X 1"
8	12H304	LOCK WASHER	1		3/8"
8	14H1076	NUT	1		3/8"
9	B14203	SNAP RING	2		
10	A22838	IDLER	2	_____-705100	
11	03H1836	BOLT	1		3/8" X 3-1/2"
11	12H304	LOCK WASHER	1	_____-1978	3/8"
11	14H1076	NUT	1	_____-1978	3/8"
11	K40003	LOCK NUT	1	1978-____	9.525 MM (3/8")
12	A22839	BUSHING	1	_____-064400	(SUB N120831)
12	N120831	SPACER	2		
13	A25368	SPRING	1	_____-1975	(SUB A28518)
13	A28518	TORSION SPRING	1		
14	A25369	ARM	1	_____-1986	(SUB A50564)
14	A50564	ARM	1		
15	B14203	SNAP RING	1		
16	24H1307	WASHER	2	064401-____	13/32" X 1" X 1/16"
16	24H1307	WASHER	1		13/32" X 1" X 1/16"
17	A24093	WASHER	2		(A)
18	A25659	BRACKET	1		
19	A24092	BUSHING	1		(A)
20	24H1308	WASHER	1		13/32" X 1" X 0.134"
21	24H1307	WASHER	1		(A) 13/32" X 1" X 1/16"
22	12H304	LOCK WASHER	1		(A) 3/8"
23	19H1800	CAP SCREW	1		(A) 3/8" X 1-1/2"
23	24H1653	WASHER	1		(A) 13/32" X 1-1/4" X 0.120"
24	03H1480	BOLT	1		3/8" X 1-1/4"
24	12H304	LOCK WASHER	1		3/8"
24	14H1076	NUT	1		3/8"
24	24H1307	WASHER	1		13/32" X 1" X 1/16"
25	B30968	IDLER	1		


PC1467 160-16 7000 Drawn Cotton and Corn Planter / INSECTICIDE BAND DIFFUSER ATTACHMENT [123] PC1467 - HARV-SEEDING

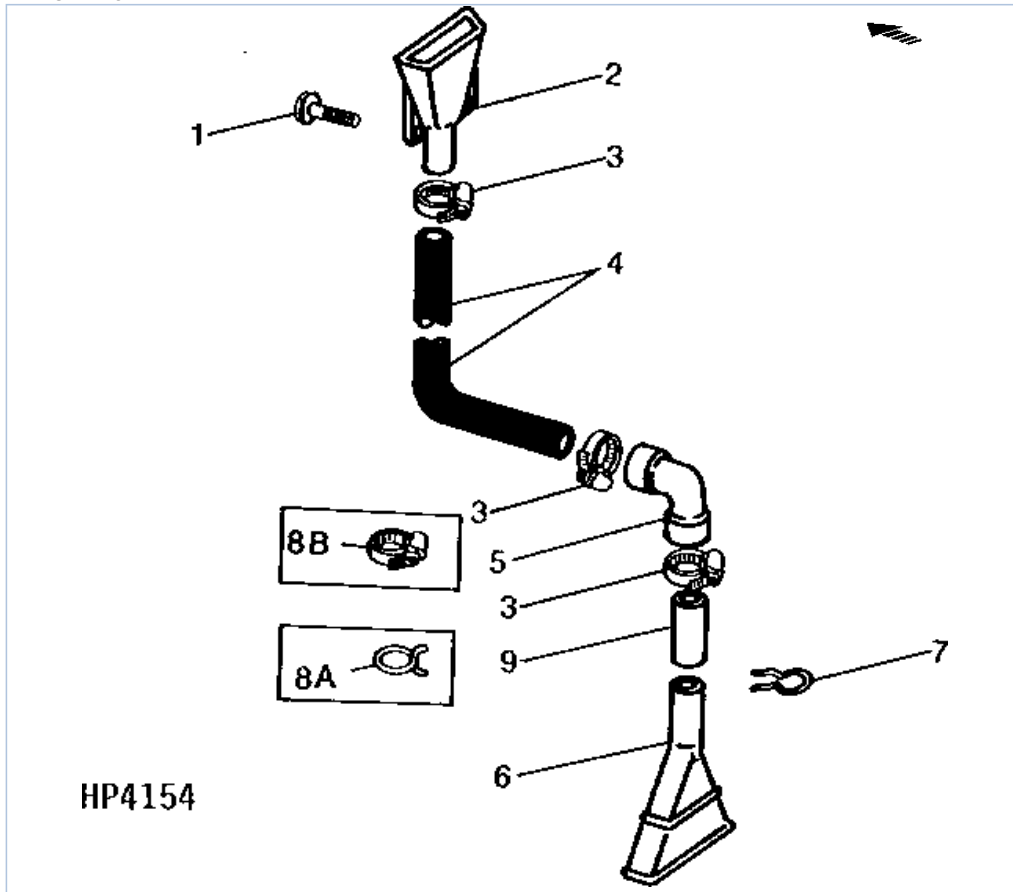

Список деталей

PC1467 160-16 7000 Drawn Cotton and Corn Planter / INSECTICIDE BAND DIFFUSER
ATTACHMENT [123] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К-ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	37H91	SCREW	2		0.190" X 1/2"
2	A22786	FUNNEL	1	- 1977	(A) (SUB A33648)
2	A33648	FUNNEL	1	- 1979	(A) (SUB AA29121 AND A37494)
2	A37497	FUNNEL	1	1979-	(B)
3	AA29204	HOSE CLAMP	3	1979-	(SUB FOR AR21837 AND AR77962)
4		HOSE	1	- 1979	13 MM X 635 MM (1/2" X 25") (CUT TO LENGTH FROM A26275)
4	A37494	HOSE	1	1979-	(B) 19 MM X 14 MM X 635 MM (3/4" X 9/16" X 25")
5	A37495	HOSE	1	1979-	(B)
6	B32601	DIFFUSER	1		
7	A22740	SPRING LOCKING PIN	1		
8A	H3187B	HOSE CLAMP	1	- 1979	(A) (SUB H3185B)
8A	H3185B	CLAMP	1	- 1979	(A) (SUB AR21837)
8B	AR21837	CLAMP	1		
9	A23224	SPACER	1		

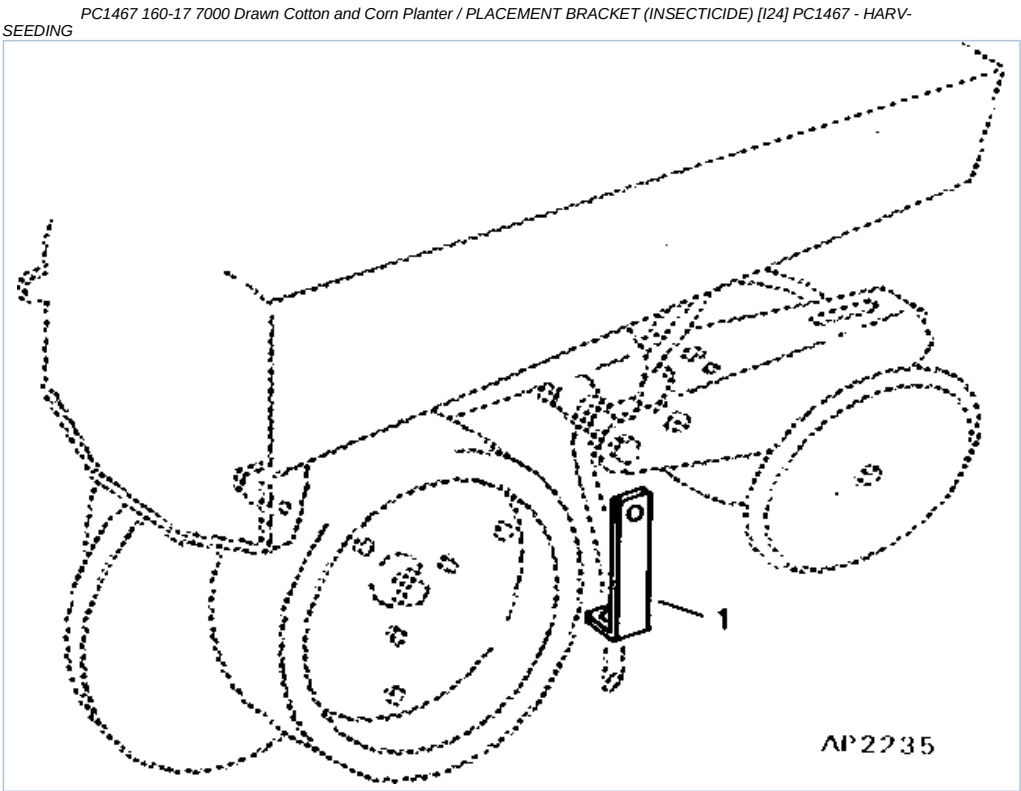

Список деталей

PC1467 160-17 7000 Drawn Cotton and Corn Planter / PLACEMENT BRACKET

(INSECTICIDE) [I24] PC1467 - HARV-SEEDING

КН.	№ ДЕТАЛИ	НАИМ. ДЕТАЛИ	К- ВО	SERIAL NO. OR YEAR	ПРИМЕЧАНИЯ
1	A24112	GUIDE	1	_____-1979	(SUB A37548)
1	A37548	ANGLE	1	_____-1985	
1	A50762B	ANGLE	1	1985-____	(SUB FOR A50762)